



CONDITION REPORT



Report No:
2017303943
DATE
28/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/09/2026		M57 Pretoria Road - 1619
Inspection Date	28/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	MAHINDRA	Registration Number	KLZ590NW
Model	KUV 100 NXT 1.2 K6+ MFALCON 5-DR [2018-2023]	Register Number	
		Date Of First Licensing	
VIN	MA1VC2RBCK6A84046	Last COR	
Engine Number		License Expiry Date	31/03/2026
Doors	5	Power / Displacement	
Color	GREY	Paint Finish	M - METALLIC
Year Model	2019	Fuel	PETROL
Km Reading	212,568 KM	Transmission	MANUAL
Cab / Body Type	STATION WAGON		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MA1VC2RBCK6A84046



CONDITION REPORT



Report No:
2017303943
DATE
28/09/2026

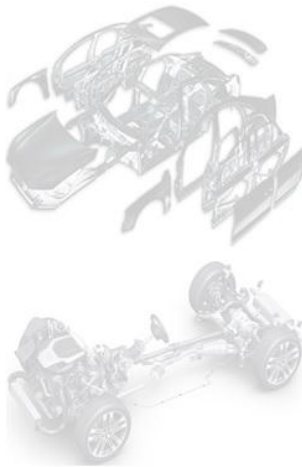

Damage	Repair Way
Engine Oil Sweat	Repair
Hoses Torn / Cut	Replace
Switch Electrical Window Winder rear left Defective	Repair
Tail Light Left Cracked	Replace
Seat Front Left Torn / Cut	Repair
Door Hinges Front Right Defective	Replace
Side Mirror Left Residual Traces of Repair	Repair
Side Mirror Right Residual Traces of Repair	Repair
Front Bumper Residual Traces of Repair	Repair
Bonnet Residual Traces of Repair	Repair
A • Pillar Right Corrosion	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Dull	Repair
Rear bumper Paintwork • Scratched	Repair
Roof Residual Traces of Repair	Repair
Windscreen Cracked	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tie Rod End right Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Rear Axle Welded	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Ball Joint(s) Front Axle Right Loose / Excessive Play	Replace
Tyre Rear Right Smooth	Replace
Engine mountings Loose / Excessive Play	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Engine Noise Excessive	Repair
Struggling to start	Repair
Warning lights illuminated	Repair
left rear electric window not closing	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.4	2.6	-	
Rear	1.9	2.1	-	
Emergency / Parking	0.4	0.6	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1VC2RBCK6A84046



CONDITION REPORT



Report No:
2017303943
DATE
28/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R14	86H	Dunlop	Sport	V	4723	4 mm
Front Right	185/65R14	86H	Dunlop	Sport	V	4723	3 mm
Rear Left	185/65R14	86H	Dunlop	Sport	V	4723	2 mm
Rear Right	185/65R14	86H	Dunlop	Sport	V	4723	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE MANAGEMENT SYSTEM	P030300	CYLINDER 3 MISFIRE DETECTED	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Bottom of engine is fully covered.

Body • Exterior: Signs of spray work done on body panels. Residual traces of poor repair on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1VC2RBCK6A84046



CONDITION REPORT



Report No:
2017303943
DATE
28/09/2026

Vehicle Information			
Name/Model	City	Year/Plate	Color
Registration	2017/303943	2017/303943	Grey
Engine/Transmission	1.8L/16V	1.8L/16V	1.8L/16V
Test results	Pass	Pass	Pass
Shock absorber test	Pass	Pass	Pass
Brake test	Pass	Pass	Pass
Steering test	Pass	Pass	Pass
Light test	Pass	Pass	Pass
Wash test	Pass	Pass	Pass
Final result	Pass	Pass	Pass

Shock and brake report

Vehicle Information			
Name/Model	City	Year/Plate	Color
Registration	2017/303943	2017/303943	Grey
Engine/Transmission	1.8L/16V	1.8L/16V	1.8L/16V
Test results	Pass	Pass	Pass
Shock absorber test	Pass	Pass	Pass
Brake test	Pass	Pass	Pass
Steering test	Pass	Pass	Pass
Light test	Pass	Pass	Pass
Wash test	Pass	Pass	Pass
Final result	Pass	Pass	Pass

Diagnostics report

Vehicle Information			
Name/Model	City	Year/Plate	Color
Registration	2017/303943	2017/303943	Grey
Engine/Transmission	1.8L/16V	1.8L/16V	1.8L/16V
Test results	Pass	Pass	Pass
Shock absorber test	Pass	Pass	Pass
Brake test	Pass	Pass	Pass
Steering test	Pass	Pass	Pass
Light test	Pass	Pass	Pass
Wash test	Pass	Pass	Pass
Final result	Pass	Pass	Pass

Diagnostics report

Vehicle Information			
Name/Model	City	Year/Plate	Color
Registration	2017/303943	2017/303943	Grey
Engine/Transmission	1.8L/16V	1.8L/16V	1.8L/16V
Test results	Pass	Pass	Pass
Shock absorber test	Pass	Pass	Pass
Brake test	Pass	Pass	Pass
Steering test	Pass	Pass	Pass
Light test	Pass	Pass	Pass
Wash test	Pass	Pass	Pass
Final result	Pass	Pass	Pass

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1VC2RBCK6A84046



CONDITION REPORT



Report No:
2017303943
DATE
28/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1VC2RBCK6A84046



CONDITION REPORT



Report No:
2017303943
DATE
28/09/2026




90 DEGREE REAR




90 DEGREE LEFT



LF TYRE TREAD

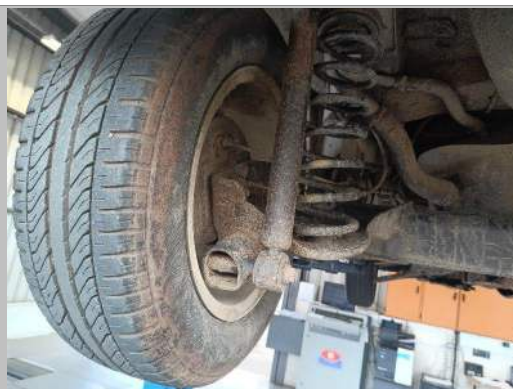

LR TYRE TREAD

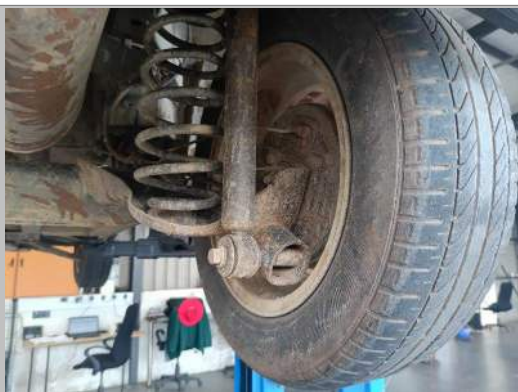

RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1VC2RBCK6A84046



CONDITION REPORT



Report No:

2017303943

DATE

28/09/2026



No sparewheel




LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

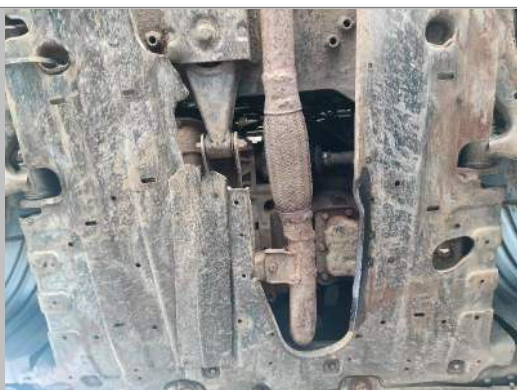

ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1VC2RBCK6A84046



CONDITION REPORT



Report No:
2017303943
DATE
28/09/2026



REAR



Expansion bottle



Oil cap and dipstick



Warning lights illuminated

[illegible]

Parking Brake Performance



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1VC2RBCK6A84046



CONDITION REPORT




Report No:

2017303943

DATE

28/09/2026

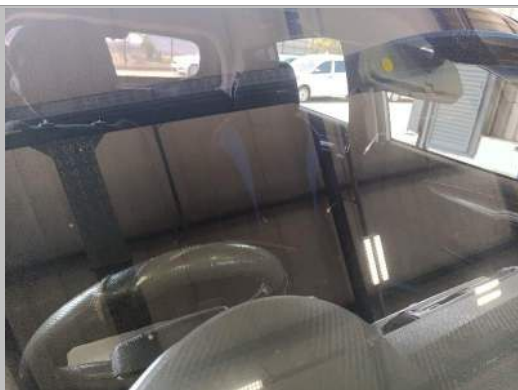

Windscreen



Front Fender Right



Door Front Right



Side Mirror Right



Door Rear Right



Tail Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1VC2RBCK6A84046



CONDITION REPORT



Report No:
2017303943
DATE
28/09/2026



Tail Light Left




Boot Lid / Hatch door



Front Fender Left



Side Mirror Left

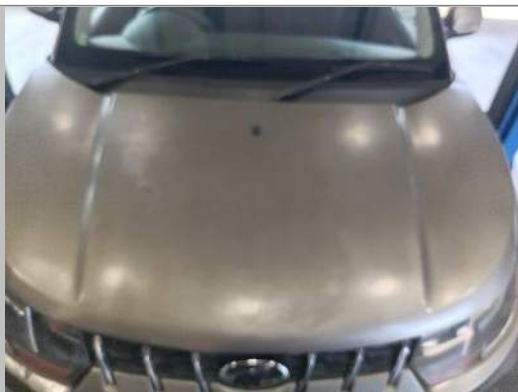

Bonnet



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1VC2RBCK6A84046



CONDITION REPORT



Report No:
2017303943
DATE
28/09/2026



Roof



Bonnet



Bonnet



Hoses



Engine mountings



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1VC2RBCK6A84046



CONDITION REPORT



Report No:
2017303943
DATE
28/09/2026



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1VC2RBCK6A84046



CONDITION REPORT



Report No:
2017303943
DATE
28/09/2026



Control Arm Bush(es) Front Axle Left



Ball Joint(s) Front Axle Right



Stabilizer Mounting Front Right



Tie Rod End right



CV Joint(s) Boot(s) Front Right (inner/outer)



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1VC2RBCK6A84046



CONDITION REPORT



Report No:
2017303943
DATE
28/09/2026



Engine



Rear Axle



Rear Axle



Rear Axle



Tyre Rear Right



A • Pillar Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1VC2RBCK6A84046



CONDITION REPORT




Report No:
2017303943
DATE
28/09/2026



Door Front Right



Door Hinges Front Right

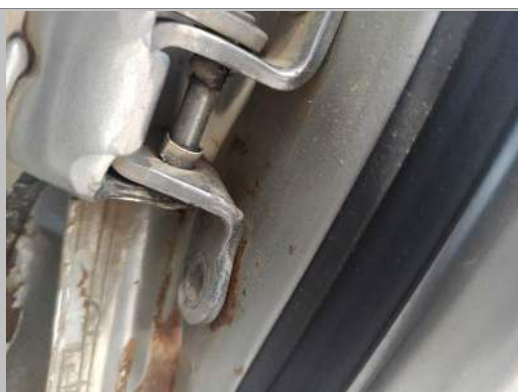

Door Hinges Front Right



Seat Front Left



Switch Electrical Window Winder rear left



Switch Electrical Window Winder rear left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1VC2RBCK6A84046