



CONDITION REPORT

Report No: 2016867662

DATE
07/05/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	07/05/2025		M57 Pretoria Road - 1619
Inspection Date	07/05/2025		Kempton Park - GT

Vehicle Data


Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	MAHINDRA	Registration Number	KR07NMGP
Model	BOLERO	Register Number	
VIN	MA1ZP2TAKN2C85912	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/03/2025
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	36,644 KM	Fuel	DIESEL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
C • Pillar Left Paintwork • Scratched	Repair
Rear Fender Left Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Tailgate Paintwork • Scratched	Repair
Load Body Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Mounting Rubber(s) Front Axle Left Cracked	Replace
Mounting Rubber(s) Front Axle Right Cracked	Replace

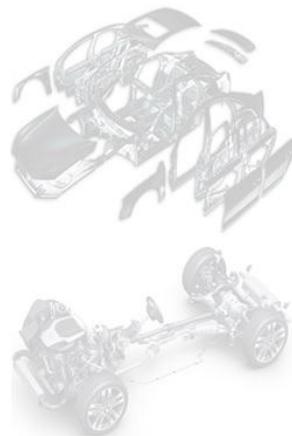

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1ZP2TAKN2C85912



CONDITION REPORT

Report No: 2016867662

DATE
07/05/2025

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.19	3.23	-	
Rear	1.76	1.88	-	
Emergency / Parking	1.68	1.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R15LT	106Q	Jk tyre	Radial	V	5121	5 mm
Front Right	195R15LT	106Q	Jk tyre	Radial	V	0522	5 mm
Rear Left	195R15LT	106Q	Jk tyre	Radial	V	0522	4 mm
Rear Right	195R15LT	106Q	Jk tyre	Radial	V	0522	4 mm
Spare	195R15LT	106Q	Jk tyre	Radial	V	5221	7 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Diagnostic could not be performed due to no data available and/or OBD interface malfunction.

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1ZP2TAKN2C85912



CONDITION REPORT

Report No: 2016867662

DATE
07/05/2025

Car		Car	
Model/Year	2014/2014	Model/Year	2014/2014
Registration	2014/2014	Registration	2014/2014
Colour	White	Colour	White
Engine	1.8L	Engine	1.8L
Transmission	5-Speed	Transmission	5-Speed
Drive	Front Wheel Drive	Drive	Front Wheel Drive
Chassis	2014/2014	Chassis	2014/2014
Wheels	15"	Wheels	15"
Tires	185/65 R15	Tires	185/65 R15
Weight	1500 kg	Weight	1500 kg
Capacity	1500 kg	Capacity	1500 kg
Max. Speed	180 km/h	Max. Speed	180 km/h
0-100	12.5 sec	0-100	12.5 sec
Consumption	7.5 L/100km	Consumption	7.5 L/100km
CO2	155 g/km	CO2	155 g/km
NOx	0.16 g/km	NOx	0.16 g/km
PM	0.005 g/km	PM	0.005 g/km
Brake	Disc	Brake	Disc
Steering	Power	Steering	Power
ABS	Yes	ABS	Yes
ESP	Yes	ESP	Yes
Stability Control	Yes	Stability Control	Yes
Adaptive Drive	No	Adaptive Drive	No
Electric Power Steering	Yes	Electric Power Steering	Yes
Electric Windows	Yes	Electric Windows	Yes
Electric Mirrors	Yes	Electric Mirrors	Yes
Electric Sunroof	No	Electric Sunroof	No
Electric Seats	No	Electric Seats	No
Electric Parking Brake	No	Electric Parking Brake	No
Electric Locking	No	Electric Locking	No
Electric Trunk	No	Electric Trunk	No
Electric Windows	Yes	Electric Windows	Yes
Electric Mirrors	Yes	Electric Mirrors	Yes
Electric Sunroof	No	Electric Sunroof	No
Electric Seats	No	Electric Seats	No
Electric Parking Brake	No	Electric Parking Brake	No
Electric Locking	No	Electric Locking	No
Electric Trunk	No	Electric Trunk	No

NO PLUG (NO DIAGNOSTIC)

Brake and shock absorber report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1ZP2TAKN2C85912



CONDITION REPORT

Report No: 2016867662

DATE
07/05/2025



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1ZP2TAKN2C85912



CONDITION REPORT

Report No: 2016867662

DATE
07/05/2025



RR TYRE TREAD



LR TYRE TREAD



RF TYRE TREAD



Spare wheel



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1ZP2TAKN2C85912



CONDITION REPORT

Report No: 2016867662


DATE
07/05/2025



ENGINE 1



Front chassis

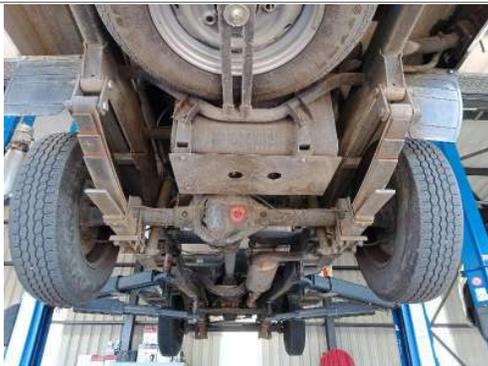

Rear chassis



Oil cap and dipstick



Spare wheel Accessories



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1ZP2TAKN2C85912



CONDITION REPORT

Report No: 2016867662

DATE
07/05/2025



Front Bumper



Bonnet



Windscreen



Rear Fender Left



Door Front Left



C • Pillar Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1ZP2TAKN2C85912



CONDITION REPORT

Report No: 2016867662

DATE
07/05/2025



Water level



Water level



Tailgate



Load Body



Mounting Rubber(s) Front Axle Right



Mounting Rubber(s) Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1ZP2TAKN2C85912



CONDITION REPORT

Report No: 2016867662

DATE
07/05/2025



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA1ZP2TAKN2C85912