



CONDITION REPORT



Report No:  
2017305339  
DATE  
30/09/2026

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 30/09/2026        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 30/09/2026        |                     | Kempton Park -           |

Vehicle Data

|                 |                                  |                         |              |
|-----------------|----------------------------------|-------------------------|--------------|
| Vehicle Type    | PASSENGER VEHICLE                | Registered Owner        | MFC          |
| Manufacturer    | SUZUKI                           | Registration Number     | NO REG       |
| Model           | ERTIGA 1.5 GL MPV AT [2022-2025] | Register Number         |              |
| VIN             | MA3BNC22S00631969                | Date Of First Licensing |              |
| Engine Number   |                                  | Last COR                |              |
| Doors           | 5                                | License Expiry Date     |              |
| Color           | WHITE                            | Power / Displacement    |              |
| Year Model      | 2024                             | Paint Finish            | M - METALLIC |
| Km Reading      | 75,189 KM                        | Fuel                    | PETROL       |
| Cab / Body Type | SUV                              | Transmission            | AUTOMATIC    |

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MA3BNC22S00631969



## CONDITION REPORT



Report No:

2017305339

DATE

30/09/2026



## Damage

## Repair Way

|                                                      |         |
|------------------------------------------------------|---------|
| Door Handle Front Right Damaged                      | Repair  |
| Carpet Front Torn / Cut                              | Repair  |
| Front Bumper Paintwork • Scratched                   | Repair  |
| Bonnet slam plate (Shock tower/ Inner tray) Residual | Repair  |
| Traces of Repair                                     |         |
| Front Fender Right Residual Traces of Repair         | Repair  |
| Front Fender Right / Inner Tray Welded               | Repair  |
| Door Front Left Paintwork • Scratched                | Repair  |
| Door Front Right Dented                              | Repair  |
| Boot Lid / Hatch door Dented                         | Repair  |
| Windscreen Cracked                                   | Replace |
| Radiator Cross Member Residual Traces of Repair      | Repair  |
| Warning lights illuminated                           | Repair  |

## Brakes

## Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 1.9                | 1.9                | -                |                                  |
| Rear                | 2.3                | 2.8                | -                |                                  |
| Emergency / Parking | 2.1                | 1.9                | -                |                                  |

## Tyres and Rims

## Tyre Specification &amp; Measurement

|             | Size      | Load/Speed Index | Manufacture | Model   | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|---------|-------|-----------------|------------------|
| Front Left  | 185/65R15 | 88H              | Tracmak     | Privilo | V     | 4825            | 5 mm             |
| Front Right | 185/65R15 | 88H              | Tracmak     | Privilo | V     | 4825            | 5 mm             |
| Rear Left   | 185/65R15 | 88H              | Bridgestone | Ecopia  | V     | 1623            | 1 mm             |
| Rear Right  | 185/65R15 | 88H              | Bridgestone | Ecopia  | V     | 1623            | 3 mm             |
| Spare       | 185/65R15 | 88H              | Bridgestone | Ecopia  | V     | 0000            | 1 mm             |

\* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.  
 97 Willem Cruywagen Ave  
 Klerksoord, Pretoria, 0200  
 Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MA3BNC22S00631969



## CONDITION REPORT



Report No:

2017305339

DATE

30/09/2026

## Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System | Code     | Description                    | Status |
|----|--------|----------|--------------------------------|--------|
| 1  | AIRBAG | B1032-00 | FRONT AIRBAG DEPLOYMENT RECORD |        |

## Inspection Conditions

No Test Drive

Rain at time of inspection

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

## Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. BODY EXTERIOR - SIGNS OF SPRAY WORK DONE ON BODY PANELS / RESIDUAL TRACES OF POOR REPAIR ON BODY PANELS

## Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

## Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MA3BNC22S00631969



## CONDITION REPORT



Report No:  
2017305339  
DATE  
30/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MA3BNC22S00631969



## CONDITION REPORT



Report No:

2017305339

DATE

30/09/2026



INTERIOR (FRONT DRIVER DOOR)



Automatic transmission



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



VIN PLATE OR STICKER



No license disc

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MA3BNC22S00631969



## CONDITION REPORT



Report No:  
2017305339  
DATE  
30/09/2026



ENGINE 1



ENGINE 2



CHASSIS



REAR



Oil cap and dipstick



Coolant reservoir

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MA3BNC22S00631969




## CONDITION REPORT



Report No:  
2017305339  
DATE  
30/09/2026



Sparewheel

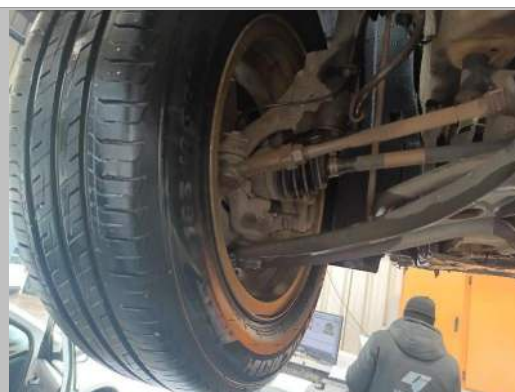

LF TYRE TREAD




LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

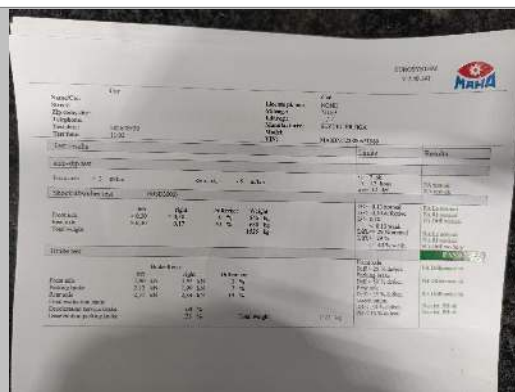

Shock and brake report

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: MA3BNC22S00631969




## CONDITION REPORT



Report No:  
2017305339  
DATE  
30/09/2026

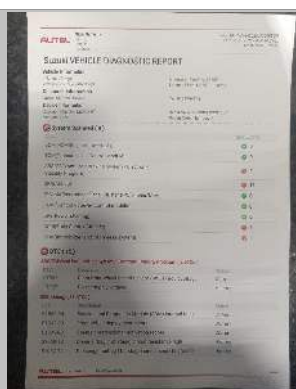

Diagnostic Report page 1

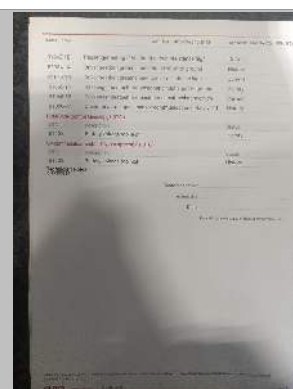

Diagnostic Report page 2



Warning lights illuminated



Windscreen



Windscreen



Door Front Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MA3BNC22S00631969



## CONDITION REPORT



Report No:  
2017305339  
DATE  
30/09/2026



Door Front Left



Door Handle Front Right



Front Fender Right



Front Fender Right / Inner Tray



Front Fender Right / Inner Tray



Front Fender Right / Inner Tray

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MA3BNC22S00631969



## CONDITION REPORT



Report No:  
2017305339  
DATE  
30/09/2026



Front Fender Right / Inner Tray



Bonnet slam plate (Shock tower/ Inner tray)



Bonnet slam plate (Shock tower/ Inner tray)



Bonnet slam plate (Shock tower/ Inner tray)



Radiator Cross Member



Radiator Cross Member

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MA3BNC22S00631969



## CONDITION REPORT



Report No:

2017305339

DATE

30/09/2026



Radiator Cross Member



Front Bumper



Door Front Left



Boot Lid / Hatch door



Radiator Cross Member



Carpet Front

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MA3BNC22S00631969