



CONDITION REPORT



Report No:
2017295717
DATE
08/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/09/2026		M57 Pretoria Road - 1619
Inspection Date	08/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	SUZUKI	Registration Number	DD06XDZN
Model	ERTIGA 1.5 GA MPV [2022-2025]	Register Number	
VIN	MA3BNC22S00A35249	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	SILVER	Power / Displacement	
Year Model	2025	Paint Finish	TWO COAT UNI
Km Reading	67,654 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00A35249



CONDITION REPORT



Report No:
2017295717
DATE
08/09/2026



Damage

Repair Way

Indicator Light Front Right Damaged	Replace
Tail Light Right Damaged	Replace
Headlight Left Damaged	Replace
Headlight Right Scratched	Replace
Hood Lining Dirty	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Damaged	Repair
A • Pillar Left Damaged	Repair
C • Pillar Right Paintwork • Scratched	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Paintwork • Scratched	Repair
Front Fender Left / Inner Tray Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Damaged	Repair
Door Rear Right Paintwork • Scratched	Repair
Sill Panel Left Damaged	Repair
Windscreen Chipped	Repair
Window Front Door Left Defective	Repair
Rim Front Right Dented	Repair
Rim Rear Left Dented	Repair
Belly plates Damaged	Repair
Deceleration parking brake defective	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.91	3.32	-	
Rear	2.01	2.25	-	
Emergency / Parking	0.97	1.12	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65 R15	88H	Centara	Touring	V	1426	4 mm
Front Right	185/65 R15	88H	Centara	Touring	V	1326	4 mm
Rear Left	185/65 R15	88H	Bridgestone	Ecopia	V	1225	1 mm
Rear Right	185/65 R15	88H	Kumho	Solus	V	2516	1 mm
Spare	185/65 R15	88H	Bridgestone	Ecopia	V		2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00A35249



CONDITION REPORT



Report No:
2017295717
DATE
08/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS/ESP(ANTI-LOCK BRAKING SYSTEM/ELECTRONIC STABIL	C1057	POWER SUPPLY VOLTAGE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE EXTERIOR AND INTERIOR ELECTRICAL AND MECHANICAL PARTS. Interior: Vehicle interior dirty and panels scratched. Rear left and right storage lids missing.
Body • Exterior: Poor residual traces of repair on body panels. Body panels misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels. Front left window does not close properly
Undercarriage: Vehicle undercarriage dirty

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00A35249




CONDITION REPORT



Report No:
2017295717
DATE
08/09/2026



LICENSE DISC

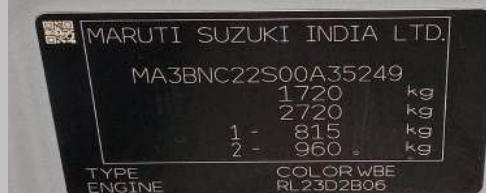

VIN PLATE OR STICKER



FRONT RIGHT CORNER



90 DEGREE FRONT



90 DEGREE LEFT



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00A35249



CONDITION REPORT



Report No:
2017295717
DATE
08/09/2026



90 DEGREE REAR



90 DEGREE RIGHT



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00A35249



CONDITION REPORT



Report No:
2017295717
DATE
08/09/2026



ENGINE 1



Oil cap and dipstick



Front chassis



Rear chassis



Spare Wheel



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00A35249



CONDITION REPORT




Report No:
2017295717
DATE
08/09/2026




LR TYRE TREAD



RR TYRE TREAD

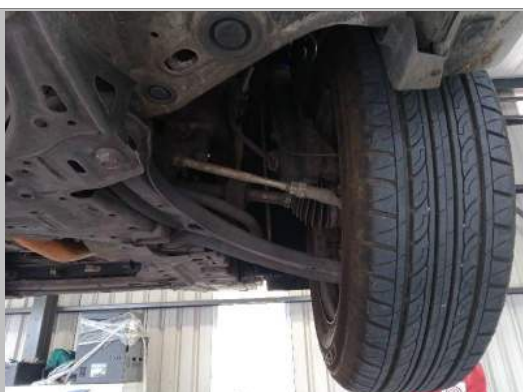


RF TYRE TREAD

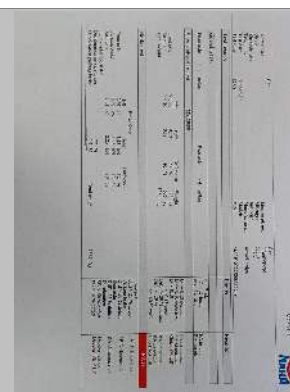

Brake and shock absorber report



Diagnostic report page 1

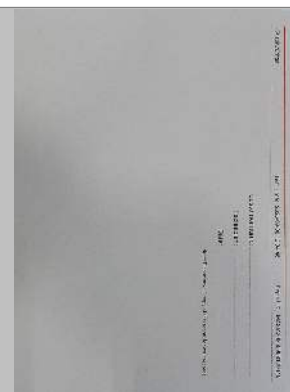

Diagnostic report page 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00A35249



CONDITION REPORT



Report No:
2017295717
DATE
08/09/2026



Spare Wheel Accessories



C • Pillar Right



Rear Fender Right



Rear Fender Right



Door Rear Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00A35249



CONDITION REPORT



Report No:
2017295717
DATE
08/09/2026



Door Front Right



Door Front Right



Front Fender Right



Bonnet



Front Fender Left



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00A35249



CONDITION REPORT



Report No:
2017295717
DATE
08/09/2026



Door Front Left



Door Rear Left



Rear Fender Left



A • Pillar Left



Tail Light Right



Hood Lining

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00A35249



CONDITION REPORT



Report No:
2017295717
DATE
08/09/2026



Indicator Light Front Right



Front Fender Left / Inner Tray



Headlight Left



Rim Front Right



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00A35249



CONDITION REPORT



Report No:
2017295717
DATE
08/09/2026



Headlight Right



Front Bumper



Sill Panel Left



Rim Rear Left



Belly plates



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00A35249

**CONDITION REPORT**

Report No:
2017295717
DATE
08/09/2026



Window Front Door Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00A35249