

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/05/2025		M57 Pretoria Road - 1619
Inspection Date	08/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	SUZUKI	Registration Number	NONE
Model	S-PRESSO 1.0 GL+ [2020-2022]	Register Number	
VIN	MA3RFL41S00372834	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	GREY	Power / Displacement	
Year Model	2022	Paint Finish	TWO COAT UNI
Km Reading	144,899 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Air Conditioner Insufficient	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Door Lock Front Right Damaged	Replace
Boot Carpet Damaged	Repair
Mirror Adjusters Damaged	Replace
Steering Wheel Trim Defective	Repair
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair
B • Pillar Right Dented	Repair
Front Fender Left Dented	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Dented	Repair
Door Front Left Damaged	Repair
Door Front Right Paintwork • Scratched	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3RFL41S00372834

Damage	Repair Way
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Dented	Repair
Sill Panel Left Dented	Repair
Roof Paintwork • Scratched	Repair
Rear Axle Welded	Replace
Tyre Front Left Damaged	Replace
Tyre Rear Left Damaged	Replace
Main Beam Left Damaged	Repair
Main Beam Right Scratched	Repair
Chassis Dented	Repair
Silencer Welded	Replace
Radiator Cradle Damaged	Replace
Clutch Operation Incorrect	Repair
Body and Exterior	Vehicle license disk missing
Tyres and rims	Spare wheel missing
Engine	Engine bay dirty.
Engine	Fan Cowley damaged
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Signs of impact damage to front of vehicle
Engine	Foreign substance inside the radiator
Interior	Vehicle interior dirty and some panels scratched
Interior	Steering column cover strapped with cable ties
Vehicle electronics malfunctioning	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.67	1.79	-	
Rear	1.02	0.98	-	
Emergency / Parking	0.84	0.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70 R14	81S	MRF	ZVTV	V	1722	2 mm
Front Right	165/70 R14	81T	Ceat	Ecodrive	V	2023	5 mm
Rear Left	165/70 R14	81S	MRF	Ecotred	V	1722	5 mm
Rear Right	165/70 R14	81S	MRF	ZVTV	V	1723	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE/POWERTRAIN	P0136	OXYGEN SENSOR(BANK 1 SENSOR 2)	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

Vehicle Information				Limits		Results
Name/Co.	Car	License pl. No.	Car	CC	1.6	1.6
Model		Registration	Model	7-12 km/h	12 km/h	12 km/h
Registration		Manufacturer	MAH			
Test date	2024/05/01	Model	MAH			
Test time	11:10	Model	MAH			
Test results				Limits		Results
Side-slip test				Limits		Results
Front axle	7.1 km/h	Rear axle	7.1 km/h	7.1 km/h	7.1 km/h	7.1 km/h
Shock absorber test (MILIORE)				Limits		Results
Front axle	1.01	Rear axle	1.01	1.01	1.01	1.01
Front axle	0.030	Rear axle	0.030	0.030	0.030	0.030
Brake test				Limits		Results
Front axle	1.01	Rear axle	1.01	1.01	1.01	1.01
Front axle	0.030	Rear axle	0.030	0.030	0.030	0.030
Brake test				Limits		Results
Front axle	1.01	Rear axle	1.01	1.01	1.01	1.01
Front axle	0.030	Rear axle	0.030	0.030	0.030	0.030
Brake test				Limits		Results
Front axle	1.01	Rear axle	1.01	1.01	1.01	1.01
Front axle	0.030	Rear axle	0.030	0.030	0.030	0.030

Brake and shock absorber report

Vehicle Information				Limits		Results
Name/Co.	Car	License pl. No.	Car	CC	1.6	1.6
Model		Registration	Model	7-12 km/h	12 km/h	12 km/h
Registration		Manufacturer	MAH			
Test date	2024/05/01	Model	MAH			
Test time	11:10	Model	MAH			
Test results				Limits		Results
Side-slip test				Limits		Results
Front axle	7.1 km/h	Rear axle	7.1 km/h	7.1 km/h	7.1 km/h	7.1 km/h
Shock absorber test (MILIORE)				Limits		Results
Front axle	1.01	Rear axle	1.01	1.01	1.01	1.01
Front axle	0.030	Rear axle	0.030	0.030	0.030	0.030
Brake test				Limits		Results
Front axle	1.01	Rear axle	1.01	1.01	1.01	1.01
Front axle	0.030	Rear axle	0.030	0.030	0.030	0.030
Brake test				Limits		Results
Front axle	1.01	Rear axle	1.01	1.01	1.01	1.01
Front axle	0.030	Rear axle	0.030	0.030	0.030	0.030

Diagnostic report page 1

Vehicle Information				Limits		Results
Name/Co.	Car	License pl. No.	Car	CC	1.6	1.6
Model		Registration	Model	7-12 km/h	12 km/h	12 km/h
Registration		Manufacturer	MAH			
Test date	2024/05/01	Model	MAH			
Test time	11:10	Model	MAH			
Test results				Limits		Results
Side-slip test				Limits		Results
Front axle	7.1 km/h	Rear axle	7.1 km/h	7.1 km/h	7.1 km/h	7.1 km/h
Shock absorber test (MILIORE)				Limits		Results
Front axle	1.01	Rear axle	1.01	1.01	1.01	1.01
Front axle	0.030	Rear axle	0.030	0.030	0.030	0.030
Brake test				Limits		Results
Front axle	1.01	Rear axle	1.01	1.01	1.01	1.01
Front axle	0.030	Rear axle	0.030	0.030	0.030	0.030
Brake test				Limits		Results
Front axle	1.01	Rear axle	1.01	1.01	1.01	1.01
Front axle	0.030	Rear axle	0.030	0.030	0.030	0.030

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT




90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

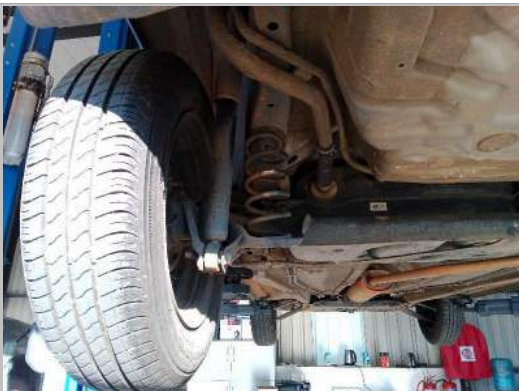

RF TYRE TREAD



RR TYRE TREAD



LR TYRE TREAD



Spare wheel Accessories



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Fan Cowley



Oil cap and dipstick



Steering Wheel Trim



Mirror Adjusters



Seat Front Right



Seat Rear



Rear Fender Right



Door Rear Right



Door Front Right



Side Mirror Right



Front Fender Right



B • Pillar Right



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Side Mirror Left



Door Front Left



Door Rear Left



Rear Fender Left



Seat Front Left



Sill Panel Left



Rear bumper



Rear bumper



Roof



Boot Lid / Hatch door



Boot Carpet



Inner Boot Floor Pan and Spare Wheel Well



Water level



Engine



Tyre Rear Left



Tyre Front Left



Radiator Cradle



Main Beam Left



Tyre Front Left



Main Beam Right



Chassis



Silencer



Rear Axle



Water level



Air Conditioner



Door Lock Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3RFL41S00372834