



CONDITION REPORT

Report No: 2016835778

DATE
09/04/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/04/2025		M57 Pretoria Road - 1619
Inspection Date	09/04/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	FORD	Registration Number	BG43TWGP
Model	FIGO 1.4 TREND 5-DR [2010-2012]	Register Number	
VIN	MAJ1XXMRJ1BC02552	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2024
Color	BLUE	Power / Displacement	
Year Model	2011	Paint Finish	C - COMMON
Km Reading	338,171 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Caps Missing	Repair
Water level Insufficient	Repair
Air conditioner pipes Damaged	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Indicator Light Front Left Damaged	Replace
Indicator Light Front Right Damaged	Replace
Tail Light Left Damaged	Replace
Tail Light Right Cracked	Repair
Interior Mirror Missing	Replace
Side Mirror Left Paintwork • Scratched	Repair
Rear Upper Valance Welded	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Dented	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair



DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJ1XXMRJ1BC02552



CONDITION REPORT

Report No: 2016835778

DATE
09/04/2025

Damage	Repair Way
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Rear bumper Residual Traces of Repair	Repair
Inner Boot Floor Pan and Spare Wheel Well Residual Traces of Repair	Repair
Sill Panel Left Dented	Repair
Sill Panel Right Dented	Repair
Steering Rack Boot Right Damaged	Replace
Tyre Rear Left Smooth	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Loose / Excessive Play	Repair
Gear Selections Insufficient	Repair
Body exterior	Vehicle got some scratches, stone chips and dents
Body exterior	Signs of spray work done on some body panels
Body exterior	Signs of repair work done on some body panels
Dipstick damage	Replace
L/F kick panel loose	Repair
Loose wires in the boot	Repair
L/F fender liner damage	Replace
Water leak	Vehicle got water leak can't pin point water leak
ABS light on	Repair
Bonnet not closing properly	Repair
Both front fog lights malfunction	Repair
Front suspension noisy	Repair
Airbag light on	Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.7	2.4	-	
Rear	1.4	1.4	-	
Emergency / Parking	0.9	1.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65R14	86T	Roadshine	Rs906	V	1628	2 mm
Front Right	175/65R14	86T	Roadshine	Rs906	V	1723	3 mm
Rear Left	175/65R14	82H	Rapid	P309	V	1419	0 mm
Rear Right	175/65R14	86T	Roadshine	Rs906	V	1623	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJ1XXMRJ1BC02552



CONDITION REPORT

Report No: 2016835778

DATE
09/04/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	CMDTCS	B1318	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za


VIN: MAJ1XXMRJ1BC02552




CONDITION REPORT

Report No: 2016835778


DATE
09/04/2025

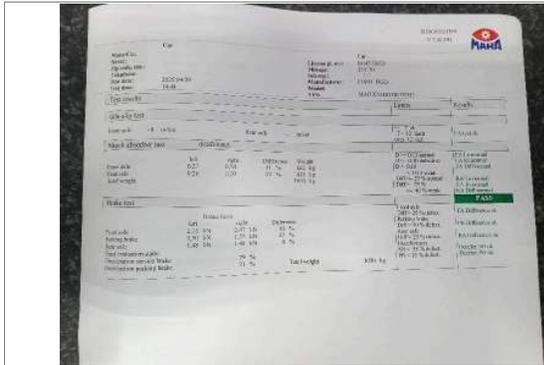

Shock and brake report

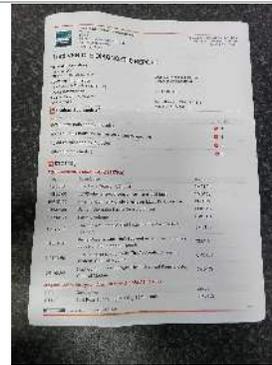

Diagnostic report

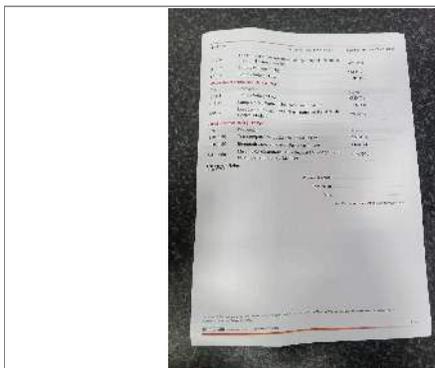

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJ1XXMRJ1BC02552



CONDITION REPORT

Report No: 2016835778

DATE
09/04/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJ1XXMRJ1BC02552



CONDITION REPORT

Report No: 2016835778

DATE
09/04/2025



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



No spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJ1XXMRJ1BC02552



CONDITION REPORT

Report No: 2016835778

DATE
09/04/2025



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Dipstick damage

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJ1XXMRJ1BC02552



CONDITION REPORT

Report No: 2016835778

DATE
09/04/2025



Oil cap and dipstick



L/F kick panel loose



Expansion bottle



Water level



Caps



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJ1XXMRJ1BC02552



CONDITION REPORT

Report No: 2016835778

DATE
09/04/2025



Center Console / Cubbyhole + Lid



Interior Mirror



Rear Upper Valance



Inner Boot Floor Pan and Spare Wheel Well



Rear Upper Valance



Tail Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJ1XXMRJ1BC02552



CONDITION REPORT

Report No: 2016835778

DATE
09/04/2025



Tail Light Right



Indicator Light Front Right




Indicator Light Front Left



Bolt(s) / Nut(s) Front Wheel Left



Bolt(s) / Nut(s) Front Wheel Right

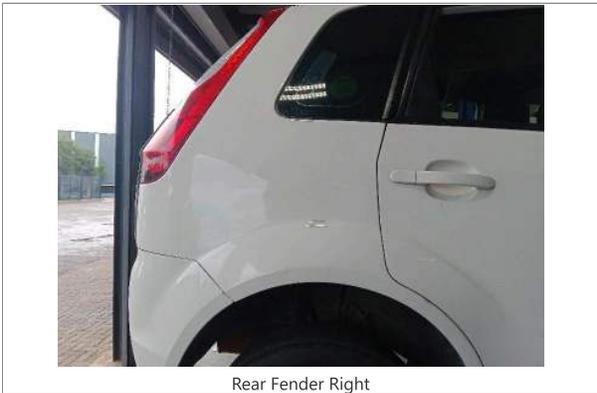

Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJ1XXMRJ1BC02552



CONDITION REPORT

Report No: 2016835778

DATE
09/04/2025



Door Rear Right



Sill Panel Right



Door Front Right



Front Fender Right



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJ1XXMRJ1BC02552



CONDITION REPORT

Report No: 2016835778

DATE
09/04/2025



Front Fender Left



Door Front Left



Side Mirror Left



Sill Panel Left



Door Rear Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJ1XXMRJ1BC02552



CONDITION REPORT

Report No: 2016835778

DATE
09/04/2025



Rear bumper



Rear bumper



Boot Lid / Hatch door



Inner Boot Floor Pan and Spare Wheel Well



Tyre Rear Left



Steering Rack Boot Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJ1XXMRJ1BC02552



CONDITION REPORT

Report No: 2016835778

DATE
09/04/2025



Engine



Air conditioner pipes



CV Joint(s) Boot(s) Front Right (inner/outer)



CV Joint(s) Boot(s) Front Left (inner/outer)



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJ1XXMRJ1BC02552