



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572

**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/04/2024		M57 Pretoria Road - 1619
Inspection Date	11/04/2024		Kempton Park - GT

**Vehicle Data**

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	FORD	Registration Number	DW22ZLGP
Model	IKON	Register Number	
VIN	MAJBXXMRTBFE28629	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/03/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	291,972 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

**Vehicle Options & Accessories****Items**

## VEHICLE INSPECTION



Damage	Repair Way
Engine Management Lights Set	Repair
Tail Light Right Damaged	Replace
Headlight Right Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Bonnet slam plate (Shock tower/ Inner tray) Damaged	Repair
B • Pillar Right Damaged	Repair
C • Pillar Right Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Roof Damaged	Repair
Windscreen Damaged	Repair
Brake disc 1. Axle left Worn	Replace
Brake disc 1. Axle right Worn	Replace
Tyre Rear Right Worn	Replace
Gearbox Oil Leak	Replace
Engine Performance Insufficient	Repair
Engine Noise Excessive	Repair
Body and exterior	Minor dents and scratches and stone chips.
Body and exterior	Signs of repair work done to somebody panels.
Body and exterior	Poor alignment to some body panels.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MAJBXXMRTBFE28629

1 / 12



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

Damage		Repair Way
Vehicle		Vehicle electronics malfunctioning.
Vehicle		Driver side door does not open from outside
Airbag warning light illuminated		Repair

### Brakes

#### Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [kN]	Braking Force [kN]		
Front	2.77	2.06	-	
Rear	1.53	1.65	-	
Emergency / Parking	1.43	1.73	-	

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/55R15	85V	Sumitomo	Radial	V	1321	2 mm
Front Right	195/55R15	85V	Sumitomo	Radial	V	1321	2 mm
Rear Left	195/55R15	82V	Sumitomo	Radial	V	1321	2 mm
Rear Right	195/55R15	85H	Goodyear	Eagle	V	1215	0 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

### Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



## CONDITION REPORT


VIN: 1V1ABDMM7B5530626

Report No: 20165376996


2 / 12

DATE


11/04/2024

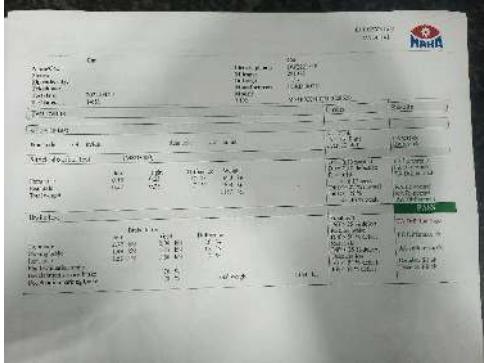

Brake and shock test

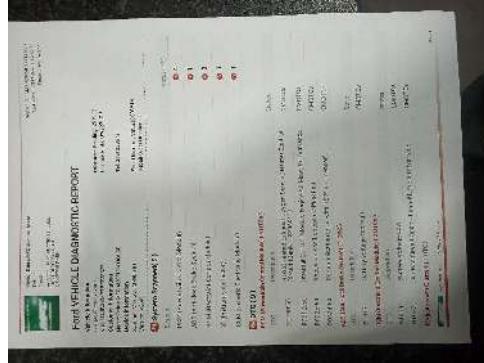

Diagnostic report

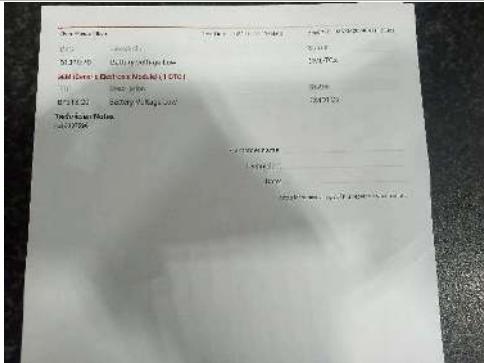

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



## CONDITION REPORT

Report No: 2016337596

VIN: MAJBXXMRTBFE28629

DATE

11/04/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016337596

DATE

VIN: MAJBXXM1T0042024

4 / 12



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

VIN: MAJBXXMRTBFE28629

5 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

90 DEGREE LEFT




LF TYRE TREAD

6 / 12



LR TYRE TREAD

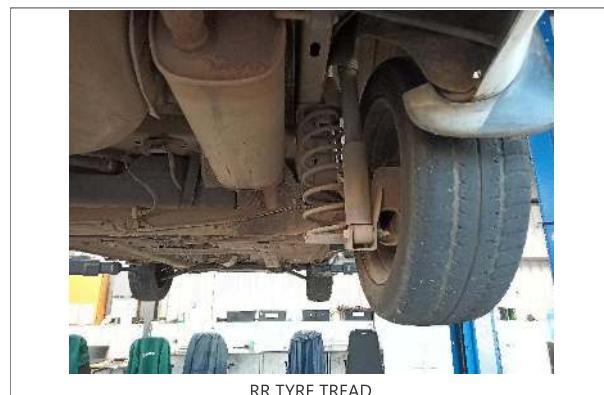

RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

7/20



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

VIN: MAJBXXMRTBFE28629

7 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

VIN PLATE OR STICKER



8 / 12

ENGINE 1



Undercarriage rear.



Undercarriage front.



Oil cap and dipstick



Water level



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

VIN: MAJBXXMRTBFE28629

9 / 12



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

Bonnet slam plate (Shock tower/ Inner tray)



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Door Front Left



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

VIN: MAJBXXMRTBFE28629

11 / 12



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

Door Rear Left



Rear Fender Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



Front Fender Right



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

Rear Fender Right



Door Front Right



Door Rear Right



C • Pillar Right



B • Pillar Right



Roof



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

Windscreen



Tail Light Right



Headlight Right



Tyre Rear Right



Brake disc 1. Axle left



Brake disc 1. Axle right



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

Gearbox



## CONDITION REPORT

Report No: 2016337596

DATE  
11/04/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)