



CONDITION REPORT



Report No:
2017303398
DATE
25/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/09/2026		M57 Pretoria Road - 1619
Inspection Date	25/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	FORD	Registration Number	KG385MP
Model	FIGO 1.5 TREND FREESTYLE 5-DR [2020-2021]	Register Number	
VIN	MAJGXXMTKGLL72852	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2021	Paint Finish	TWO COAT UNI
Km Reading	87,096 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MAJGXXMTKGLL72852



CONDITION REPORT



Report No:
2017303398
DATE
25/09/2026

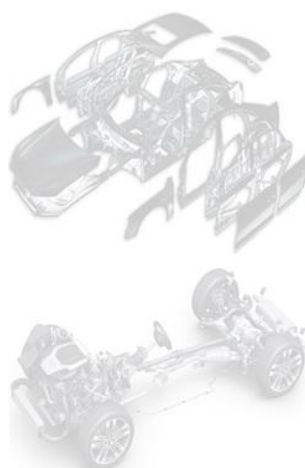

Damage	Repair Way
Engine Damaged	Repair
Engine Wiring Damaged	Repair
Fan Belt Worn	Repair
Radiator Deformed	Replace
Water level Insufficient	Replace
Air conditioner pipes Damaged	Replace
Bonnet cable Damaged	Replace
Central Air Vent Damaged	Replace
Center Console / Cubbyhole + Lid Damaged	Replace
Engine Management Lights Set	Repair
Tail Light Right Damaged	Replace
Fog Light Front Left Damaged	Replace
Fog Light Front Right Damaged	Replace
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Damaged	Repair
Rear Axle Poor Alignment	Repair
Tyre Front Left Worn	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Spare Tyre Worn	Replace
Rim Front Right Damaged	Replace
Radiator Cradle Damaged	Replace
Engine Noise Excessive	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.64	2.43	-	
Rear	1.31	1.55	-	
Emergency / Parking	0.71	0.87	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGLL72852



CONDITION REPORT



Report No:
2017303398
DATE
25/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	92T	Dunlop	Sp	V	2025	0 mm
Front Right	185/60R15	84H	Continental	Contipremiu	V	0424	1 mm
Rear Left	185/60R15	84H	Sumitomo	Radial	V	2524	0 mm
Rear Right	185/60R15	88H	Autogrip	Radial	V	3922	0 mm
Spare	175/65R14	82H	Firestone	Radial	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PCM	P06E9:00-28	ENGINE STARTER PERFORMANCE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: 20 DTC'S AT TIME OF TESTING SEE DTC REPORT. VEHICLE STRUGGLES TO SELECT GEARS.ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Battery loose. fan cowling damaged. sump damage. signs of water leak cannot pinpoint. non-standard radiator fitted to vehicle.

Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels. Repair work done to vehicle below standard. Signs of impact damage to front of vehicle.

Axle and Suspension: signs of vehicle crabbing.

Road Test: gear lever extremely loose.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGLL72852



CONDITION REPORT



Report No:

2017303398

DATE

25/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE LEFT



90 DEGREE RIGHT



90 DEGREE FRONT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGLL72852



CONDITION REPORT



Report No:

2017303398

DATE

25/09/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual.



LR TYRE TREAD



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGLL72852



CONDITION REPORT



Report No:
2017303398
DATE
25/09/2026



RF TYRE TREAD



RR TYRE TREAD



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGLL72852



CONDITION REPORT



Report No:
2017303398
DATE
25/09/2026




VIN PLATE OR STICKER




LICENSE DISC MISSING



BRAKE TEST REPORT

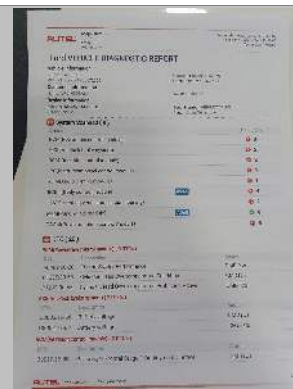

DIAGNOSTIC REPORT PAGE 1

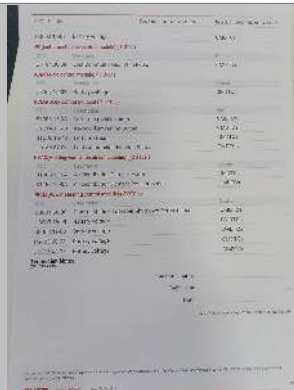

DIAGNOSTIC REPORT PAGE 2



Bonnet cable

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGLL72852



CONDITION REPORT



Report No:
2017303398
DATE
25/09/2026



Bonnet cable



Bonnet cable



Engine Wiring



Engine Wiring



Water level



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGLL72852



CONDITION REPORT



Report No:

2017303398

DATE

25/09/2026



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Rear Fender Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGLL72852



CONDITION REPORT



Report No:
2017303398
DATE
25/09/2026



Door Rear Left



Rear bumper




Rear bumper



Door Front Right



Door Rear Right

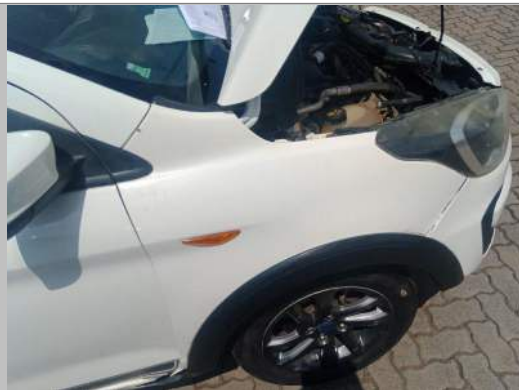

Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGLL72852



CONDITION REPORT



Report No:

2017303398

DATE

25/09/2026



Rear Fender Right



Sill Panel Right



Sill Panel Left



Boot Lid / Hatch door



Tail Light Right



Headlight Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGLL72852



CONDITION REPORT



Report No:

2017303398

DATE

25/09/2026



Headlight Left



Central Air Vent



Tyre Front Right



Rim Front Right



Front Bumper



Radiator Cradle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGLL72852



CONDITION REPORT




Report No:

2017303398

DATE


25/09/2026

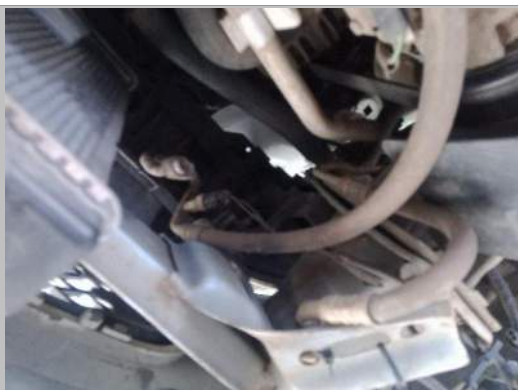

Air conditioner pipes



Radiator

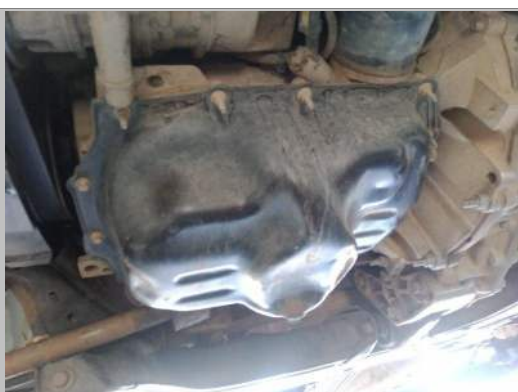


Engine



Fan Belt



Tyre Front Left

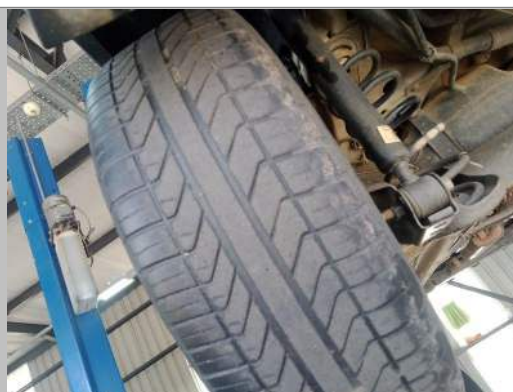

Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGLL72852



CONDITION REPORT



Report No:


2017303398

DATE

25/09/2026



Tyre Rear Right

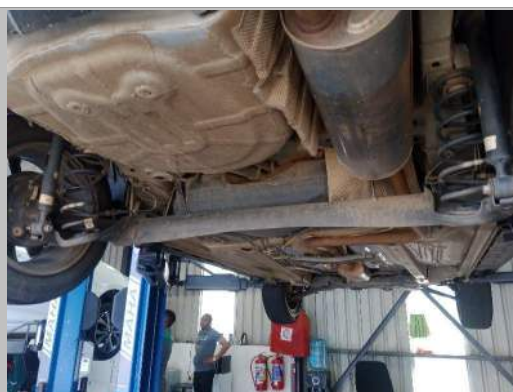

Rear Axle



Fog Light Front Left



Fog Light Front Right



Spare Tyre



Center Console / Cubbyhole + Lid

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGLL72852



CONDITION REPORT



Report No:
2017303398
DATE
25/09/2026



Engine Management Lights

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGLL72852