



CONDITION REPORT



Report No:
2016998456
DATE
01/09/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	01/09/2025		M57 Pretoria Road - 1619
Inspection Date	01/09/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	KPY501NW
Model	FIGO	Register Number	
VIN	MAJGXXMTKGMA00820	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	49,060 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MAJGXXMTKGMA00820



CONDITION REPORT



Report No:
2016998456
DATE
01/09/2025

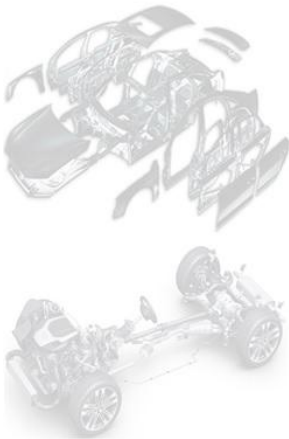	Damage	Repair Way
	Rear Fender Left Paintwork • Scratched	Repair
	Door Front Left Paintwork • Scratched	Repair
	Door Rear Left Paintwork • Scratched	Repair
	Rear bumper Paintwork • Scratched	Repair

Brakes
Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.2	2.3	-	
Rear	1.5	1.5	-	
Emergency / Parking	0.9	0.9	-	

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65R14	82T	Apollo	Alnac	V	4823	3 mm
Front Right	175/65R14	82T	Apollo	Alnac	V	4823	3 mm
Rear Left	175/65R14	82H	Apollo	Alnac	V	2421	4 mm
Rear Right	175/65R14	82H	Apollo	Alnac	V	2821	3 mm
Spare	175/65R14	82H	Apollo	Alnac	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGMA00820



CONDITION REPORT



Report No:
2016998456
DATE
01/09/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	CMDTCS	U3003:16-08	BATTERY VOLTAGE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGMA00820



CONDITION REPORT



Report No:
2016998456
DATE
01/09/2025

Car		Motorcycle		Bike	
Brand/Model		Brand/Model		Brand/Model	
Color		Color		Color	
Year		Year		Year	
Engine		Engine		Engine	
Price		Price		Price	
Location		Location		Location	
Condition		Condition		Condition	
Notes		Notes		Notes	

Category	Item	Value	Unit	Notes
Car	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	
Motorcycle	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	
Bike	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	

Category	Item	Value	Unit	Notes
Car	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	
Motorcycle	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	
Bike	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	

Category	Item	Value	Unit	Notes
Car	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	
Motorcycle	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	
Bike	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	

Category	Item	Value	Unit	Notes
Car	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	
Motorcycle	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	
Bike	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	

Category	Item	Value	Unit	Notes
Car	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	
Motorcycle	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	
Bike	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	

Category	Item	Value	Unit	Notes
Car	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	
Motorcycle	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	
Bike	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	

Category	Item	Value	Unit	Notes
Car	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	
Motorcycle	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	
Bike	Engine	1.8	cc	
	Transmission	5	speed	
	Brake	1.5	cc	
	Price	1.5	cc	

Category	Item	Value	Unit	Notes
----------	------	-------	------	-------

Shock and brake report

[illegible]

Diagnostic report

A blank, lined page from a notebook. The page features horizontal ruling lines and a vertical margin line on the left side. The paper appears slightly aged with some faint smudges. At the bottom of the page, there is a small, faint logo that reads "Autism Speaks" and some text that is partially obscured.

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGMA00820



CONDITION REPORT



Report No:
2016998456
DATE
01/09/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGMA00820



CONDITION REPORT



Report No:
2016998456
DATE
01/09/2025




90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD

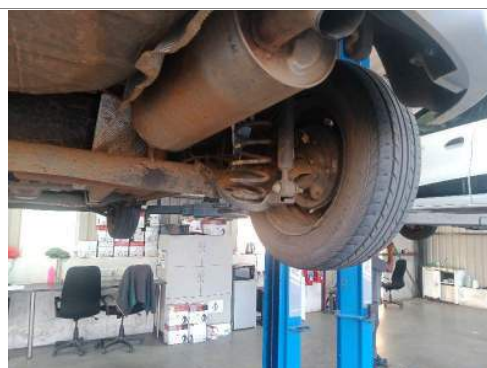

RR TYRE TREAD

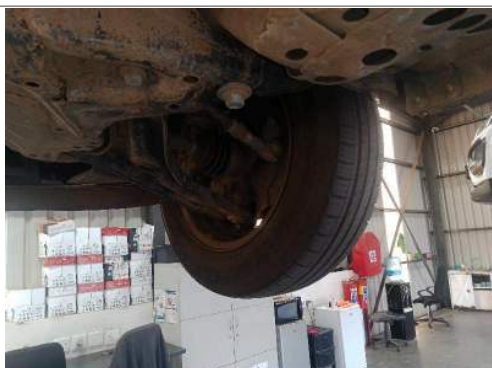

RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MAJGXXMTKGMA00820



CONDITION REPORT



Report No:
2016998456
DATE
01/09/2025

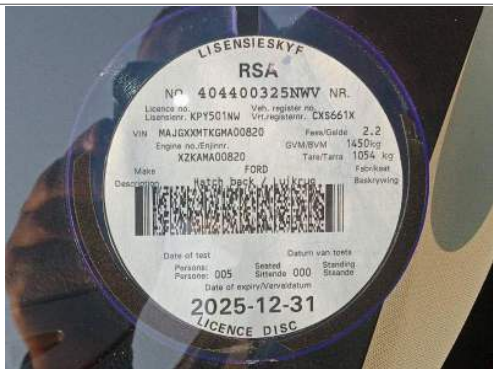

LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGMA00820



CONDITION REPORT



Report No:
2016998456
DATE
01/09/2025



Expection bottle



Water level



Rear Fender Left



Door Front Left



Door Rear Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJGXXMTKGMA00820