

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/03/2025		M57 Pretoria Road - 1619
Inspection Date	28/03/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	CY34JNGP
Model	I20 1.2 MOTION 5-DR [2012-2015]	Register Number	
VIN	MALBB51BLEM607770	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/10/2019
Color	GREY	Power / Displacement	
Year Model	2014	Paint Finish	TWO COAT UNI
Km Reading	137,977 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Caps Damaged	Replace
Radiator Water Leak	Replace
Air conditioner pipes Defective	Repair
Switch Electrical Window Winder front right Damaged	Replace
Windscreen Wiper Malfunction	Repair
Air Conditioner Insufficient	Replace
Number Plate Light Left Defective	Repair
Headlight Left Defective	Repair
Headlight Right Defective	Repair
Seat Front Left Dirty	Repair
Seat Front Right Damaged	Repair
Hood Lining Dirty	Repair
Door Panel Front Right Defective	Repair
Door Panel Rear Right Defective	Repair
Door Sealing Rubber Front Right Damaged	Replace
Door Sealing Rubber Rear Right Damaged	Replace
Boot Carpet Damaged	Repair
Boot Panel Left Defective	Repair
Boot Panel Right Defective	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51BLEM607770

Damage	Repair Way
Gear Lever Dust Boot Worn	Repair
Steering Wheel Trim Defective	Repair
Number Plate Front Damaged	Repair
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
B • Pillar Left Residual Traces of Repair	Repair
C • Pillar Left Residual Traces of Repair	Repair
Front Fender Left Damaged	Repair
Front Fender Right Dented	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Damaged	Repair
Front Fender Left / Inner Tray Damaged	Repair
Rear Fender Left / Inner Tray Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Doorstopper Rear Left Damaged	Replace
Boot Lid / Hatch door Damaged	Repair
Boot Lid / Hatch Door Shock Left Damaged	Replace
Boot Lid / Hatch Door Shock Right Damaged	Replace
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Dented	Repair
Sill Panel Left Residual Traces of Repair	Repair
Sill Panel Right Paintwork • Scratched	Repair
Roof Dented	Repair
Windscreen Cracked	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Shock Absorber Front Left Leak	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Damaged	Replace
Spare Tyre Damaged	Replace
Rim Front Left Dented	Repair
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Chassis Damaged	Repair
Sub Frame Damaged	Replace
Belly plates Damaged	Replace
Gearbox Oil Sweat	Repair
Fuel Tank Dented	Repair
Radiator Cradle Damaged	Replace
Steering Noisy	Repair
Engine Noise Excessive	Repair
Jack Missing	Replace
Wheel Spanner Missing	Replace
Triangle Missing	Replace
Warning lights illuminated on dashboard	Repair
Interior	Vehicle interior dirty and some panels scratched
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Some body panels misaligned
Body and Exterior	Dents and scratches on some body panels
Undercarriage	Vehicle undercarriage dirty
Tyres and rims	Front left and right hubcaps damaged
Tyres and rims	Front and rear tyre sizes different

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.23	2.42	-	
Rear	1.58	1.66	-	
Emergency / Parking	0.62	1.56	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60 R14	82H	Symmetry	SY201	V	4417	0 mm
Front Right	185/60 R14	82H	Symmetry	SY201	V	1919	0 mm
Rear Left	185/65 R14	86H	Kumho	Sense	V	4119	0 mm
Rear Right	185/65 R14	86H	Fullway	Radial	V	2815	0 mm
Spare	165/80 R13	83T	Regal	Radial	V		0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENG(ENGINE)	P0014	EXHAUST CAMSHAFT POSITION(CMP)B TIMING OVER-ADVANC	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual transmission



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



Front right hubcap



Front left hubcap



Oil cap and dipstick



Front chassis



Rear chassis




ENGINE 1




VIN PLATE OR STICKER




LICENSE DISC

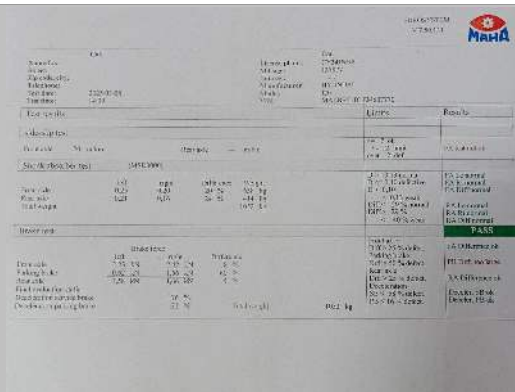

BRAKE AND SHOCK REPORT

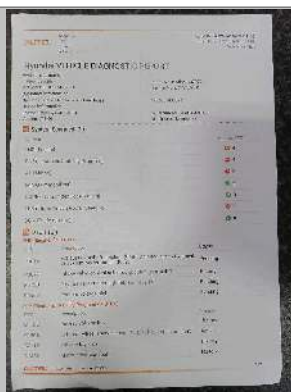

DIAGNOSTIC REPORT PAGE 1

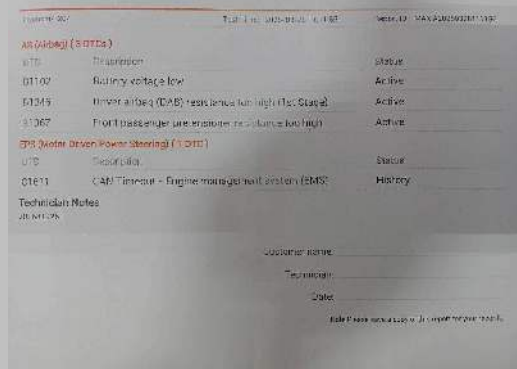


DIAGNOSTIC REPORT PAGE 2



Gear Lever Dust Boot



Steering Wheel Trim

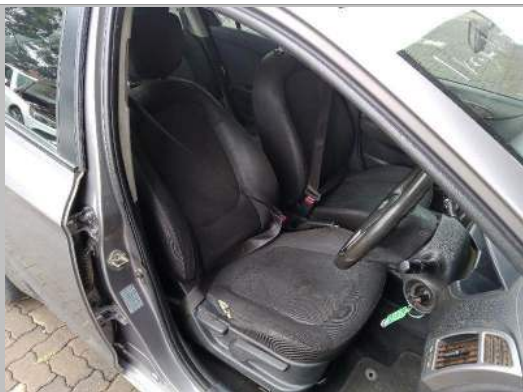

Seat Front Right



Door Sealing Rubber Front Right



Door Panel Front Right



Door Panel Rear Right



Door Sealing Rubber Rear Right



Rear Fender Right



Door Rear Right



Door Front Right



Front Fender Right



Side Mirror Right



Front Bumper



Front Bumper



Bonnet



Headlight Left



Headlight Right



Front Fender Left



Windscreen



Windscreen Wiper



Side Mirror Left



Rear Fender Left



Door Rear Left



Door Front Left



B • Pillar Left



Seat Front Left



Sill Panel Left



C • Pillar Left



C • Pillar Left



Doorstopper Rear Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



Roof



Hood Lining



Steering Wheel Trim



Air Conditioner



C • Pillar Left



Boot Lid / Hatch Door Shock Right



Boot Lid / Hatch Door Shock Left



Spare Tyre



Inner Boot Floor Pan and Spare Wheel Well




Boot Carpet



Boot Panel Left



Boot Panel Right

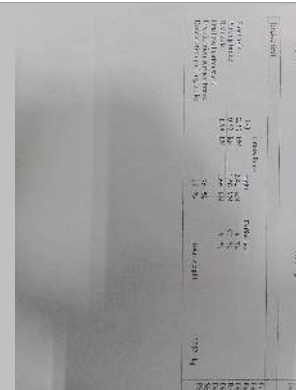

Parking Brake Performance



Engine



Water level



Sill Panel Right



Rear Fender Left / Inner Tray



Sill Panel Left



Bolt(s) / Nut(s) Front Wheel Left



Shock Absorber Front Left



Rim Front Left



Front Fender Left / Inner Tray



Belly plates



Radiator Cradle



Gearbox



Sub Frame



Chassis



Tyre Front Right



Tyre Front Left



Radiator



Air conditioner pipes



Fuel Tank



Tyre Rear Right



Tyre Rear Left



Number Plate Light Left



Caps



Water level



Caps



Number Plate Front



Switch Electrical Window Winder front right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51BLEM607770