



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/07/2025		M57 Pretoria Road - 1619
Inspection Date	30/07/2025		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	BT89BSGP
Model	I20 1.4 GL 5-DR [2009-2013]	Register Number	
VIN	MALBB51CLBM285653	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2025
Color	RED	Power / Displacement	
Year Model	2012	Paint Finish	TWO COAT UNI
Km Reading	246,704 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025

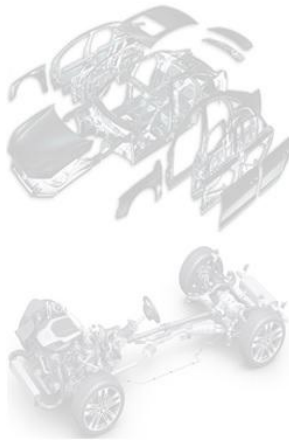

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Fan Belt Damaged	Replace
Radiator Damaged	Replace
Battery box Damaged	Replace
Air conditioner pipes Defective	Repair
Indicator Switch Damaged	Replace
Air Conditioner Insufficient	Replace
Headlight Left Damaged	Replace
Headlight Right Defective	Repair
Seat Rear Damaged	Repair
Sun Visor Left Defective	Repair
Sun Visor Right Defective	Repair
Door Handle Front Right Damaged	Replace
Door Handle Rear Left Damaged	Replace
Boot Carpet Damaged	Repair
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Bonnet Dented	Repair
Bonnet slam plate (Shock tower/ Inner tray) Damaged	Replace
A • Pillar Left Damaged	Repair
C • Pillar Right Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Dented	Repair
Front Fender Right / Inner Tray Defective	Replace
Door Front Left Dented	Repair
Door Front Right Damaged	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Damaged	Repair
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Damaged	Repair
Roof Damaged	Repair
Windscreen Chipped	Repair
Tie Rod left Defective	Replace
Tie Rod right Defective	Replace
Rear Axle Damaged	Replace
Control Arm(s) Front Axle Right Defective	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Right Worn	Replace
Spare Tyre Damaged	Replace
Rim Front Right Damaged	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Damaged	Replace
Rim Spare Wheel Damaged	Repair
Main Beam Left Damaged	Repair
Chassis Damaged	Repair
Sub Frame Dented	Repair
Belly plates Damaged	Repair
Gearbox Mountings Loose / Excessive Play	Repair
Gearbox Oil Sweat	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025

Damage	Repair Way
Radiator Cradle Damaged	Replace
Engine Performance Idling / Hunting	Repair
Engine Noise Excessive	Repair
Warning lights illuminated on dashboard	Repair
Interior	Loose wiring inside of vehicle
Body and Exterior	Wiper valance damaged
Interior	Boot lock plastic cover damaged
Engine	Foreign substance on oil cap
Engine	Engine oil sump damaged
Engine	Some bolts are missing on bottom of engine
Engine	Fan Cowley loose.
Engine	Aircon condenser missing
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Signs of impact damage to rear of vehicle
Body and Exterior	Signs of impact damage to front of vehicle.
Body and Exterior	Signs of hail damage on some body panels
Engine	Signs of rodent in engine bay
Body and Exterior	Engine bay dirty and battery loose
Interior	Aftermarket sound fitted to vehicle

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.61	2.51	-	
Rear	1.26	1.42	-	
Emergency / Parking	1.51	1.41	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60 R15	88H	Radar	RPX-800	V	3821	0 mm
Front Right	185/60 R15	84H	Continental	Contipremuim	V	1922	0 mm
Rear Left	185/60 R15	84H	Pirelli	Cinturato	V	2515	4 mm
Rear Right	185/60 R15	88H	Voyager	Radial	V	3217	0 mm
Spare	185/60 R15	88H	Radar	RPX-800	V	3621	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENG(ENGINE)	P0012	INTAKE CAMSHAFT POSITION(CMP)A TIMING OVER-RETARTED	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025

[illegible]

Brake and shock absorber repor

[illegible]

Diagnostic report page 1

[illegible]

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Engine oil sump

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MALBB51CLBM285653



CONDITION REPORT




Report No:
2016962855
DATE
30/07/2025

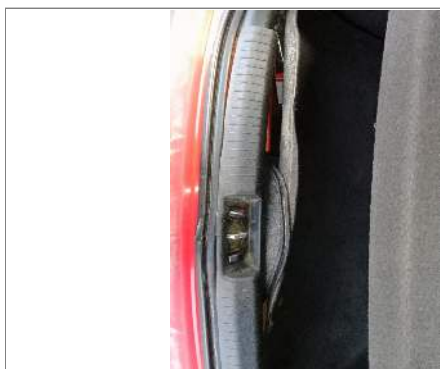

Boot lock plastic cover



Oil cap and dipstick

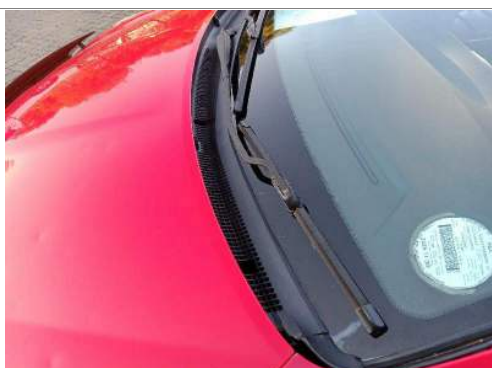

Wiper valance



Sun Visor Left



Sun Visor Right



Seat Rear

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653




CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025



Front Fender Right

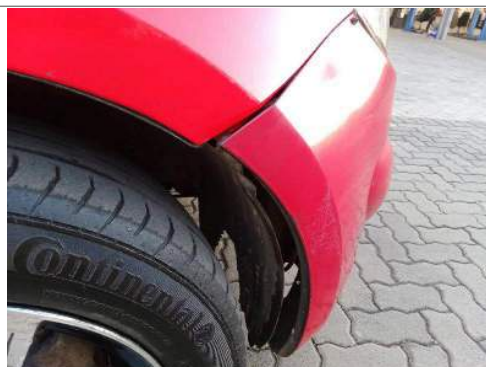

Front Fender Right / Inner Tray



Side Mirror Right



Door Front Right



Door Rear Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025



Rear bumper



Rear bumper



Roof



Rear Fender Left



Door Rear Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025



Front Fender Left



Side Mirror Left



Door Handle Rear Left



Front Bumper



Front Bumper



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025

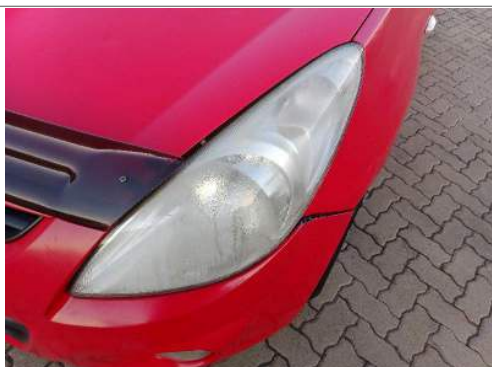

Headlight Left



Headlight Right



Door Handle Front Right



C • Pillar Right



Air Conditioner



Rim Spare Wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025



Spare Tyre



Inner Boot Floor Pan and Spare Wheel Well



Inner Boot Floor Pan and Spare Wheel Well



Boot Carpet



Windscreen



Fan Belt

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025



Engine Wiring



Engine Wiring



Battery box



Bonnet slam plate (Shock tower/ Inner tray)



Engine Wiring



Rim Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025



Sill Panel Right



Rim Rear Right



Rim Rear Left



Sill Panel Left



Radiator



Sub Frame

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025



Gearbox



Gearbox Mountings



Radiator Cradle



Front Bumper



Tyre Front Right



Tyre Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025



Main Beam Left



Belly plates



Air conditioner pipes



Chassis



Chassis



Chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025



Chassis



Tyre Rear Right



Rear Axle



Main Beam Left



Rear bumper



Chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025



Control Arm(s) Front Axle Right



Tie Rod left



Tie Rod right



Water level



Water level



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653



CONDITION REPORT



Report No:
2016962855
DATE
30/07/2025



Indicator Switch



A - Pillar Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBB51CLBM285653