



CONDITION REPORT



Report No:
2017302333
DATE
22/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/09/2026		M57 Pretoria Road - 1619
Inspection Date	22/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	KS31DFGP
Model	I20 1.2 MOTION 5-DR [2021-2024]	Register Number	
VIN	MALBG512LNM127149	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2026
Color	SILVER	Power / Displacement	
Year Model	2022	Paint Finish	M - METALLIC
Km Reading	173,112 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM127149



CONDITION REPORT



Report No:

2017302333

DATE

22/09/2026

Damage

Repair Way

Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Service Brake Performance Front Axle Left / Right	Repair
Difference out of legal range	Repair
R/F tire deferred name brand	Repair



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.0	2.9	-	
Rear	1.9	1.9	-	
Emergency / Parking	1.2	1.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Bridgestone	Ecopia	V	1521	2 mm
Front Right	185/60R15	88H	Goodyear	Efficient gr	V	2323	3 mm
Rear Left	185/65R15	88H	Bridgestone	Ecopia	V	0622	3 mm
Rear Right	185/65R15	88H	Bridgestone	Ecopia	V	0622	3 mm
Spare	185/65R15	88H	Bridgestone	Ecopia	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM127149



CONDITION REPORT



Report No:
2017302333
DATE
22/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	HISTORY	P0075:00	INTAKE VALVE CONTROL SOLENOID CIRCUIT BANK 1	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM127149



CONDITION REPORT



Report No:
2017302333
DATE
22/09/2026

[illegible]

Shock and brake report

PATIENT NAME _____

DATE _____

HISTORICAL VEHICLE DIAGNOSTIC REPORT

CHIEF COMPLAINT _____

PRESENTING SYMPTOMS _____

REVIEW OF SYSTEMS _____

PHYSICAL EXAMINATION _____

LABORATORY TESTS _____


IMPRESSION _____

RECOMMENDATIONS _____

PHYSICIAN SIGNATURE _____

DATE _____

Diagnostic report

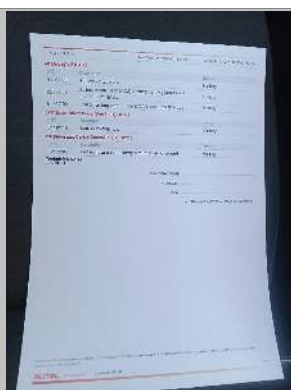

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM127149



CONDITION REPORT



Report No:
2017302333
DATE
22/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM127149



CONDITION REPORT



Report No:
2017302333
DATE
22/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM127149



CONDITION REPORT



Report No:
2017302333
DATE
22/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM127149



CONDITION REPORT



Report No:

2017302333

DATE

22/09/2026



Coolant bottle



Windscreen



Water level

Front axle	-1	m/km	Rear axle	-6	m/km
Shock absorber test (MSD3000)					
	left	right	Difference	Weight	
Front axle	> 0,30	0,18	40 %	769 kg	
Rear axle	> 0,30	0,10	37 %	489 kg	
Total weight				1258 kg	
Brake test					
	Brake force		Difference		
	left	right			
Front axle	2,08 kN	2,09 kN	31 %		
Parking brake	1,23 kN	1,27 kN	2 %		
Rear axle	1,90 kN	1,91 kN	0 %		
Final evaluation static					
Deceleration service brake			72 %		
Deceleration parking brake			20 %	Total weight	

Service Brake Performance Front Axle



Bonnet



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM127149



CONDITION REPORT



Report No:
2017302333
DATE
22/09/2026



Side Mirror Left



Door Front Left



Door Rear Left



Rear Fender Left



Rear bumper



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM127149



CONDITION REPORT



Report No:
2017302333
DATE
22/09/2026



Door Front Right



Side Mirror Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LNM127149