



CONDITION REPORT



Report No:
2017296486
DATE
09/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	
Requested Date	09/09/2026		
Inspection Date	09/09/2026		

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HYUNDAI	Registration Number	LF80PPGP
Model	I20 1.2 MOTION 5-DR [2021-2024]	Register Number	
VIN	MALBG512LPM218912	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	RED	Power / Displacement	
Year Model	2023	Paint Finish	TWO COAT UNI
Km Reading	72,620 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LPM218912



CONDITION REPORT



Report No:

2017296486

DATE

09/09/2026

Damage

Repair Way

Headlight Right Cracked	Replace
Seat Front Left Dirty	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Left Damaged	Repair
Rear Fender Right Residual Traces of Repair	Repair
Front Fender Left / Inner Tray Damaged	Replace
Rear Fender Right / Inner Tray Damaged	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Residual Traces of Repair	Repair
Rear bumper Paintwork • Scratched	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Damaged	Repair
Tyre Front Right Damaged	Replace
Sub Frame Scratched	Repair
Gearbox Mountings Defective	Repair
Gearbox Oil Sweat	Repair
Radiator Cradle Damaged	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.36	2.37	-	
Rear	2.42	2.55	-	
Emergency / Parking	1.52	1.43	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65 R15	88H	Bridgestone	Ecopia	V	1925	4 mm
Front Right	185/65 R15	88H	Bridgestone	Ecopia	V	1925	4 mm
Rear Left	185/65 R15	88H	Bridgestone	Ecopia	V	0523	3 mm
Rear Right	185/65 R15	88H	Bridgestone	Ecopia	V	1925	3 mm
Spare	185/65 R15	92H	Sumitomo	HTR	V	1824	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LPM218912



CONDITION REPORT



Report No:
2017296486
DATE
09/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AB(AIRBAG)	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, EXTERIOR, AND MECHANICAL PARTS. Body • Exterior: Poor residual traces of repair on body panels. Body panels were misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LPM218912



CONDITION REPORT



Report No:

2017296486

DATE

09/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LPM218912



CONDITION REPORT



Report No:

2017296486

DATE

09/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



MANUAL GEAR LEVER



LF TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LPM218912



CONDITION REPORT



Report No:
2017296486
DATE
09/09/2026



LR TYRE TREAD



RR TYRE TREAD



ENGINE 1



FRONT CHASSIS



REAR CHASSIS



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LPM218912



CONDITION REPORT




Report No:
2017296486
DATE
09/09/2026




LICENSE DISC




VIN PLATE OR STICKER

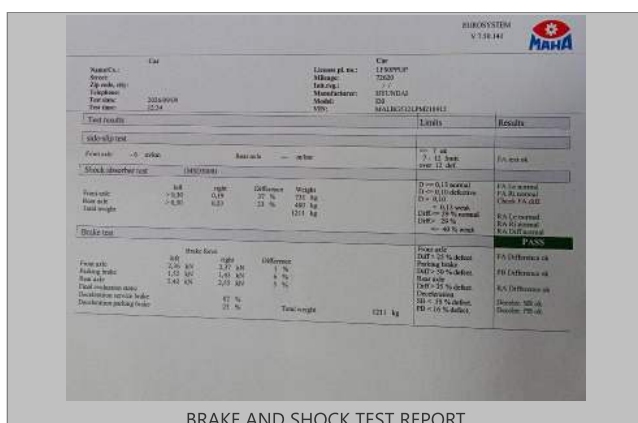


BRAKE AND SHOCK TEST REPORT

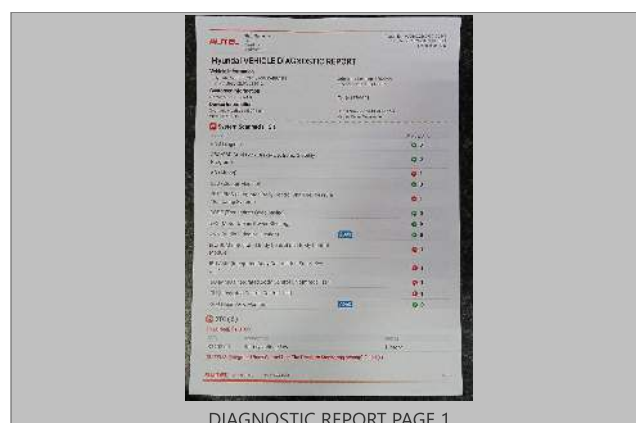

DIAGNOSTIC REPORT PAGE 1

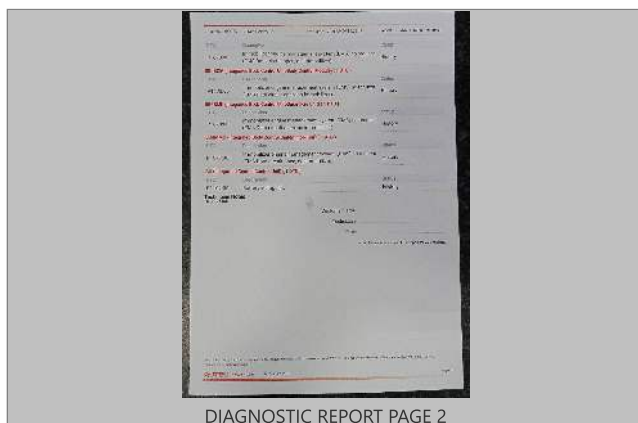

DIAGNOSTIC REPORT PAGE 2

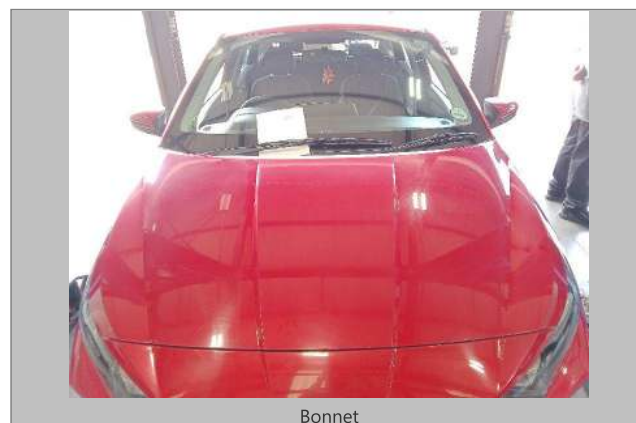

Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LPM218912



CONDITION REPORT



Report No:
2017296486
DATE
09/09/2026



Bonnet



Door Front Right



Door Rear Right



Rear Fender Right



Rear bumper



Inner Boot Floor Pan and Spare Wheel Well

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LPM218912



CONDITION REPORT



Report No:
2017296486
DATE
09/09/2026




Inner Boot Floor Pan and Spare Wheel Well



Door Rear Left



Door Rear Left

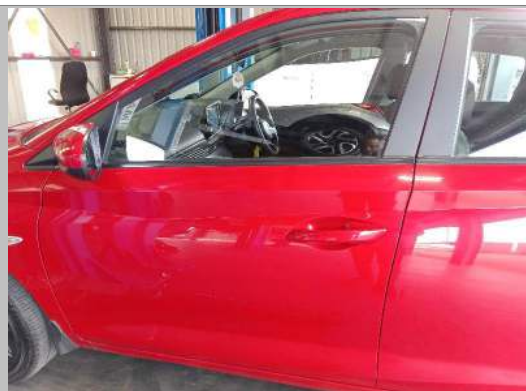

Door Front Left



Door Front Left



Seat Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LPM218912



CONDITION REPORT



Report No:
2017296486
DATE
09/09/2026



Headlight Right



Water level



Rear Fender Right / Inner Tray



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LPM218912



CONDITION REPORT



Report No:
2017296486
DATE
09/09/2026



Front Fender Left / Inner Tray



Front Fender Left



Sill Panel Left



Rear bumper



Sill Panel Right



Sub Frame

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LPM218912



CONDITION REPORT



Report No:
2017296486
DATE
09/09/2026



Sub Frame



Gearbox Mountings



Radiator Cradle



Tyre Front Right



Gearbox



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBG512LPM218912