



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	20/12/2023		M57 Pretoria Road - 1619
Inspection Date	20/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	NU138-273
Model	i20	Register Number	
VIN	MALBM51BLKM527718	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2023
Color	BLUE	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	110,298 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

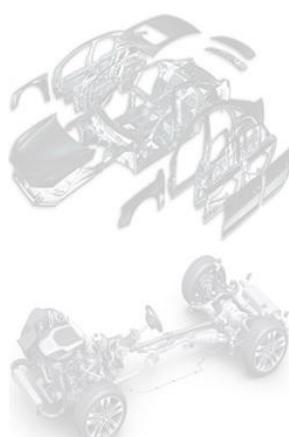

Damage	Repair Way
Engine Oil Leak	Repair
Hooter Defective	Repair
Door Handle Front Left Missing	Replace
Window Winder rear right Missing	Replace
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Pitmarks	Repair
Front Fender Left Paintwork • Pitmarks	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Defective	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Paintwork • Scratched	Repair
Main Beam Left Residual Traces of Repair	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Defective	Repair
CV Joint(s) Boot(s) Front Right (inner/outer) Defective	Repair
Boot not opening cannot see spare wheel	Repair
Aircorn condenser damage	Replace
Front bumper stiffener weld	Replace
Bonnet release latch damage	Repair
L/F door not opening	Repair
Airbag and oil light on	Repair
Button on steering wheel multifunction	Repair
Windscreen washers not working	Repair
Both front fog lights multifunction	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM527718

1 / 12



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023**Brakes****Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [kN]	Braking Force [kN]		
Front	2.5	2.3	-	
Rear	1.9	2.3	-	
Emergency / Parking	1.2	1.5	-	

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/70R14	88T	Winrun	R380	V	2122	3 mm
Front Right	185/70R14	88T	Dunlop	Sp sport	V	2822	4 mm
Rear Left	185/70R14	88T	Dunlop	Sp sport	V	2822	4 mm
Rear Right	185/70R14	88T	Dunlop	Sp sport	V	2822	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Diagnostic could not be performed due to no data available and or OBD interface malfunction.

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Body • Exterior: Vehicle got some scratches, stone chips and dents on some body panels. Signs of spray work done on some body panels

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: MAUJW1B115207118

Report No: 2016207118

2 / 12

DATE

20/12/2023

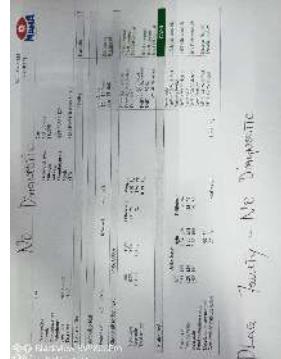

Shock and brake report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

**CONDITION REPORT****Report No:** 2016207178

VIN: MALBM51BLKM527718

DATE

20/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207178

DATE

VIN: MALBM51B261527203

26/12/2023

4 / 12



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023

VIN: MALBM51BLKM527718

5 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023

VIN: MALBM51BLKM527718

6 / 12



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023

VIN: MALBM51BLKM527718

7 / 12



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023

CHASSIS



Front bumper stiffener weld



Aircon condenser damage



Coolant bottle



Oil cap and dipstick



Manual



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023

VIN: MALBM51BLKM527718

9 / 12



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023

Water level



Door Handle Front Left



Window Winder rear right



Bonnet



Side Mirror Right



Front Fender Right



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023

VIN: MALBM51BLKM527718

11 / 12



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023

Front Bumper



Front Bumper



Front Bumper



Front Fender Left



Door Front Left



Door Rear Left



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023

Rear Fender Left



Sill Panel Left



Rear bumper



Rear bumper



Door Rear Right



Door Front Right



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023

Rear Fender Right



Main Beam Left



CV Joint(s) Boot(s) Front Right (inner/outer)



CV Joint(s) Boot(s) Front Left (inner/outer)



Engine



CV Joint(s) Boot(s) Front Right (inner/outer)



DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023

Hooter



CONDITION REPORT

Report No: 2016207178

DATE
20/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za