



CONDITION REPORT

Report No: 2016212397

DATE  
27/12/2023

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 27/12/2023        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 27/12/2023        |                     | Kempton Park - GT        |

Vehicle Data


|                 |                   |                         |              |
|-----------------|-------------------|-------------------------|--------------|
| Vehicle Type    | PASSENGER VEHICLE | Registered Owner        | MFC          |
| Manufacturer    | HYUNDAI           | Registration Number     | JP12VGGP     |
| Model           | CRETA             | Register Number         |              |
| VIN             | MALC381CLLM656582 | Date Of First Licensing |              |
| Engine Number   |                   | Last COR                |              |
| Doors           | 5                 | License Expiry Date     | 31/08/2024   |
| Color           | WHITE             | Power / Displacement    |              |
| Year Model      |                   | Paint Finish            | TWO COAT UNI |
| Km Reading      | 57,021 KM         | Fuel                    | PETROL       |
| Cab / Body Type | HATCHBACK         | Transmission            | MANUAL       |

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

| Damage                    | Repair Way |
|---------------------------|------------|
| Front Bumper Damaged      | Repair     |
| Bonnet Damaged            | Repair     |
| Rear Fender Right Damaged | Repair     |
| Door Front Left Damaged   | Repair     |
| Door Rear Left Damaged    | Repair     |

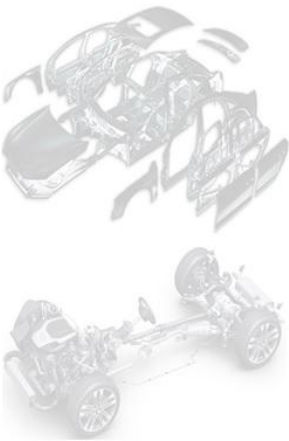



## CONDITION REPORT

Report No: 2016212397

 DATE  
27/12/2023

### Brakes

#### Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 3.17               | 2.78               | -                |                                  |
| Rear                | 2.46               | 2.6                | -                |                                  |
| Emergency / Parking | 2                  | 2.17               | -                |                                  |

### Tyres and Rims

#### Tyre Specification & Measurement

|             | Size      | Load/Speed Index | Manufacture | Model     | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|-----------|-------|-----------------|------------------|
| Front Left  | 205/65R16 | 95H              | Goodyear    | Assurance | V     | 4819            | 2 mm             |
| Front Right | 205/65R16 | 95H              | Goodyear    | Assurance | V     | 4819            | 2 mm             |
| Rear Left   | 205/65R16 | 95H              | Goodyear    | Assurance | V     | 4819            | 2 mm             |
| Rear Right  | 205/65R16 | 95H              | Goodyear    | Assurance | V     | 4819            | 2 mm             |

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

### Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: SHOCK ABSORBER TEST NOT PERFORMED.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

### Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



## CONDITION REPORT


VIN: MALC81Q116296597

Report No: 2016212397


2 / 7

DATE


27/12/2023

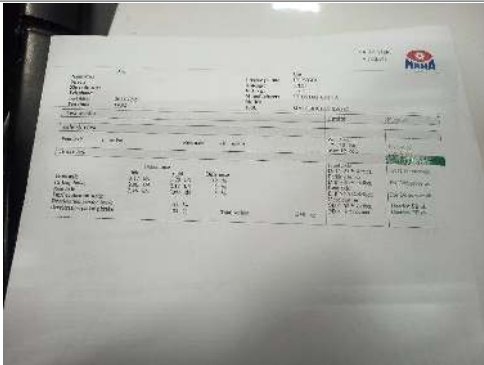

Brake test

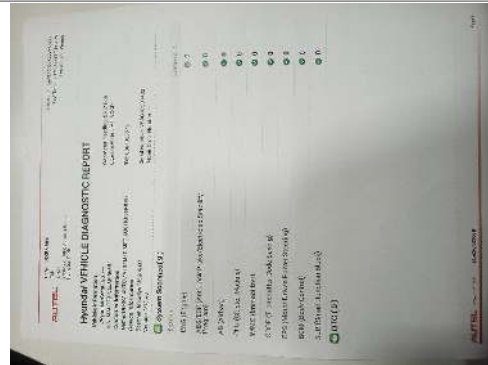

Diagnostic report

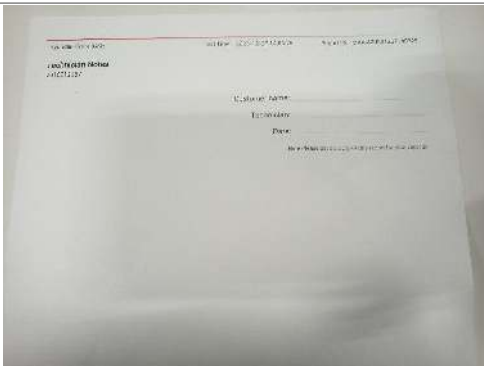

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



CONDITION REPORT

Report No: 2016212397  
VIN: MALC381CLLM656582  
DATE  
3/17  
27/12/2023

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



## CONDITION REPORT

Report No: 2016212397

DATE  
VIN: MALC381C11102023  
4/7



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016212397

DATE  
27/12/2023

VIN: MALC381CLLM656582

5 / 7

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016212397

DATE  
27/12/2023

VIN: MALC381CLLM656582  
6 / 7



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



CONDITION REPORT

Report No: 2016212397

DATE  
27/12/2023

VIN: MALC381CLLM656582  
7 / 7

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



## CONDITION REPORT

Report No: 2016212397

DATE  
27/12/2023

ENGINE 1



ADDITIONAL 4



ADDITIONAL 5



ADDITIONAL 10



ADDITIONAL 11



Water level



CONDITION REPORT

Report No: 2016212397

DATE  
27/12/2023

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



## CONDITION REPORT

Report No: 2016212397

DATE  
27/12/2023

Front Bumper



Front Bumper



Bonnet



Door Front Left



Door Rear Left



Rear Fender Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016212397****DATE**  
**27/12/2023**

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)