



CONDITION REPORT

Report No: 2016867682

DATE
07/05/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	07/05/2025		M57 Pretoria Road - 1619
Inspection Date	07/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HYUNDAI	Registration Number	NO REG
Model	CRETA	Register Number	
VIN	MALC381UMHM237641	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2025
Color	GREY	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	204,380 KM	Fuel	DIESEL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Switch Electrical Window Winder front left Defective	Repair
Switch Electrical Window Winder rear left Defective	Repair
Switch Electrical Window Winder rear right Defective	Repair
Door Panel Front Right Torn / Cut	Repair
Door Sealing Rubber Rear Left Missing	Replace
Door Sealing Rubber Rear Right Missing	Replace
Front Bumper Residual Traces of Repair	Repair
Bonnet Residual Traces of Repair	Replace
A • Pillar Right Paintwork • Scratched	Repair
Front Fender Left Residual Traces of Repair	Repair
Rear Fender Left Dented	Repair
Door Front Right Dented	Repair
Rear bumper Residual Traces of Repair	Repair
Roof Dented	Repair
Windscreen Cracked	Replace
Control Arm Bush(es) Front Axle Right Loose / Excessive Play	Replace
Radiator Cradle Welded	Repair
left rear window perspex	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALC381UMHM237641



CONDITION REPORT

Report No: 2016867682

DATE
07/05/2025

Damage	Repair Way
Both rear door missing rubber sealing	Replace

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.3	3.2	-	
Rear	2.7	3.1	-	
Emergency / Parking	1.8	1.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/65R16	95H	Ling long	Green max	V	3620	1 mm
Front Right	205/65R16	96H	Ling long	Green max	V	3620	1 mm
Rear Left	235/60R16	100H	Kumho	Ecowing	V	011	3 mm
Rear Right	235/60R16	100H	Kumho	Ecowing	V	0117	3 mm
Spare	205/65R16	95H	Kumho	Solus	V	0000	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AIRBAG	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Body • Exterior: Signs of spray work done on some body panels. Residual traces of repair work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALC381UMHM237641




CONDITION REPORT


Report No: 2016867682

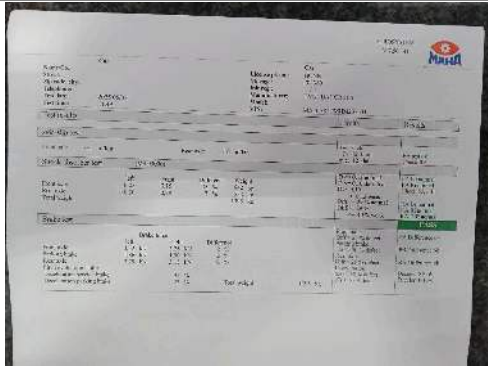DATE
07/05/2025

Shock and brake report

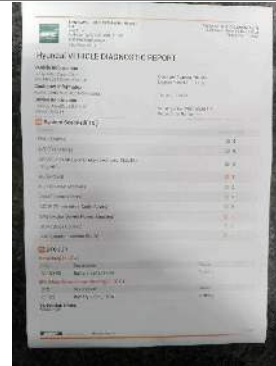

Diagnostic test

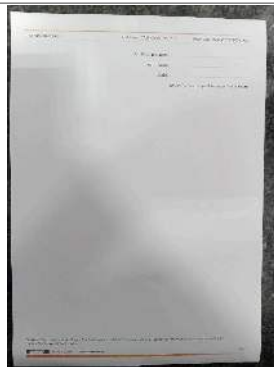

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALC381UMHM237641



CONDITION REPORT

Report No: 2016867682

DATE
07/05/2025

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALC381UMHM237641



CONDITION REPORT

Report No: 2016867682

DATE
07/05/2025

90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALC381UMHM237641



CONDITION REPORT

Report No: 2016867682

DATE
07/05/2025

LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALC381UMHM237641



CONDITION REPORT

Report No: 2016867682

DATE
07/05/2025

Coolant reservoir



Oil cap and dipstick



Perspex window



Door Panel Front Right



Door Front Right



A • Pillar Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALC381UMHM237641



CONDITION REPORT

Report No: 2016867682

DATE
07/05/2025

Rear bumper



Rear Fender Left



Windscreen



Windscreen



Bonnet



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALC381UMHM237641



CONDITION REPORT

Report No: 2016867682

DATE
07/05/2025

Water level



Roof



Door Front Right



Control Arm Bush(es) Front Axle Right



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALC381UMHM237641



CONDITION REPORT

Report No: 2016867682

DATE
07/05/2025

Front Bumper



Front Bumper



Front Bumper



Front Bumper



Front Fender Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALC381UMHM237641



CONDITION REPORT

Report No: 2016867682

DATE
07/05/2025

Door Sealing Rubber Rear Right



Door Sealing Rubber Rear Right



Door Sealing Rubber Rear Left



Door Sealing Rubber Rear Left



Engine



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALC381UMHM237641



CONDITION REPORT

Report No: 2016867682

DATE
07/05/2025

Engine



Radiator Cradle



Switch Electrical Window Winder front left



Switch Electrical Window Winder rear left



Switch Electrical Window Winder rear right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALC381UMHM237641