



CONDITION REPORT

Report No: 201644863

DATE
10/07/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/07/2024		M57 Pretoria Road - 1619
Inspection Date	10/07/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	HYUNDAI	Registration Number	LC71YZGP
Model	VENUE	Register Number	
VIN	MALFB81BLPM405603	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2024
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	19,757 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

Damage	Repair Way
Windscreen Wiper Damaged	Replace
Front Bumper Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Right Dented	Repair





CONDITION REPORT

Report No: 2016448683

DATE
10/07/2024

Brakes

Brake Test Results

	Left	Right	Axe Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.88	2.96	-	-
Rear	1.66	1.81	-	-
Emergency / Parking	1.52	1.61	-	-

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65 R15	91H	Goodyear	Assurance	V	2322	5 mm
Front Right	195/65 R15	91H	Goodyear	Assurance	V	3522	4 mm
Rear Left	195/65 R15	91H	Goodyear	Assurance	V	3222	5 mm
Rear Right	195/65 R15	91H	Goodyear	Assurance	V	3422	5 mm
Spare	195/65 R15	91H	Goodyear	Assurance	V	3522	6 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacturer).

No	System	Code	Description	Status
1	AB(AIRBAG)	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Engine bay dirty.

Interior: Vehicle interior dirty and some panels scratched.

Undercarriage: Bottom of engine and gearbox covered. Vehicle undercarriage dirty.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT

VIN: MALEF81BPM405603

Report No: 2016448683

2 / 7

DATE

10/07/2024

Car		Univ. pl. no.		Car	
Verg/Cat	Model	137V/GP	137V/GP	Make	HYUNDAI
Serial	Year	17/17	17/17	Model	VENUE
Reg. date	Length	1700 mm	1700 mm	Model	VENUE
Test date	Width	1700 mm	1700 mm	Model	VENUE
Test time	Height	1470 mm	1470 mm	Model	VENUE
Test result:				Model	VENUE
Test results:				Model	VENUE
Brake test	in cm	Front side	in cm	Front side	in cm
Stock absorber test	(0.000 mm)				
Front side	< 0.20	Side	< 0.10	Front side	< 0.10
Rear side	> 0.20	Side	> 0.10	Rear side	> 0.10
Total weight	1094 kg			Total weight	1094 kg
PERCENTAGE				PERCENTAGE	
Front side	0.0	Side	0.0	Front side	0.0
Parking brake	0.00	Side	0.00	Parking brake	0.00
Front	1.00	Side	0.00	Front	0.00
Front parking brake	1.00	Side	0.00	Front parking brake	0.00
Brake system overall test	0.00	Total weight	1094 kg	Brake system overall test	0.00
Brake system parking brake	0.00			Brake system parking brake	0.00

Brake and shock absorber report



Diagnostic report page 1

Message ID		Test Time	Report ID
B2015.00	Airbag control unit (ACU) & cluster airbag lamp CAN message mismatch	2024-07-10 01:49:27	WAA04260401027002
B3017.00	Cluster airbag warning lamp CAN message timeout		History
ICU (Integrated Central Control Unit) (1 DTC)			History
DTC	Description	Status	
B1102.00	Battery voltage low	History	
Technician Notes			
Integrator			
Customer name: _____			
Technician: _____			
Date: _____			

Diagnostic report page 2




FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

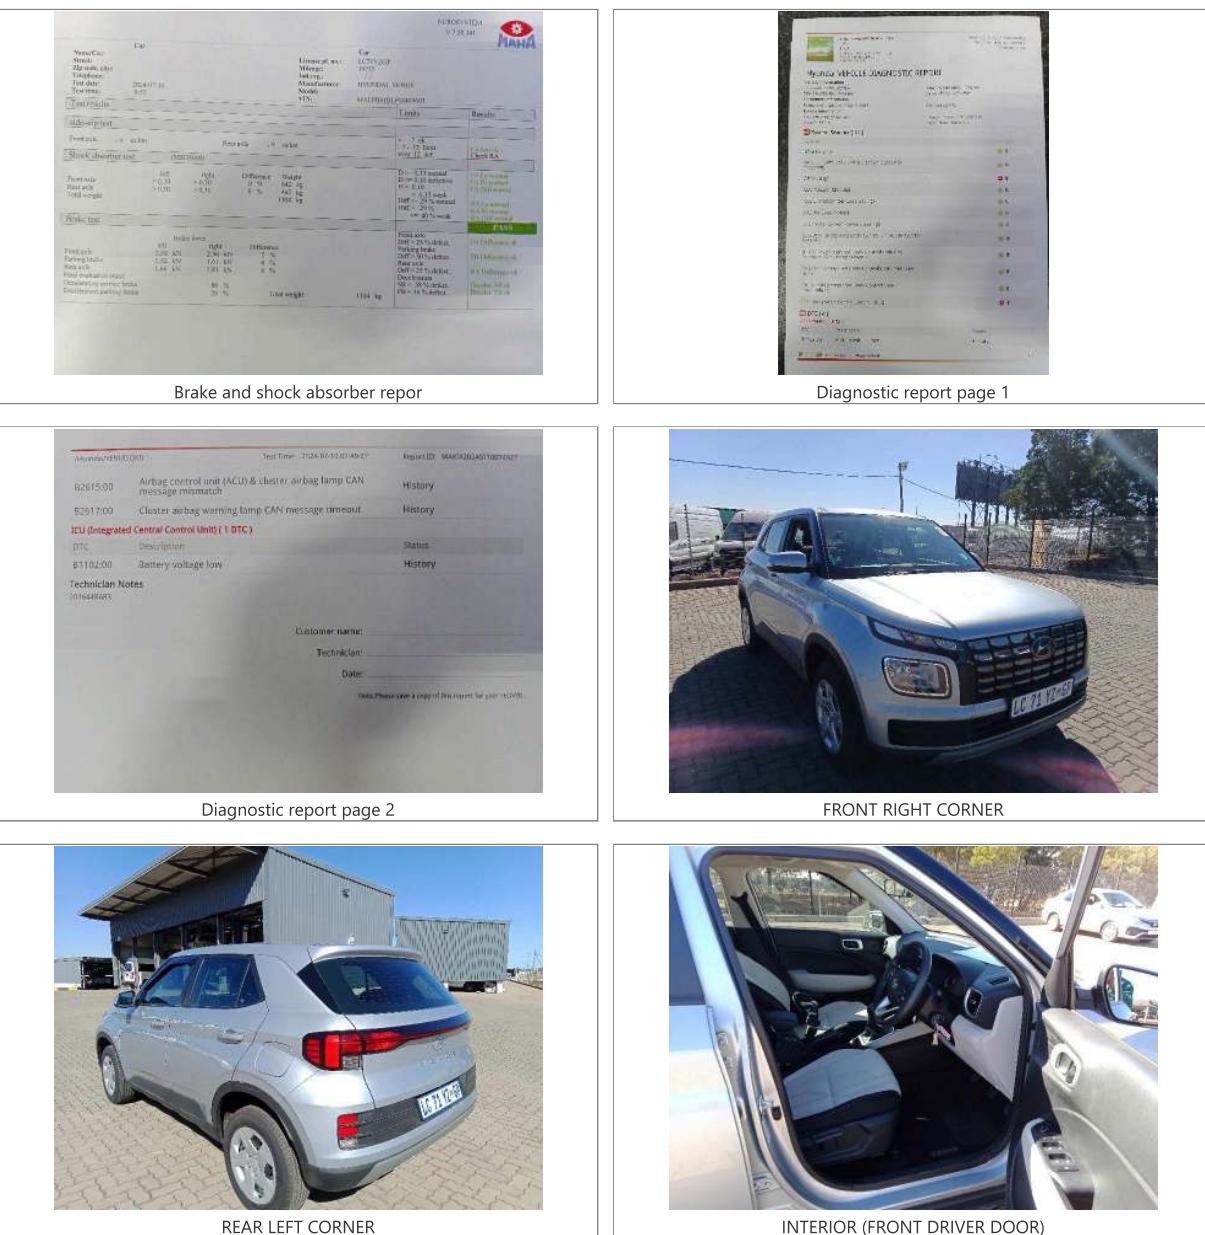

**CONDITION REPORT****Report No:** 2016448683

VIN: MALFB81BLPM405603

DATE

10/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448683

DATE

VIN: MALFB81BLPM405603

10/07/2024

4 / 7



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



CONDITION REPORT

Report No: 2016448683

DATE

10/07/2024

VIN: MALFB81BLPM405603

5 / 7

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448683

DATE
10/07/2024

VIN: MALFB81BLPM405603

6 / 7



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories



CONDITION REPORT

Report No: 2016448683

DATE
10/07/2024

VIN: MALFB81BLPM405603

7 / 7



CONDITION REPORT

Report No: 201644863

DATE
10/07/2024



CONDITION REPORT

Report No: 2016448683

DATE
10/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016448683

DATE
10/07/2024

Windscreen Wiper



Front Bumper



Front Bumper



Water level



Door Front Right



Door Rear Right



CONDITION REPORT

Report No: 2016448683

DATE
10/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za