



CONDITION REPORT

Report No: 2016844468

DATE
15/04/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/04/2025		M57 Pretoria Road - 1619
Inspection Date	15/04/2025		Kempton Park - GT


Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HYUNDAI	Registration Number	JS42DSGP
Model	VENUE 1.0 88KW TGD1 FLUID 2 TONE [2020-2023]	Register Number	
VIN	MALFC81ALLM103605	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/06/2025
Color	RED	Power / Displacement	
Year Model	2020	Paint Finish	TWO COAT UNI
Km Reading	144,053 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

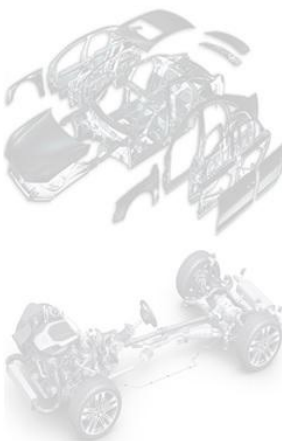

Damage	Repair Way
Hoses Oil Leak	Repair
Seat Rear Defective	Repair
Side Mirror Left Residual Traces of Repair	Replace
Front Bumper Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Dented	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Right Dented	Repair
Door Front Left Damaged	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Shock Absorber Front Left Sweat	Replace
Shock Absorber Rear Left Sweat	Replace
Shock Absorber Rear Right Sweat	Replace
Tyre Rear Left Worn	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM103605



CONDITION REPORT

Report No: 2016844468

DATE
15/04/2025

Damage	Repair Way
Rim Front Right Scratched	Repair
Gearbox Oil Leak	Repair
Engine Noise Excessive	Repair
Interior	Vehicle interior dirty and some panels scratched
Undercarriage	Bottom of engine and gearbox covered
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Residual traces of repair on some body panels
Body and Exterior	Dents and scratches on some body panels
Rear tyres size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.59	3.24	-	
Rear	1.67	1.5	-	
Emergency / Parking	1.12	1.39	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60 R16	95H	MRF	Wanderer	V	0620	4 mm
Front Right	215/60 R16	95H	MRF	Wanderer	V	0420	2 mm
Rear Left	215/65 R16	98H	Lanvigator	Comfort	V	3121	0 mm
Rear Right	215/60 R16	95H	MRF	Wanderer		0620	4 mm
Spare	195/65 R15	91H	Goodyear	Assurance	V	0620	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AB(AIRBAG)	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: MALFC81ALLM103605

**CONDITION REPORT****Report No: 2016844468****DATE**
15/04/2025

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM103605




CONDITION REPORT


Report No: 2016844468

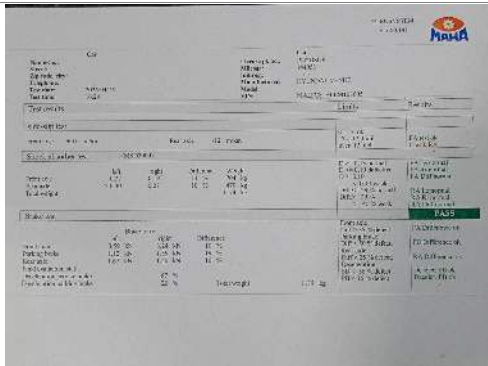DATE
15/04/2025

Brake and shock absorber report

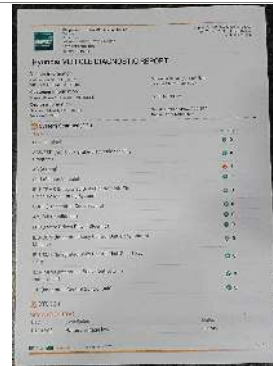

Diagnostic report page 1

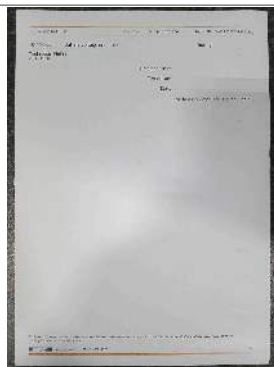

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM103605



CONDITION REPORT

Report No: 2016844468

DATE
15/04/2025

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM103605



CONDITION REPORT

Report No: 2016844468

DATE
15/04/2025

90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM103605



CONDITION REPORT

Report No: 2016844468

DATE
15/04/2025

LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM103605



CONDITION REPORT

Report No: 2016844468

DATE
15/04/2025

Seat Rear



Rear Fender Right



Door Rear Right



Door Front Right



Front Fender Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM103605



CONDITION REPORT

Report No: 2016844468

DATE
15/04/2025

Front Bumper



Bonnet



Front Fender Left



Door Front Left



Door Rear Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM103605



CONDITION REPORT

Report No: 2016844468

DATE
15/04/2025

Rear bumper



Boot Lid / Hatch door



Rim Front Right



Shock Absorber Rear Right



Shock Absorber Rear Left



Shock Absorber Front Left


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM103605



CONDITION REPORT

Report No: 2016844468

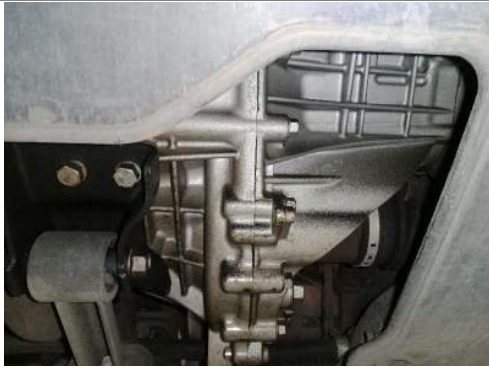DATE
15/04/2025

Gearbox



Hoses



Tyre Rear Left



Water level



Windscreen



Side Mirror Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALFC81ALLM103605