



## CONDITION REPORT



Report No:  
2017305215  
DATE  
30/09/2026

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 30/09/2026        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 30/09/2026        |                     | Kempton Park - GT        |

## Vehicle Data

|                 |                                |                         |            |
|-----------------|--------------------------------|-------------------------|------------|
| Vehicle Type    | PASSENGER VEHICLE              | Registered Owner        |            |
| Manufacturer    | TATA CARS                      | Registration Number     | HYG076MP   |
| Model           | BOLT 1.2 TURBO XMS [2015-2019] | Register Number         |            |
| VIN             | MAT623228FPRA0167              | Date Of First Licensing |            |
| Engine Number   |                                | Last COR                |            |
| Doors           | 4                              | License Expiry Date     | 31/08/2027 |
| Color           | BLUE                           | Power / Displacement    |            |
| Year Model      | 2016                           | Paint Finish            | C - COMMON |
| Km Reading      | 178,730 KM                     | Fuel                    | PETROL     |
| Cab / Body Type | SEDAN                          | Transmission            | MANUAL     |

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MAT623228FPRA0167



## CONDITION REPORT



Report No:

2017305215

DATE

30/09/2026



## Damage

## Repair Way

|                                                                      |                                            |
|----------------------------------------------------------------------|--------------------------------------------|
| Engine Oil Sweat                                                     | Repair                                     |
| Switch Electrical Window Winder front left Defective                 | Repair                                     |
| Switch Electrical Window Winder front right Damaged                  | Repair                                     |
| Switch Electrical Window Winder rear left Defective                  | Repair                                     |
| Switch Electrical Window Winder rear right Defective                 | Repair                                     |
| Fog Light Front Left Damaged                                         | Replace                                    |
| Fog Light Front Right Damaged                                        | Replace                                    |
| Headlight Left Cracked                                               | Replace                                    |
| Parking Brake Performance Left / Right Difference out of legal range | Repair                                     |
| Tie Rod End right Damaged                                            | Replace                                    |
| Stabilizer Mounting Front Left Damaged                               | Replace                                    |
| Gearbox Oil Leak                                                     | Repair                                     |
| CV Joint(s) Boot(s) Front Right (inner/outer) Damaged                | Replace                                    |
| Driver electric window not closing                                   | Repair                                     |
| Original color of vehicle is dark blue                               | Entire vehicle has been sprayed light blue |
| Both rear electric windows not working                               | Repair                                     |

## Brakes

## Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 2.7                | 2.1                | -                |                                  |
| Rear                | 1.3                | 0.9                | -                |                                  |
| Emergency / Parking | 1.3                | 0.1                | -                |                                  |

## Tyres and Rims

## Tyre Specification &amp; Measurement

|             | Size      | Load/Speed Index | Manufacture | Model | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|-------|-------|-----------------|------------------|
| Front Left  | 185/60R15 | 84H              | Anchee      | AC808 | V     | 4225            | 5 mm             |
| Front Right | 185/60R15 | 84H              | Anchee      | AC808 | V     | 4425            | 4 mm             |
| Rear Left   | 185/60R15 | 84H              | Royal black | Mile  | V     | 0624            | 5 mm             |
| Rear Right  | 185/60R15 | 84H              | Royal black | Mile  | V     | 0224            | 3 mm             |
| Spare       | 185/60R15 | 84T              | Bridgestone | B260  | V     | 0000            | 1 mm             |

\* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.  
 97 Willem Cruywagen Ave  
 Klerksoord, Pretoria, 0200  
 Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAT623228FPRA0167



## CONDITION REPORT



Report No:

2017305215

DATE

30/09/2026

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System                   | Code     | Description                                   | Status |
|----|--------------------------|----------|-----------------------------------------------|--------|
| 1  | ENGINE MANAGEMENT SYSTEM | P0130-13 | OXYGEN SENSOR CIRCUIT OPEN ( BANK 1 SENSOR 1) |        |

### Inspection Conditions

No Test Drive  
Rain at time of inspection  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. BODY EXTERIOR - SIGNS OF SPRAY WORK DONE ON BODY PANELS / RESIDUAL TRACES OF REPAIR ON BODY PANELS

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MAT623228FPRA0167



## CONDITION REPORT



Report No:  
2017305215  
DATE  
30/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)


VIN: MAT623228FPRA0167



CONDITION REPORT



Report No:  
2017305215  
DATE  
30/09/2026

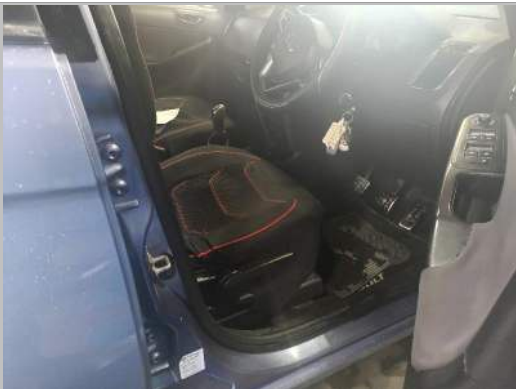

INTERIOR (FRONT DRIVER DOOR)



Manual transmission



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MAT623228FPRA0167



## CONDITION REPORT



Report No:  
2017305215  
DATE  
30/09/2026



ENGINE 1




ENGINE 2



CHASSIS



REAR

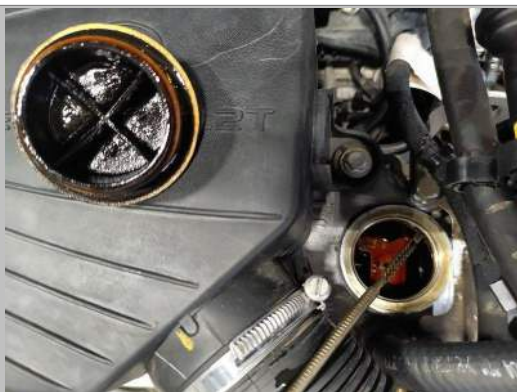

Oil cap and dipstick



Expansion bottle

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)


VIN: MAT623228FPRA0167



## CONDITION REPORT



Report No:  
2017305215  
DATE  
30/09/2026

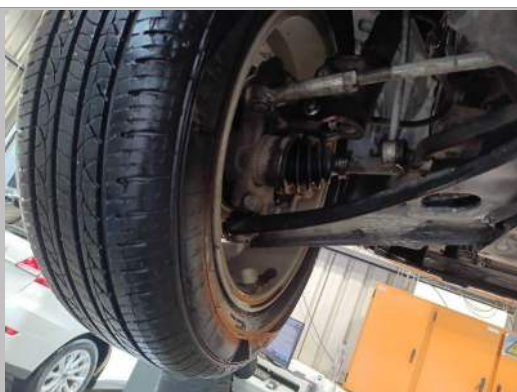

LF TYRE TREAD



RF TYRE TREAD




LR TYRE TREAD



RR TYRE TREAD



Sparewheel

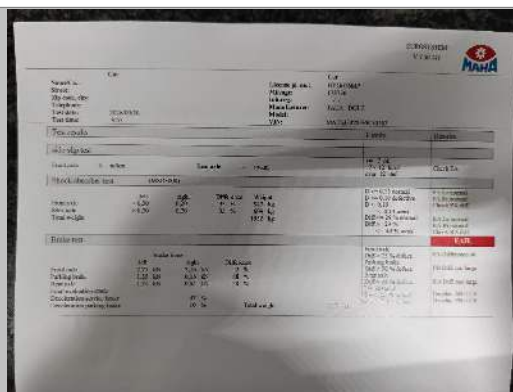

Shock and brake report

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: MAT623228FPRA0167




## CONDITION REPORT




Report No:  
2017305215  
DATE  
30/09/2026

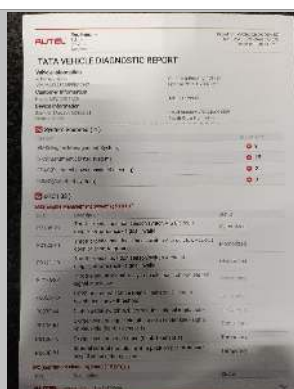

Diagnostic Report page 1

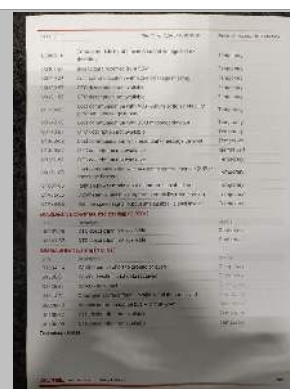

Diagnostic Report page 2

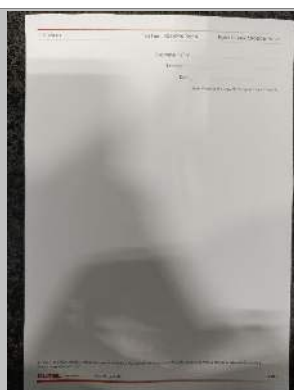

Diagnostic Report page 3

|               |      |      |         |
|---------------|------|------|---------|
| FAHRENGEWICHT | 0,20 | 33 % | 943 kg  |
| Rear axle     | 0,20 | 33 % | 609 kg  |
| Total weight  |      |      | 1552 kg |

| Brake test                 |             |         |            |
|----------------------------|-------------|---------|------------|
|                            | Brake force |         |            |
|                            | left        | right   | Difference |
| Front axle                 | 2,77 kN     | 2,16 kN | 22 %       |
| Parking brake              | 1,35 kN     | 0,16 kN | 88 %       |
| Rear axle                  | 1,31 kN     | 0,94 kN | 28 %       |
| Final evaluation static    |             |         |            |
| Deceleration service brake |             | 47 %    |            |
| Deceleration parking brake |             | 10 %    |            |

Parking Brake Performance



Water level



CV Joint(s) Boot(s) Front Right (inner/outer)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MAT623228FPRA0167



## CONDITION REPORT



Report No:  
2017305215  
DATE  
30/09/2026



Tie Rod End right



Fog Light Front Right



Fog Light Front Left



Headlight Left



Stabilizer Mounting Front Left



Gearbox

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAT623228FPRA0167



## CONDITION REPORT



Report No:  
2017305215  
DATE  
30/09/2026



Gearbox



Engine



Engine



Fog Light Front Left



Switch Electrical Window Winder rear right



Switch Electrical Window Winder rear right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAT623228FPRA0167



## CONDITION REPORT



Report No:  
2017305215  
DATE  
30/09/2026



Switch Electrical Window Winder rear left



Switch Electrical Window Winder front left



Switch Electrical Window Winder rear left



Switch Electrical Window Winder front right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAT623228FPRA0167