



CONDITION REPORT

Report No: 2016866280

DATE
06/05/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	06/05/2025		M57 Pretoria Road - 1619
Inspection Date	06/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	SUZUKI	Registration Number	LN48KGGP
Model	DZIRE 1.2 GA MC [2020-ON]	Register Number	
VIN	MBHCZF63S00258714	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	28/02/2026
Color	WHITE	Power / Displacement	
Year Model	2022	Paint Finish	M - METALLIC
Km Reading	129,711 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Front Bumper Damaged	Repair
Grill Damaged	Replace
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Dented	Repair
Front Fender Right Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Dented	Repair
Sill Panel Right Residual Traces of Repair	Repair
Windscreen Cracked	Replace
Radiator Cradle Welded	Repair
Body exterior	Vehicle got minor scratches, stone chips and dents
Body exterior	Signs of repair work done on some body panels
L/F fender liner damage	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00258714



CONDITION REPORT

Report No: 2016866280

DATE
06/05/2025

Damage

Front tyres size differs

Repair Way

Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.0	1.8	-	
Rear	1.8	2.2	-	
Emergency / Parking	1.1	1.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/80R14	85T	Apollo	Amazer	V	1322	3 mm
Front Right	165/65R14	85T	Apollo	Amazer	V	2723	3 mm
Rear Left	165/80R14	85T	Apollo	Amazer	V	3722	1 mm
Rear Right	165/80R14	85T	Apollo	Amazer	V	1122	2 mm
Spare	T135/70R15	99M	Jk tyre	Temporary	V	5226	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	HISTORY	B1004-18	POWER SOURCE VOLTAGE TOO LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00258714



CONDITION REPORT

Report No: 2016866280

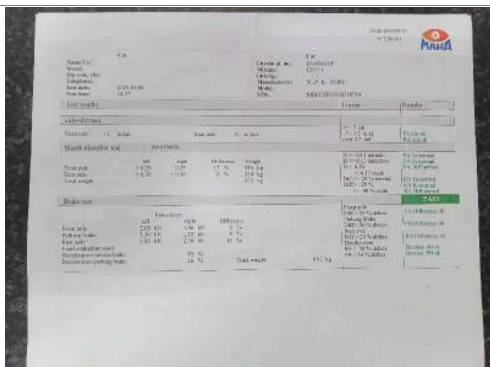DATE
06/05/2025

Shock and brake report



Diagnostic report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00258714



CONDITION REPORT

Report No: 2016866280

DATE
06/05/2025

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00258714



CONDITION REPORT

Report No: 2016866280

DATE
06/05/2025


90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

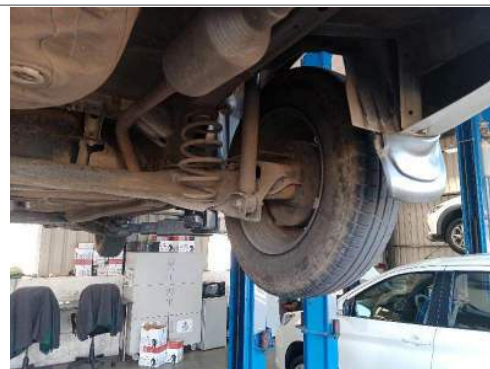

RR TYRE TREAD



RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00258714



CONDITION REPORT

Report No: 2016866280

DATE
06/05/2025

LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Coolant bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00258714



CONDITION REPORT

Report No: 2016866280

DATE
06/05/2025

Oil cap and dipstick



Water level



Bonnet



Windscreen



Sill Panel Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00258714



CONDITION REPORT

Report No: 2016866280

DATE
06/05/2025

Door Rear Right



Door Front Right



Front Fender Right



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00258714



CONDITION REPORT

Report No: 2016866280

DATE
06/05/2025

Grill



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Sill Panel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00258714



CONDITION REPORT

Report No: 2016866280

DATE
06/05/2025

Rear bumper



Rear bumper



Boot Lid / Hatch door



Rear bumper



Radiator Cradle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00258714