



CONDITION REPORT



Report No:
2017302476
DATE
23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	SUZUKI	Registration Number	LV42ZMGP
Model	FRONX	Register Number	
VIN	MBHKWDA3S00258648	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/06/2027
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	PEARL EFFECT
Km Reading	41,384 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHKWDA3S00258648



CONDITION REPORT



Report No:

2017302476

DATE


23/09/2026

Damage

Repair Way

Seat Front Left Dirty
 Front Bumper Paintwork • Chipmarks
 Windscreen Chipped
 Shock Absorber Rear Left Sweat
 Shock Absorber Rear Right Sweat

Repair
 Repair
 Repair
 Replace
 Replace

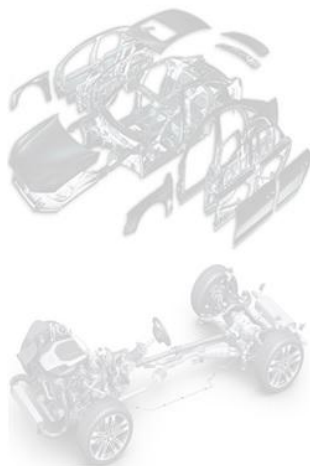

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.98	3.23	-	
Rear	1.74	1.84	-	
Emergency / Parking	1.27	1.22	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/60 R16	89H	Goodyear	Assurance	V	1124	2 mm
Front Right	195/60 R16	89H	Goodyear	Assurance	V	1124	3 mm
Rear Left	195/60 R16	89H	Goodyear	Assurance	V	1124	4 mm
Rear Right	195/60 R16	89H	Goodyear	Assurance	V	1124	4 mm
Spare	195/60 R16	89H	Goodyear	Assurance	V	0924	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHKWDA3S00258648



CONDITION REPORT



Report No:
2017302476
DATE
23/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS/ESP(ANTI-LOCK BRAKING SYSTEM/ELECTRONIC STABIL	C1157-1C	POWER SUPPLY VOLTAGE ABNORMAL	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHKWDA3S00258648



CONDITION REPORT



Report No:

2017302476

DATE _____

23/09/2026

[illegible]

Brake and shock absorber report

[illegible]

Diagnostic report

Serial#	Description	Date Rec'd	Warranty Exp.	Status
31032-08	Rear camera signal fault			History

Technician Notes:
2/7/2009

Customer name _____
 Technician _____
 Date _____

<http://www.ford.com>

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHKWDA3S00258648



CONDITION REPORT



Report No:

2017302476

DATE

23/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHKWDA3S00258648



CONDITION REPORT



Report No:

2017302476

DATE

23/09/2026



90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

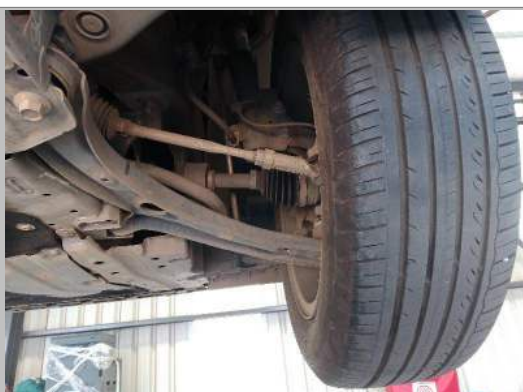

RF TYRE TREAD



Spare Wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHKWDA3S00258648



CONDITION REPORT



Report No:

2017302476

DATE

23/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHKWDA3S00258648



CONDITION REPORT



Report No:
2017302476
DATE
23/09/2026



Seat Front Left



Windscreen



Front Bumper



Front Bumper



Shock Absorber Rear Right



Shock Absorber Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHKWDA3S00258648



CONDITION REPORT



Report No:
2017302476
DATE
23/09/2026



DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHKWDA3S00258648