



CONDITION REPORT



Report No:
2017296016
DATE
08/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/09/2026		M57 Pretoria Road - 1619
Inspection Date	08/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	SUZUKI	Registration Number	MC59ZVGP
Model	SWIFT 1.2 GL 5-DR [2024-ON]	Register Number	
VIN	MBHZCDESR00180651	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2027
Color	WHITE	Power / Displacement	
Year Model	2025	Paint Finish	TWO COAT UNI
Km Reading	59,535 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDESR00180651



CONDITION REPORT



Report No:

2017296016

DATE

08/09/2026

Damage

Repair Way

Engine Oil Sweat	Repair
Engine Wiring Defective	Repair
Radio/CD/USB Defective	Repair
Seat Rear Damaged	Repair
Door Panel Front Right Damaged	Repair
Door Sealing Rubber Rear Left Defective	Repair
Parcel Tray Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Right Damaged	Repair
Door Rear Left Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Shock Absorber Rear Left Sweat	Replace
Shock Absorber Rear Right Sweat	Replace
Tyre Front Left Damaged	Replace
Belly plates Damaged	Repair
Deceleration parking brake defective	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.88	2.76	-	
Rear	1.66	1.86	-	
Emergency / Parking	0.7	0.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/80 R14	85T	MRF	Ecotred	V	2924	1 mm
Front Right	165/80 R14	85T	MRF	Ecotred	V	2824	1 mm
Rear Left	165/80 R14	85T	MRF	Ecotred	V	2924	3 mm
Rear Right	165/80 R14	85T	MRF	Ecotred	V	2924	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDESR00180651



CONDITION REPORT



Report No:
2017296016
DATE
08/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS/ESP(ANTI-LOCK BRAKING SYSTEM/ELECTRONIC STABIL	U0100-87	LOST COMMUNICATION WITH ECM	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Electrical Components and Instruments: Cluster faded. Non standard radio fitted to vehicle.

Interior: Aftermarket sound fitted to vehicle.

Body • Exterior: Dents and scratches on body panels. Residual traces of repair on body panels. Stone chips and spray work on body panels.

Tyres and Rims: Spare Wheel could not be checked.

Undercarriage: Bottom of engine and gearbox fully covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDES00180651



CONDITION REPORT



Report No:

2017296016

DATE _____

08/09/2026

[illegible]

Brake and shock absorber report

[illegible]

Diagnostic report page 1

[illegible]

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDESR00180651



CONDITION REPORT



Report No:

2017296016

DATE

08/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDES00180651



CONDITION REPORT



Report No:

2017296016

DATE

08/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDES00180651



CONDITION REPORT



Report No:
2017296016
DATE
08/09/2026



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Spare Wheel Accessories



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDESR00180651



CONDITION REPORT



Report No:
2017296016
DATE
08/09/2026



Rear Fender Right



Front Fender Right



Bonnet



Bonnet



Seat Rear



Seat Rear

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDES00180651



CONDITION REPORT



Report No:
2017296016
DATE
08/09/2026



Door Sealing Rubber Rear Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



Parcel Tray



Engine Wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDES00180651



CONDITION REPORT



Report No:
2017296016
DATE
08/09/2026



Front Bumper



Front Bumper



Door Rear Left



Door Rear Left



Belly plates



Belly plates

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDES00180651



CONDITION REPORT



Report No:


2017296016

DATE

08/09/2026




Tyre Front Left

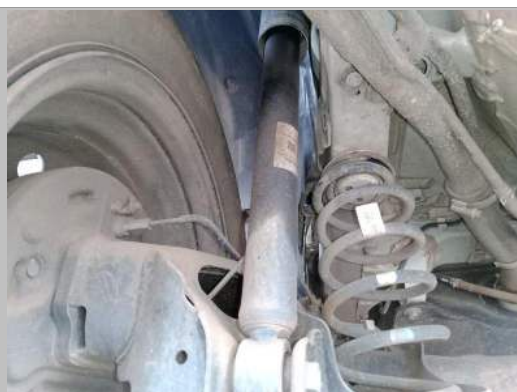

Shock Absorber Rear Left



Shock Absorber Rear Right

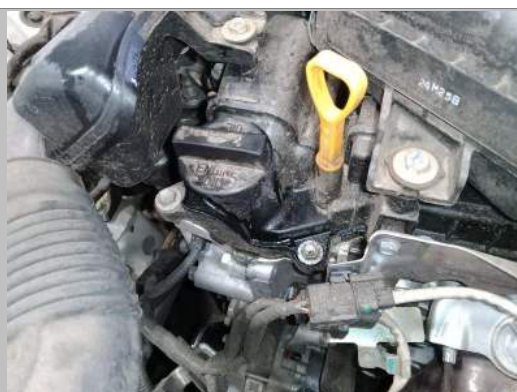

Engine



Water level



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDES00180651



CONDITION REPORT



Report No:
2017296016
DATE
08/09/2026



Windscreen



Radio/CD/USB



Door Panel Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHZCDESR00180651