



CONDITION REPORT



Report No:
2016888250
DATE
23/05/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/05/2025		M57 Pretoria Road - 1619
Inspection Date	23/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	TOYOTA	Registration Number	KK83TWGP
Model	ETIOS 1.5 SPRINT [2019-2021]	Register Number	
VIN	MBJB29BT200129834	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/01/2025
Color	SILVER	Power / Displacement	
Year Model	2020	Paint Finish	M - METALLIC
Km Reading	177,980 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MBJB29BT200129834



CONDITION REPORT



Report No:
2016888250
DATE
23/05/2025

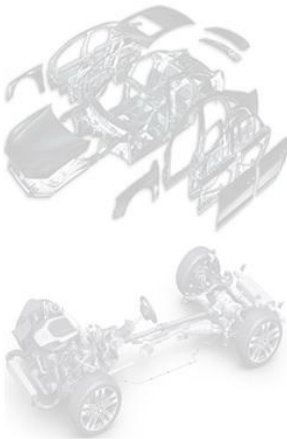

Damage	Repair Way
Number Plate Light Right Missing	Replace
Side Mirror Right Paintwork • Dull	Repair
Front Bumper Damaged	Repair
Bonnet Paintwork • Dull	Repair
Front Fender Left Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Dull	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Dented	Repair
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Smooth	Replace
Tyre Front Right Smooth	Replace
Gearbox Oil Sweat	Repair
CV Joint(s) Front Left (inner/outer) Damaged	Replace
Vehicle electronics Faulty	Odometer and cluster lights malfunction
ABS warning lights malfunction	On and off
Some body panels misaligned	Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.4	2.4	-	
Rear	1.4	1.6	-	
Emergency / Parking	0.9	1.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88T	Dunlop	Enasave	V	3322	0 mm
Front Right	185/65R15	88H	Firestone	Touring	V	0000	0 mm
Rear Left	185/60R15	84H	Bridgestone	Turanza	V	0420	1 mm
Rear Right	185/60R15	84H	Bridgestone	---	V	0420	1 mm
Spare	185/60R15	84H	Bridgestone	Turanza	V	0000	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MJB29BT200129834



CONDITION REPORT



Report No:
2016888250
DATE
23/05/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1300	SKID CONTROL ECU FAULT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of repair work done on some body panels. Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MJB29BT200129834



CONDITION REPORT



Report No:
2016888250
DATE
23/05/2025

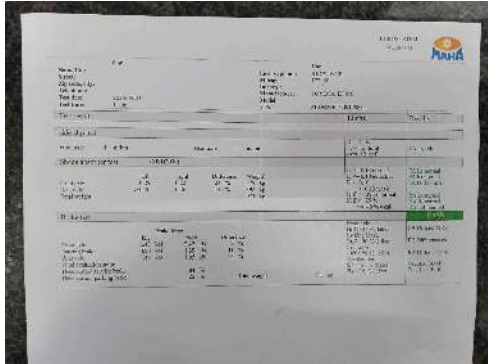

Shock and brake report



Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MJB29BT200129834



CONDITION REPORT



Report No:
2016888250
DATE
23/05/2025



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MJB29BT200129834



CONDITION REPORT



Report No:
2016888250
DATE
23/05/2025



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MJB29BT200129834



CONDITION REPORT



Report No:
2016888250
DATE
23/05/2025



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end



Coolant reservoir

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MJB29BT200129834



CONDITION REPORT



Report No:
2016888250
DATE
23/05/2025



Oil cap and dipstick



Water level



Water level



Side Mirror Right



Door Front Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MJB29BT200129834



CONDITION REPORT



Report No:
2016888250
DATE
23/05/2025



Rear Fender Right



Rear Fender Left



Rear bumper



Door Rear Left



Door Front Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MJB29BT200129834



CONDITION REPORT



Report No:
2016888250
DATE
23/05/2025



Front Fender Left



Bonnet



Bonnet



Tyre Front Right



Control Arm Bush(es) Front Axle Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MJB29BT200129834



CONDITION REPORT



Report No:
2016888250
DATE
23/05/2025



Front Bumper



Control Arm Bush(es) Front Axle Left



Tyre Front Left



CV Joint(s) Front Left (inner/outer)



Sill Panel Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MJB29BT200129834



CONDITION REPORT



Report No:
2016888250
DATE
23/05/2025



Number Plate Light Right



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MJB29BT200129834