



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/04/2024		M57 Pretoria Road - 1619
Inspection Date	30/04/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	TOYOTA	Registration Number	KN79XCGP
Model	ETIOS	Register Number	
VIN	MBJB29BTX00121092	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/05/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	202,533 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

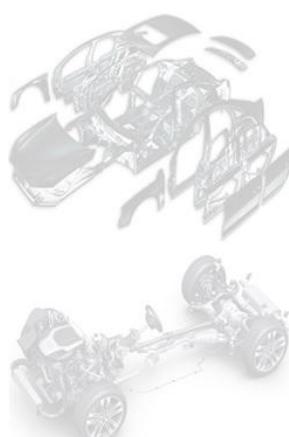

Damage	Repair Way
Fan Defective	Replace
Headlight Left Defective	Repair
Headlight Right Defective	Replace
Seat Front Right Damaged	Repair
Seat Rear Defective	Repair
Hood Lining Dirty	Repair
Door Sealing Rubber Front Right Damaged	Replace
Carpet Front Damaged	Repair
Steering Wheel Trim Defective	Repair
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Bonnet Residual Traces of Repair	Repair
A • Pillar Right Dented	Repair
Front Fender Left Dented	Repair
Front Fender Right Dented	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Damaged	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Damaged	Repair
Doorstopper Front Right Defective	Replace
Doorstopper Rear Left Defective	Replace
Doorstopper Rear Right Defective	Replace
Boot Lid / Hatch door Dented	Repair
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Dented	Repair
Sill Panel Left Paintwork • Scratched	Repair
Sill Panel Right Paintwork • Scratched	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBJB29BTX00121092

1 / 19



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

Damage	Repair Way
Rocker Panel Right Damaged	Repair
Roof Dented	Repair
Windscreen Chipped	Repair
Shock Absorber Front Left Sweat	Replace
Shock Absorber Front Right Sweat	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Mounting Rubber(s) Rear Axle Left Cracked	Replace
Mounting Rubber(s) Rear Axle Right Cracked	Replace
Tyre Front Left Torn / Cut	Replace
Tyre Front Right Defective	Replace
Spare Tyre Damaged	Replace
Rim Front Left Scratched	Repair
Rim Front Right Scratched	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Scratched	Repair
Rim Spare Wheel Dented	Repair
Chassis Damaged	Repair
Cross Member Rear Right Scratched	Repair
Sub Frame Welded	Replace
Engine to silencer pipe Defective	Repair
Belly plates Damaged	Replace
Fuel Tank Defective	Repair
Radiator Cradle Damaged	Replace
Engine	Engine bay dirty
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Some body panels misaligned
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Residual traces of repair on some body panels
Undercarriage	Vehicle undercarriage dirty
Road test	Vehicle unsafe to drive
Lights	Number plate light missing
Interior	Boot release cable missing.
Axle and suspension	Front suspension noisy
Tyres and rims	Front and rear tyre sizes different

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [kN]	Braking Force [kN]		
Front	1.8	2.04	-	
Rear	1.28	1.43	-	
Emergency / Parking	1.04	0.52	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60 R15	88H	Goodyear	Efficient	V	0719	0 mm
Front Right	185/60 R15	84H	Sumitomo	HTR H5	V	1921	0 mm
Rear Left	175/65 R15	88H	Zeta	Radial	V	3219	1 mm
Rear Right	175/65 R15	84H	Michelin	Energy	V	4116	1 mm
Spare	175/65 R15	84H	Hilo	HF201	V	0913	0 mm

* Tyre Legend: V=Virgin, R=Recap



CONDITION REPORT

VIN: MPINOB20063610916

2 / 19

DATE

30/04/2024

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE AND ECT	P1604	STARTABILITY FAULT	

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

Report No: 2016360916


VIN: MBB29BTX00121092

DATE


30/04/2024

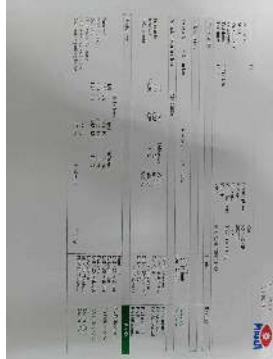

Brake and shock absorber report

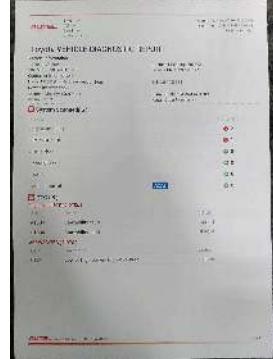

Diagnostic report page 1

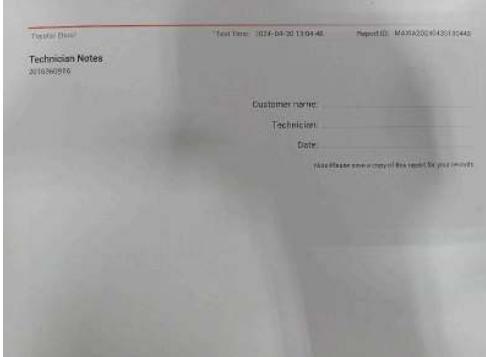

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



CONDITION REPORT

Report No: 2016360916

DATE

VIN: MBJB29B5001472024

4 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

VIN: MBJB29BTX00121092

5 / 19



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

VIN: MBJB29BTX00121092

6 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel Accessories



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

VIN: MBJB29BTX00121092

8 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024


Spare wheel and Accessories



LICENSE DISC



VIN PLATE OR STICKER

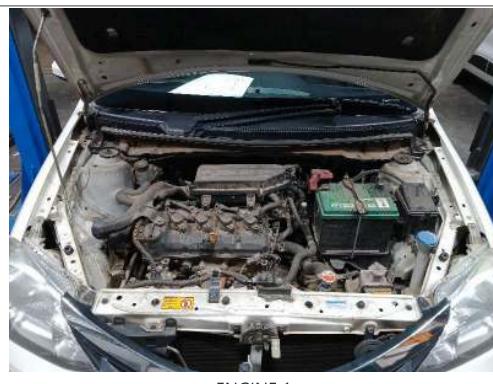

ENGINE 1



Front chassis



Rear chassis



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

VIN: MBJB29BTX00121092

10 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

Oil cap and dipstick



Front Bumper



Front Bumper



Headlight Right



Headlight Left



Bonnet



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

VIN: MBJB29BTX00121092

12 / 19



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

Windscreen



Front Fender Left



Side Mirror Left



Door Front Left



Door Rear Left



Rear Fender Left



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

VIN: MBJB29BTX00121092

14 / 19



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

Sill Panel Left



Doorstopper Rear Left

VIN: MBJB29E1X00121092

15 / 19



Seat Rear



Rear bumper



Rear bumper



Boot Lid / Hatch door



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

VIN: MBJB29BTX00121092

16 / 19



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

Rear Fender Right



Door Rear Right

VIN: MBJB29BTX00121092

17 / 19



Door Front Right



Doorstopper Rear Right



Seat Rear



Doorstopper Front Right



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

VIN: MBJB29BTX00121092

18 / 19



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

Seat Front Right



Sill Panel Right



Door Sealing Rubber Front Right



Carpet Front



Steering Wheel Trim



Hood Lining



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

Roof



Spare Tyre



Inner Boot Floor Pan and Spare Wheel Well



Rim Spare Wheel



Water level



Front Fender Right



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

Rocker Panel Right



Shock Absorber Front Right



Control Arm Bush(es) Front Axle Right



Rim Front Right



Tyre Front Right



Rim Rear Right



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

Rim Rear Left



Rim Front Left



Tyre Front Left



Control Arm Bush(es) Front Axle Left



Shock Absorber Front Left



Chassis



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

Chassis



Tyre Front Left



Tyre Front Right



Sub Frame



Radiator Cradle



Radiator Cradle



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

Radiator Cradle



Mounting Rubber(s) Rear Axle Left



Mounting Rubber(s) Rear Axle Right



Belly plates



Inner Boot Floor Pan and Spare Wheel Well



Cross Member Rear Right



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

Fuel Tank



Engine to silencer pipe



Fan



A • Pillar Right



CONDITION REPORT

Report No: 2016360916

DATE
30/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za