



## CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



### Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	07/04/2026		M57 Pretoria Road - 1619
Inspection Date	07/04/2026		Kempton Park -

### Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	FLN994L
Model	ETIOS 1.5 SPRINT 5-DR [2019-2021]	Register Number	
VIN	MBJM29BT102063399	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/05/2023
Color	WHITE	Power / Displacement	
Year Model	2019	Paint Finish	TWO COAT UNI
Km Reading	85,274 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

### Vehicle Options & Accessories

#### Items

## VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: MBJM29BT102063399



CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026

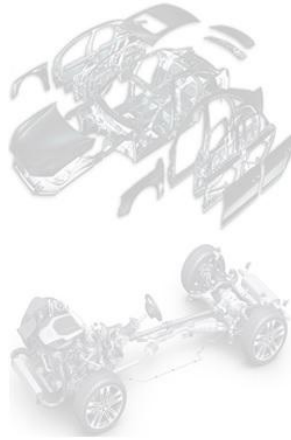

Damage	Repair Way
Engine Oil Sweat	Repair
Oil level Insufficient	Replace
Air cleaner Damaged	Replace
Hooter Defective	Repair
Windscreen Wiper Damaged	Replace
Air Conditioner Insufficient	Replace
Tail Light Right Defective	Replace
Headlight Right Damaged	Replace
Seat Rear Damaged	Repair
Sun Visor Left Cracked	Replace
Sun Visor Right Cracked	Replace
Hood Lining Damaged	Repair
Door Panel Front Left Damaged	Repair
Door Panel Front Right Damaged	Repair
Door Handle Rear Right Damaged	Replace
Dash Padding Damaged	Repair
Carpet Rear Torn / Cut	Repair
Front Bumper Damaged	Repair
Grill Damaged	Replace
Bonnet Residual Traces of Repair	Repair
Bonnet slam plate (Shock tower/ Inner tray) Damaged	Repair
A • Pillar Left Residual Traces of Repair	Repair
A • Pillar Right Residual Traces of Repair	Repair
B • Pillar Left Residual Traces of Repair	Repair
B • Pillar Right Residual Traces of Repair	Repair
C • Pillar Right Residual Traces of Repair	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Dented	Repair
Front Fender Right / Inner Tray Damaged	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Damaged	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Residual Traces of Repair	Repair
Inner Boot Floor Pan and Spare Wheel Well Dented	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Dented	Repair
Roof Residual Traces of Repair	Repair
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Shock Absorber Rear Right Leak	Replace
Alignment Poor Alignment	Repair
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Worn	Replace
Rim Front Left Scratched	Repair
Main Beam Right Dented	Repair
Chassis Welded	Repair
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Radiator Cradle Damaged	Replace
Steering Malfunction	Repair
Brakes Insufficient	Repair
Interior	Front right inner A pillar plastic trim damaged
Body and Exterior	Front bumper stiffener dented

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399



## CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026

Damage	Repair Way
Road test	Vehicle has a hard start
Airbag warning light illuminated on dashboard	Repair
Engine	Aircon condenser dented
Road test	Vehicle is a cut and joint on chassis
Road test	Vehicle safety integrity compromised

## Brakes

### Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	2.38	2.47	-	
Rear	0.13	1.44	-	
Emergency / Parking	1.02	0.76	-	

## Tyres and Rims

### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60 R15	84H	Bridgestone	Turanza	V	0919	1 mm
Front Right	185/60 R15	84H	Bridgestone	Turanza	V	0919	1 mm
Rear Left	185/60 R15	84H	Bridgestone	Turanza	V	0919	0 mm
Rear Right	185/60 R15	84H	Bridgestone	Turanza	V	1219	0 mm
Spare	185/60 R15	84H	Bridgestone	Turanza	V	4919	6 mm

\* Tyre Legend: V=Virgin, R=Recap

## Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS/VSC/TRC	C1300	SKID CONTROL ECU FAULT	

## Inspection Conditions

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

## Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Electrical Components and Instruments: Hooter not working  
Body • Exterior: Dents and scratches on some body panels. Stone chips and spray work on some body panels. Some body panels misaligned. Poor residual traces of repair on some body panels.  
Road Test: Vehicle unsafe to drive.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399



## CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026

**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

**Technician**

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399





CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399



CONDITION REPORT



Report No: 2017210529  
DATE 07/04/2026



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories



LICENSE DISC

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399



CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026



VIN PLATE OR STICKER




ENGINE 1



Front chassis



Rear Chassis

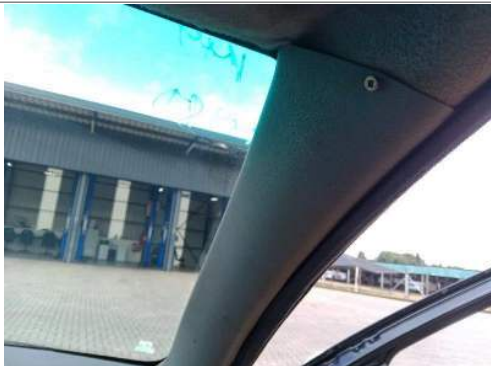

Front right inner A pillar pla



Front bumper stiffener

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399



CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026



Oil cap and dipstick



Aircon condenser



Hood Lining



Sun Visor Left



Sun Visor Right



B • Pillar Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399



CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026



A • Pillar Right



Door Panel Front Right



Door Handle Rear Right



Seat Rear



Seat Rear



Carpet Rear

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399



CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026



C • Pillar Right



Door Rear Right



Door Rear Right



Door Front Right



Door Front Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399



CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Bonnet



Front Fender Right / Inner Tray

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399



CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026



Bonnet slam plate (Shock tower/ Inner tray)



Headlight Right



Headlight Right



Bonnet slam plate (Shock tower/ Inner tray)



Air cleaner



Engine

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399



CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026



Grill



Grill



Oil level



Door Panel Front Left



A • Pillar Left



B • Pillar Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399



CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026



Door Front Left



Door Front Left



Door Rear Left



Rear Fender Left



Hooter



Tail Light Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399



CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026



Boot Lid / Hatch door



Boot Lid / Hatch door



Rear bumper



Rear bumper



Windscreen Wiper



Roof

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399



CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026



Service Brake Performance Rear Axle



Air Conditioner



Control Arm Bush(es) Front Axle Right



Control Arm Bush(es) Front Axle Left



Rim Front Left



Sill Panel Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399



CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026



Sill Panel Right



Radiator Cradle



CV Joint(s) Boot(s) Front Right (inner/outer)



Main Beam Right



Chassis



Chassis

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399



CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026



Chassis



Chassis



Tyre Rear Right



Tyre Rear Left



Shock Absorber Rear Right



Inner Boot Floor Pan and Spare Wheel Well

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399



CONDITION REPORT



Report No:  
2017210529  
DATE  
07/04/2026



Inner Boot Floor Pan and Spare Wheel Well



Water level



Hood Lining



Dash Padding

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MBJM29BT102063399