



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/02/2024		M57 Pretoria Road - 1619
Inspection Date	15/02/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	NISSAN	Registration Number	FZ83CBGP
Model	ALMERA	Register Number	
VIN	MDHBBAN17Z0718574	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	29/02/2024
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	328,332 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

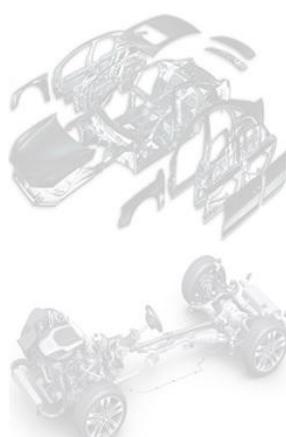

Damage	Repair Way
Air cleaner Damaged	Replace
Park Light Front Left Defective	Repair
Park Light Front Right Defective	Repair
Park Light Rear Left Defective	Repair
Tail Light Left Broken	Replace
Tail Light Right Broken	Replace
Seat Front Left Torn / Cut	Replace
Rear Lower Valance Welded	Replace
Front Bumper Damaged	Replace
Grill Damaged	Replace
Bonnet slam plate (Shock tower/ Inner tray) Dented	Repair
Front Fender Left Dented	Repair
Front Fender Right Damaged	Repair
Door Front Left Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Rear bumper Damaged	Repair
Shock Absorber Front Left Leak	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Ball Joint(s) Front Axle Left Loose / Excessive Play	Replace
Ball Joint(s) Front Axle Right Loose / Excessive Play	Replace
Tyre Front Left Excessive Wear & Tear	Replace
Tyre Front Right Torn / Cut	Replace
Tyre Rear Right Smooth	Replace
Rim Rear Right Dented	Repair
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Belly plates Damaged	Replace
Gearbox Damaged	Repair
Rear tyre size differs.	Replace.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0718574

1 / 16



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

Damage	Repair Way
Aircon condenser and radiator misaligned	on radiator cradle.

Brakes

Brake Test Results

	Left	Right	Axe Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.7	2.6	-	-
Rear	1.8	2.3	-	-
Emergency / Parking	1.6	1.6	-	-

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	84H	Firestone	Touring	V	1323	1 mm
Front Right	185/60R15	84H	Bridgestone	Potenza	V	3815	1 mm
Rear Left	205/60R15	91V	Pace	Pc20	V	4714	1 mm
Rear Right	195/60R15	88V	Continental	Contact	V	2116	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
 Vehicle doesn't start
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. SIGNS OF SPRAY WORK DONE ON ALL BODY PANELS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: MHDPAV770710578

Report No: 2046269978

2 / 16

DATE


15/02/2024

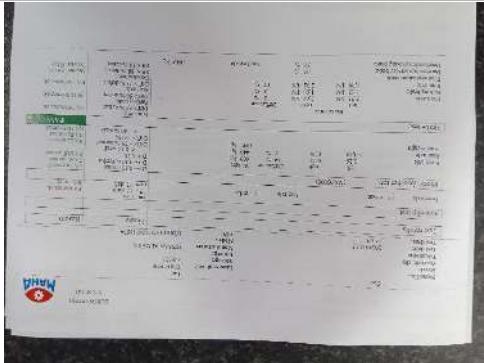

Shock and brake report



Diagnostic report

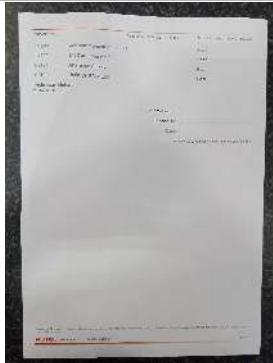

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



CONDITION REPORT

Report No: 2016269378

VIN: MDHBBAN17Z0718574

DATE

15/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016269378

DATE

VIN: MDHBBAN15/02/2024

4 / 16



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

VIN: MDHBBAN17Z0718574

5 / 16

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

VIN: MDHBBAN17Z0718574

6 / 16



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

VIN: MDHBBAN17Z0718574

7 / 16

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024


ENGINE 1



ENGINE 2



CHASSIS

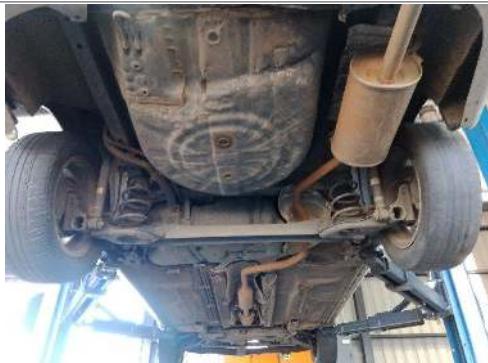

Rear end



Oil cap and dipstick



Battery damage



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

VIN: MDHBBAN17Z0718574

9 / 16



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

Battery damage



Battery damage



R/F fender liner missing.



Missing badge



L/F fender liner missing.



Aircon condenser dent.



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

VIN: MDHBBAN17Z0718574

11 / 16



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

Aircon condenser and radiator.



VIN: MDHBBAN17Z0718574

12 / 16

Coolant reservoir



Manual



No sparewheel



Tail Light Right



Tail Light Left



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

VIN: MDHBBAN17Z0718574

13 / 16



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024



Seat Front Left



Air cleaner

VIN: MDH7Z0718574

14 / 16



Bonnet slam plate (Shock tower/ Inner tray)



Front Fender Right



Control Arm Bush(es) Front Axle Right



Shock Absorber Front Left



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

VIN: MDHBBAN17Z0718574

15 / 16



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

Ball Joint(s) Front Axle Right



Front Bumper

VIN: MDHBBAM17Z0718574

16 / 16



Front Bumper



Front Bumper



Front Bumper



Front Bumper



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

Grill



Grill



Front Fender Left



Door Front Left



Tyre Front Left



Ball Joint(s) Front Axle Left



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

Door Rear Left



Bolt(s) / Nut(s) Rear Wheel Left



Rear bumper



Rear bumper



Rear bumper



Bolt(s) / Nut(s) Rear Wheel Right



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

Tyre Front Right



Front Bumper



Gearbox



Gearbox



Rim Rear Right



Tyre Rear Right



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

Rear Lower Valance



Rear Lower Valance



Rear Lower Valance



Rear Lower Valance



Rear Lower Valance



Belly plates



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

Park Light Front Left



Park Light Front Right



Park Light Rear Left





CONDITION REPORT

Report No: 2016269378

DATE
15/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za