

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/04/2025		M57 Pretoria Road - 1619
Inspection Date	23/04/2025		Kempton Park - GT

## Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	NISSAN	Registration Number	JM15BWGP
Model	ALMERA 1.5 ACENTA [2016-2023]	Register Number	
VIN	MDHBBAN17Z0730286	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	28/02/2026
Color	WHITE	Power / Displacement	
Year Model	2020	Paint Finish	C - COMMON
Km Reading	400,779 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

## Vehicle Options & Accessories

### Items

## VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Air cleaner Damaged	Repair
Seat Front Right Torn / Cut	Repair
Front Bumper Damaged	Replace
Bonnet Residual Traces of Repair	Repair
A • Pillar Left Damaged	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Dented	Repair
Door Front Left Residual Traces of Repair	Repair
Door Rear Left Residual Traces of Repair	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Damaged	Repair
Roof Dented	Repair
Control Arm Bush(es) Front Axle Right Damaged	Replace
Ball Joint(s) Front Axle Right Damaged	Replace
Tyre Front Left Excessive Wear & Tear	Replace
Tyre Rear Left Excessive Wear & Tear	Replace
Tyre Rear Right Excessive Wear & Tear	Replace

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MDHBBAN17Z0730286

Damage	Repair Way
Gearbox Leak	Repair
Warning lights illuminated	Repair

## Brakes

### Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
Front	2.5	2.7	-	
Rear	1.9	1.8	-	
Emergency / Parking	0.9	0.8	-	

## Tyres and Rims

### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65R15	91V	Nexen	Npriz	V	0000	0 mm
Front Right	195/65R15	91H	Continental	Contact	V	4522	1 mm
Rear Left	185/60R15	84H	Goodyear	Duragrip	V	0000	1 mm
Rear Right	195/60R15	88H	Firestone	Touring	V	4812	2 mm
Spare	185/65R15	91H	Goodyear	Excellence	V	0000	1 mm

\* Tyre Legend: V=Virgin, R=Recap

## Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1107	RIGHT FRONT SENSOR 2	

## Inspection Conditions

No Test Drive  
Rain at time of inspection  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

## Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of poor repair work most body panels. Signs of spray work done on some body panels. Minor dents scratches stone chips on some body panels.

## Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

## Technician

Trevino Julius


This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or


DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MDHBBAN17Z0730286


strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

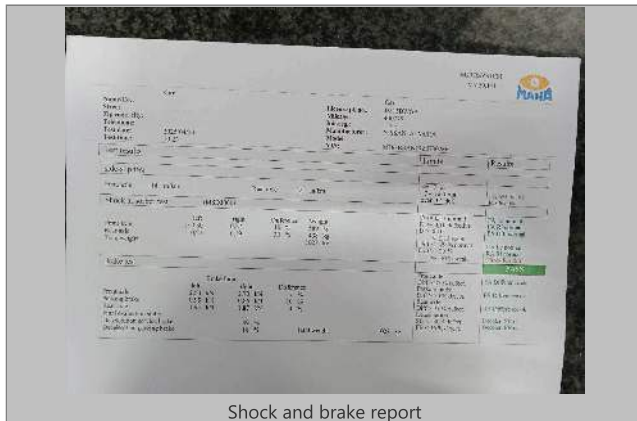

Shock and brake report

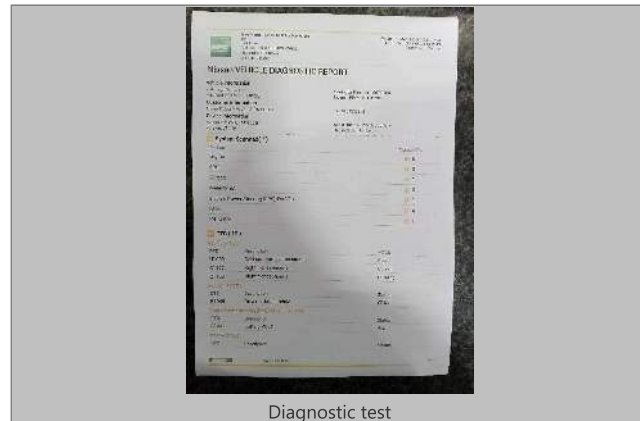

Diagnostic test

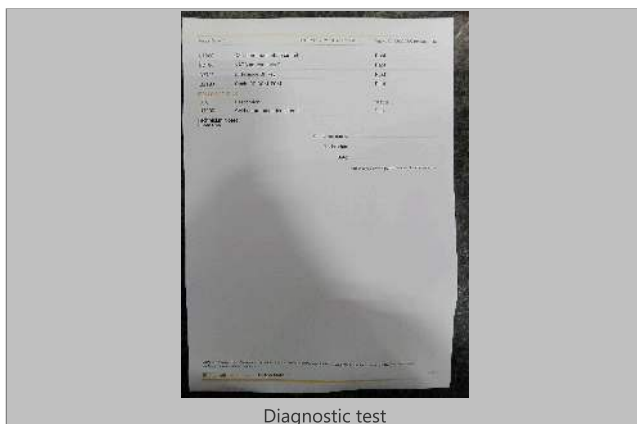

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR






90 DEGREE LEFT



LF TYRE TREAD

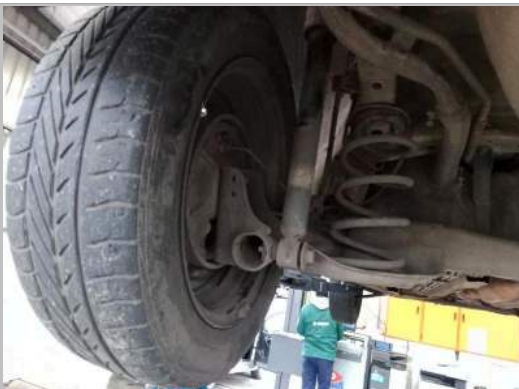

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end





Airbag warning lights



ABS warning lights illuminated



R/F fender liner missing



Coolant reservoir



Oil cap and dipstick



L/F fender liner missing





Front Fender Right



Front Fender Right



Seat Front Right



Rear Fender Left



Door Rear Left



Door Front Left



Front Fender Left



A • Pillar Left



Roof



Roof



Bonnet



Bonnet



Bonnet



Water level



Air cleaner



Engine



Control Arm Bush(es) Front Axle Right



Control Arm Bush(es) Front Axle Right



Ball Joint(s) Front Axle Right



Front Bumper



Front Bumper



Front Bumper



Tyre Front Left



Rear bumper





Rear bumper



Rear bumper



Engine



Engine



Gearbox



Tyre Rear Left



Tyre Rear Right



Sill Panel Left



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MDHBBAN17Z0730286