



CONDITION REPORT



Report No:
2017299055
DATE
15/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/09/2026		M57 Pretoria Road - 1619
Inspection Date	15/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	NISSAN	Registration Number	LJ15WNGP
Model	MAGNITE 1.0 VISIA 5-DR [2023-2025]	Register Number	
VIN	MDHFBADD0Z0018029	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2026
Color	WHITE	Power / Displacement	
Year Model	2023	Paint Finish	C - COMMON
Km Reading	197,161 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0018029



CONDITION REPORT



Report No:

2017299055

DATE

15/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Tail Light Left Damaged	Replace
Tail Light Right Chipped	Replace
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Left Torn / Cut	Repair
Seat Front Right Torn / Cut	Repair
Door Handle Front Right Damaged	Replace
Front Bumper Residual Traces of Repair	Repair
Bonnet Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Dented	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Dented	Repair
Tyre Front Left Excessive Wear & Tear	Replace
Tyre Front Right Smooth	Replace
Tyre Rear Left Torn / Cut	Replace
Tyre Rear Right Excessive Wear & Tear	Replace
Spare Tyre Excessive Wear & Tear	Replace
Rim Rear Left Deformed	Repair
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Clutch Operation Insufficient	Repair
Warning lights illuminated	Repair
Shock absorbers are weak	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.6	2.6	-	
Rear	1.5	1.8	-	
Emergency / Parking	1	1.4	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0018029



CONDITION REPORT



Report No:
2017299055
DATE
15/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/60R16	89H	MRF	Wanderer	V	2621	0 mm
Front Right	195/55R6	87H	Goodyear	Eagle	V	1722	0 mm
Rear Left	195/60R16	89V	Ceat	Securadrive	V	2621	1 mm
Rear Right	195/55R16	91V	Autogrip	Grip100	V		0 mm
Spare	195/60R16	89H	MRF	Wanderer	V	////	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE	P0657:11	MAIN RELAY CONTROL CIRCUIT CC.O	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of poor repair on body panels. Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0018029



CONDITION REPORT



Report No:
2017299055
DATE
15/09/2026

Vehicle Data				Engine Data			
Make/Model	Year	Engine No.	Car	Make/Model	Year	Engine No.	Car
Nissan X-TRAIL	2017	1111111111	1111111111	Nissan X-TRAIL	2017	1111111111	1111111111
Make/Model	Year	Engine No.	Car	Make/Model	Year	Engine No.	Car
Nissan X-TRAIL	2017	1111111111	1111111111	Nissan X-TRAIL	2017	1111111111	1111111111
Make/Model	Year	Engine No.	Car	Make/Model	Year	Engine No.	Car
Nissan X-TRAIL	2017	1111111111	1111111111	Nissan X-TRAIL	2017	1111111111	1111111111

Shock and brake report

Vehicle Data				Engine Data			
Make/Model	Year	Engine No.	Car	Make/Model	Year	Engine No.	Car
Nissan X-TRAIL	2017	1111111111	1111111111	Nissan X-TRAIL	2017	1111111111	1111111111
Make/Model	Year	Engine No.	Car	Make/Model	Year	Engine No.	Car
Nissan X-TRAIL	2017	1111111111	1111111111	Nissan X-TRAIL	2017	1111111111	1111111111
Make/Model	Year	Engine No.	Car	Make/Model	Year	Engine No.	Car
Nissan X-TRAIL	2017	1111111111	1111111111	Nissan X-TRAIL	2017	1111111111	1111111111

Diagnostics report

Vehicle Data				Engine Data			
Make/Model	Year	Engine No.	Car	Make/Model	Year	Engine No.	Car
Nissan X-TRAIL	2017	1111111111	1111111111	Nissan X-TRAIL	2017	1111111111	1111111111
Make/Model	Year	Engine No.	Car	Make/Model	Year	Engine No.	Car
Nissan X-TRAIL	2017	1111111111	1111111111	Nissan X-TRAIL	2017	1111111111	1111111111
Make/Model	Year	Engine No.	Car	Make/Model	Year	Engine No.	Car
Nissan X-TRAIL	2017	1111111111	1111111111	Nissan X-TRAIL	2017	1111111111	1111111111

Diagnostics report

Vehicle Data				Engine Data			
Make/Model	Year	Engine No.	Car	Make/Model	Year	Engine No.	Car
Nissan X-TRAIL	2017	1111111111	1111111111	Nissan X-TRAIL	2017	1111111111	1111111111
Make/Model	Year	Engine No.	Car	Make/Model	Year	Engine No.	Car
Nissan X-TRAIL	2017	1111111111	1111111111	Nissan X-TRAIL	2017	1111111111	1111111111
Make/Model	Year	Engine No.	Car	Make/Model	Year	Engine No.	Car
Nissan X-TRAIL	2017	1111111111	1111111111	Nissan X-TRAIL	2017	1111111111	1111111111

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MDHFBADD0Z0018029



CONDITION REPORT



Report No:
2017299055
DATE
15/09/2026

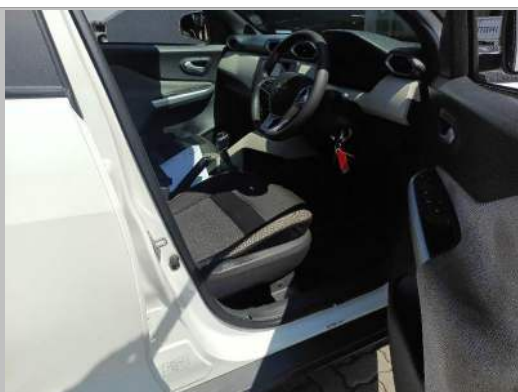

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0018029



CONDITION REPORT



Report No:

2017299055

DATE

15/09/2026



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0018029



CONDITION REPORT



Report No:

2017299055

DATE

15/09/2026



Tyre no rim



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0018029



CONDITION REPORT



Report No:

2017299055

DATE


15/09/2026



REAR



Expansion bottle

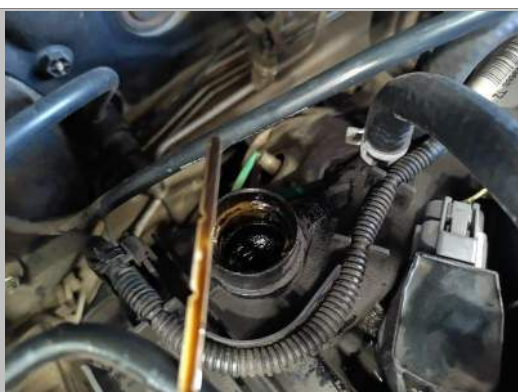

Dipstick



Warning lights illuminated



Oil cap

Test results				
side-slip test				
Front axle	-15	m/km	Rear axle	-6 m/km
Shock absorber test (MSD3000)				
	left	right	Difference	Weight
Front axle	> 0,30	0,13	57 %	732 kg
Rear axle	0,16	0,08	50 %	526 kg
Total weight				1258 kg
Brake test				
	Brake force		Difference	
Front axle	left	right		
	2,62 kN	2,65 kN	1 %	
Parking brake	1,09 kN	1,40 kN	22 %	
			14 %	

Shocks are weak

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0018029



CONDITION REPORT



Report No:

2017299055

DATE


15/09/2026



Warning lights




Front Fender Right

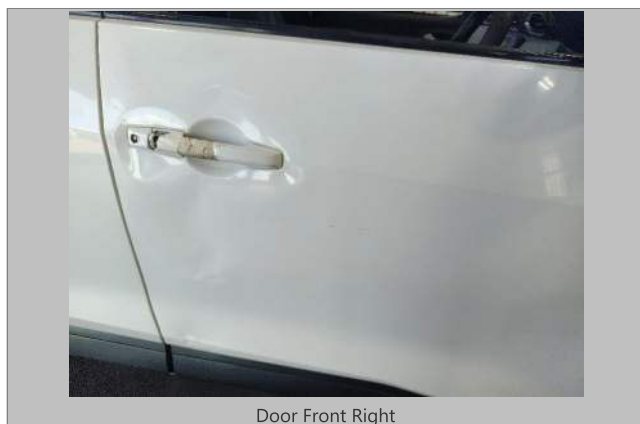

Door Front Right



Door Handle Front Right

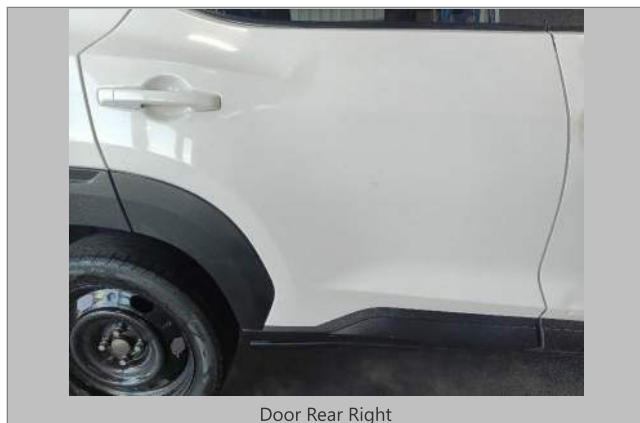

Door Rear Right



Tail Light Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0018029



CONDITION REPORT



Report No:

2017299055

DATE


15/09/2026



Rear Fender Right



Boot Lid / Hatch door

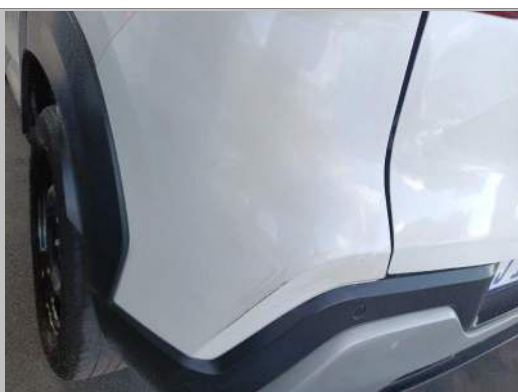

Rear Fender Left



Tail Light Left



Spare Tyre



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0018029



CONDITION REPORT



Report No:

2017299055

DATE

15/09/2026



Door Rear Left



Door Front Left



Front Fender Left



Bonnet



Bonnet



Headlight Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0018029



CONDITION REPORT



Report No:
2017299055
DATE
15/09/2026



Headlight Left



Headlight Right



Headlight Right



Water level



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0018029



CONDITION REPORT



Report No:
2017299055
DATE
15/09/2026




Front Bumper



Tyre Front Left



Rim Rear Left

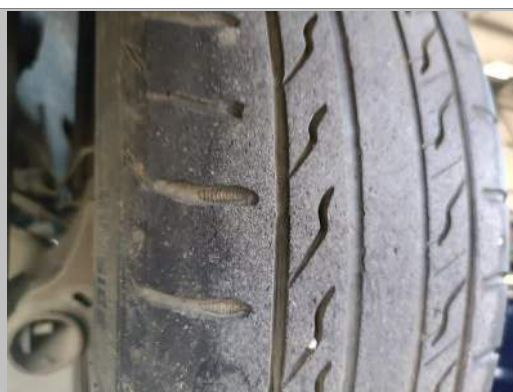

Tyre Rear Right



Tyre Front Right



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0018029



CONDITION REPORT



Report No:
2017299055
DATE
15/09/2026



Engine



CV Joint(s) Boot(s) Front Right (inner/outer)



Engine



Tyre Rear Left



Seat Front Left



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0018029

**CONDITION REPORT**

Report No:
2017299055
DATE
15/09/2026



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHFBADD0Z0018029