



CONDITION REPORT

Report No: 2016569638

DATE
14/10/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/10/2024		M57 Pretoria Road - 1619
Inspection Date	14/10/2024		Kempton Park - GT

Vehicle Data


Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	NISSAN	Registration Number	KZS501NW
Model	MAGNITE 1.0 VISIA 5-DR [2023-ON]	Register Number	
VIN	MDHFBADD0Z0020867	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/01/2025
Color	SILVER	Power / Displacement	
Year Model	2024	Paint Finish	TWO COAT METALLIC
Km Reading	17,688 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Management Lights Set	Repair
Front Bumper Damaged	Repair
Rear bumper Damaged	Repair
Tyre pressure warning light	Repair

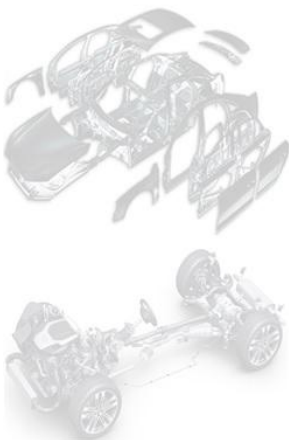



CONDITION REPORT

Report No: 2016569638

DATE
14/10/2024

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.07	2.06	-	
Rear	1.6	1.54	-	
Emergency / Parking	0.97	0.91	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/60R16	89H	MRF	Radial	V	3223	3 mm
Front Right	195/60R16	89H	MRF	Radial	V	3223	3 mm
Rear Left	195/60R16	89H	MRF	Radial	V	3223	3 mm
Rear Right	195/60R16	86H	MRF	Radial	V	3323	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	BCM	C1A83:68	WHEEL VALVE SENSOR 2	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Body • Exterior: Minor dents and scratches and stone chips. Signs of repair work done to somebody panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: MDHERAD9070030867

Report No: 2016569638


2 / 7

DATE


14/10/2024

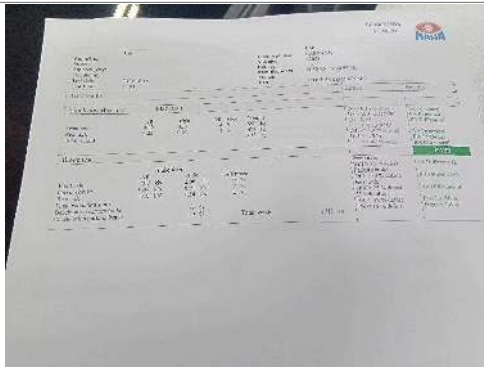

Brake and shock test

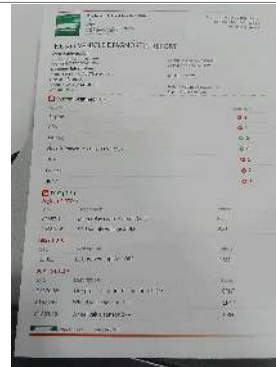

Diagnostic report

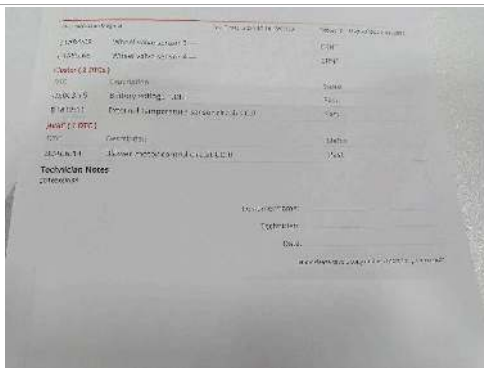

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

**CONDITION REPORT****Report No: 2016569638**

VIN: MDHFBADD0Z0020867

DATE**14/10/2024**

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016569638

DATE
VIN: MDHFBADD0Z0020867
14/10/2024
4/7

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



CONDITION REPORT

Report No: 2016569638

DATE

14/10/2024

VIN: MDHFBADD0Z0020867

5 / 7

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016569638

DATE
14/10/2024

VIN: MDHFBADD0Z0020867

6 / 7



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016569638

DATE
14/10/2024

VIN: MDHFBADD0Z0020867
7 / 7

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016569638

DATE
14/10/2024

VIN PLATE OR STICKER



ENGINE 1



ADDITIONAL 4



ADDITIONAL 5



ADDITIONAL 10



ADDITIONAL 11



CONDITION REPORT

Report No: 2016569638

DATE
14/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016569638

DATE
14/10/2024

Water level



Front Bumper



Front Bumper



Rear bumper



Engine Management Lights

**CONDITION REPORT****Report No: 2016569638****DATE**
14/10/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za