



CONDITION REPORT



Report No:
2017305818
DATE
01/10/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	01/10/2026		M57 Pretoria Road - 1619
Inspection Date	01/10/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	HV72GGGP
Model	KWID	Register Number	
VIN	MEEBBA00200621796	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	142,303 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEBBA00200621796



CONDITION REPORT



Report No:
2017305818
DATE
01/10/2026

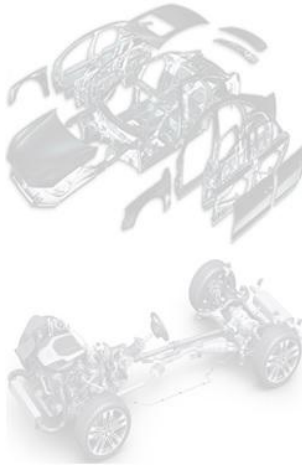

Damage	Repair Way
Engine Oil Leak	Repair
Radiator Defective	Replace
Air Conditioner Insufficient	Replace
Interior Lights Defective	Replace
Tail Light Left Cracked	Replace
Fog Light Front Left Defective	Repair
Fog Light Front Right Defective	Repair
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Right Damaged	Repair
Hood Lining Dirty	Repair
Door Handle Front Right Damaged	Replace
Door Sealing Rubber Front Left Damaged	Replace
Door Sealing Rubber Front Right Damaged	Replace
Door Sealing Rubber Rear Left Damaged	Replace
Door Sealing Rubber Rear Right Damaged	Replace
Parcel Tray Missing	Repair
Brake Pedal Rubber Damaged	Replace
Steering Wheel Trim Excessive Wear & Tear	Repair
Side Mirror Right Residual Traces of Repair	Replace
Front Bumper Damaged	Replace
Grill Damaged	Replace
Bonnet Damaged	Repair
Bonnet slam plate (Shock tower/ Inner tray) Damaged	Repair
C • Pillar Right Dented	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Front Fender Right / Inner Tray Damaged	Replace
Door Front Left Dented	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Damaged	Repair
Roof Dented	Repair
Windscreen Scratched	Repair
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	Repair
Shock Absorber Rear Right Sweat	Replace
Control Arm Bush(es) Front Axle Left Damaged	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Mounting Rubber(s) Rear Axle Left Cracked	Replace
Mounting Rubber(s) Rear Axle Right Cracked	Replace
Tyre Front Right Damaged	Replace
Spare Tyre Damaged	Replace
Main Beam Right Damaged	Repair
Chassis Scratched	Repair
Engine to silencer pipe Welded	Replace
Gearbox Oil Leak	Repair
Fuel Tank Damaged	Replace
Radiator Cradle Damaged	Replace
Front right shock absorber weak	Replace
Service and Brake decelerations defective	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT



Report No:
2017305818
DATE
01/10/2026

Damage

Repair Way

Fan Cowley damaged	Replace
Aircon condenser damaged	Replace
Front bumper stiffener damaged	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.58	1.92	-	
Rear	0.78	0.7	-	
Emergency / Parking	0.81	0.62	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	155/80 R13	79T	Autogrip	P308	V	0125	3 mm
Front Right	155/80 R13	79T	Autogrip	P308	V	0125	3 mm
Rear Left	155/80 R13	79T	Dunlop	Sp-Touring	V	2524	4 mm
Rear Right	155/80 R13	79T	Autogrip	P308	V	0125	5 mm
Spare	155/80 R13	79T	Jk tyre	Ultima-Neo	V	2817	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJ(INJECTION)	DTC022664	BRAKE/ACCELERATOR PEDAL POSITIONS SIGNAL PLAUSIBIL	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. VEHICLE LICENSE DISK NOT AN ORIGINAL COPY.Lights: Front left and right fog light bulbs missing.
Interior: Vehicle interior dirty and panels scratched.Front and rear seats fully covered.Boot release handle not opening.
Body • Exterior: Poor residual traces of repair on body panels.Body panels misaligned.Stone chips and spray work on body panels.Dents and scratches on body panels.Signs of impact damage to front of vehicle.Vehicle safety integrity compromised.

Concluding Remarks

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT



Report No:
2017305818
DATE
01/10/2026

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT



Report No:

Report No:
2017305818

DATE _____

01/10/2026

[illegible]

Brake and shock absorber report

[illegible]

Diagnostic report page 1

[illegible]

Diagnostic report page 2

NAME: <u>W</u>	PHONE NO.: <u>1-800-3</u>	DATE OF BIRTH: <u>10/10/1980</u>
PERSONAL INFO		
SSN: <u>123-45-6789</u>	DOB: <u>10/10/1980</u>	
STREET: <u>123 Main St</u>	CITY: <u>Anytown</u>	STATE: <u>CA</u>
ZIP: <u>90210</u>		
EMAIL: <u>john.doe@xyz.com</u>		
PHONE: <u>555-123-4567</u>		
EMPLOYMENT INFO		
COMPANY: <u>ABC Corp</u>	POSITION: <u>Software Engineer</u>	
START DATE: <u>2015-01-01</u>	END DATE: <u>2020-12-31</u>	
EDUCATION INFO		
SCHOOL: <u>Stanford Univ</u>	DEGREE: <u>BS in Computer Science</u>	
GRADUATION DATE: <u>2008-05-15</u>		
ADDITIONAL INFO		
REMARKS: <u>See attached resume for more details.</u>		
Signature: _____ Date: _____ Title: _____ Company: _____		

Diagnostic report page 3



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT



Report No:
2017305818
DATE
01/10/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT



Report No:

2017305818

DATE

01/10/2026



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT




Report No:

2017305818

DATE

01/10/2026

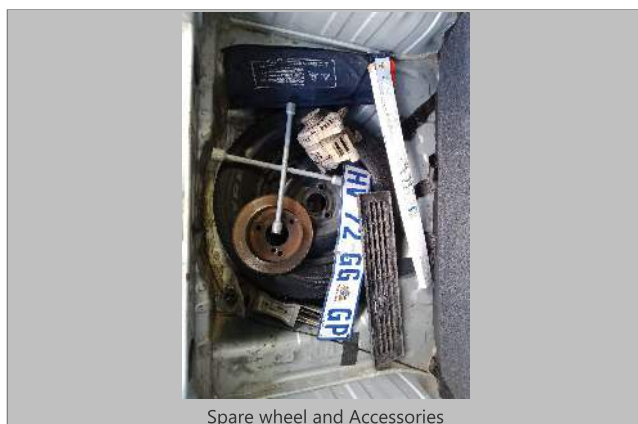

Spare wheel and Accessories




LICENSE DISC




VIN PLATE OR STICKER



ENGINE 1

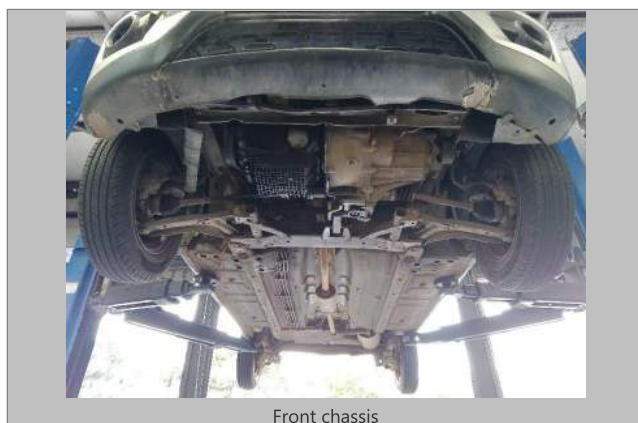

Front chassis

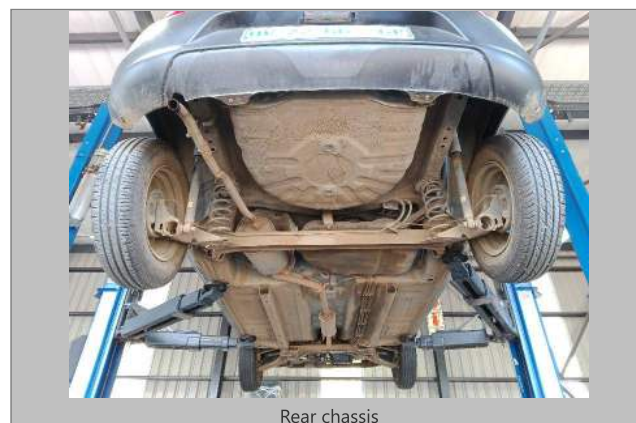

Rear chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT



Report No:
2017305818
DATE
01/10/2026



Aircon condenser



Front bumper stiffener



Fan Cowley



Oil cap and dipstick



Hood Lining



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT



Report No:
2017305818
DATE
01/10/2026



Door Sealing Rubber Front Right



Door Sealing Rubber Rear Right



C • Pillar Right



Front Fender Right



Side Mirror Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT



Report No:
2017305818
DATE
01/10/2026



Door Rear Right



Boot Lid / Hatch door



Rear bumper



Rear bumper



Rear bumper



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT




Report No:
2017305818
DATE
01/10/2026



Tail Light Left



Door Rear Left

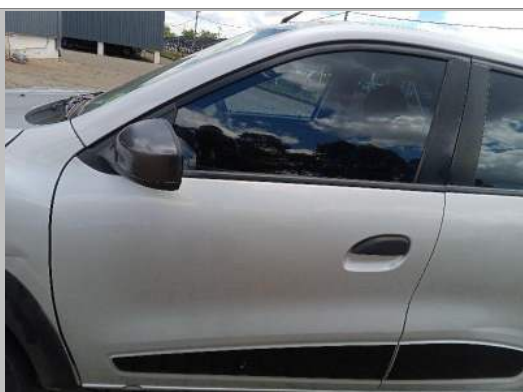

Door Front Left



Door Sealing Rubber Rear Left



Door Sealing Rubber Front Left



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT



Report No:
2017305818
DATE
01/10/2026



Bonnet



Grill



Front Bumper



Front Bumper



Front Bumper



Headlight Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT



Report No:
2017305818
DATE
01/10/2026



Headlight Left



Windscreen



Door Handle Front Right



Brake Pedal Rubber



Steering Wheel Trim



Air Conditioner

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT



Report No:
2017305818
DATE
01/10/2026

Brake test					
	Brake force		Difference	Creeping	
	left	right		left	right
Tram axle	1.58 kN	1.07 kN	17 %	— %	— %
Parking brake	0.81 kN	0.62 kN	24 %	— %	— %
Max axle	0.78 kN	0.70 kN	10 %	92 %	92 %
Final evaluation static					
Deceleration service brake		51 %			
Deceleration parking brake		35 %			
			Total weight	1000 kg	

Service Brake Performance Rear Axle



Main Beam Right



Front Fender Right / Inner Tray



Control Arm Bush(es) Front Axle Right



Grill



Fog Light Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT



Report No:
2017305818
DATE
01/10/2026



Fog Light Front Right



Control Arm Bush(es) Front Axle Left



Sill Panel Left



Sill Panel Left



Engine to silencer pipe



Sill Panel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT



Report No:

2017305818

DATE

01/10/2026



Engine to silencer pipe




Engine



Radiator



Radiator Cradle

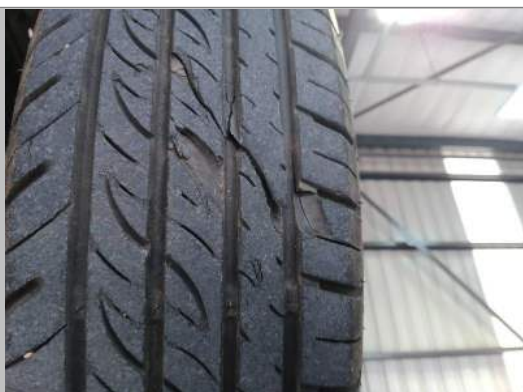

Tyre Front Right



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT



Report No:
2017305818
DATE
01/10/2026



Radiator Cradle



Main Beam Right



Chassis



Chassis



Fuel Tank



Mounting Rubber(s) Rear Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796




CONDITION REPORT



Report No:
2017305818
DATE
01/10/2026



Mounting Rubber(s) Rear Axle Right

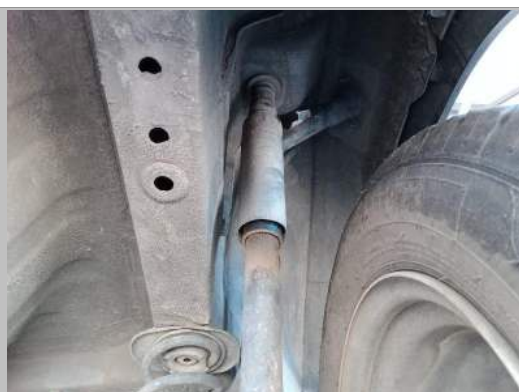

Shock Absorber Rear Right



Inner Boot Floor Pan and Spare Wheel Well



Parcel Tray



Spare Tyre



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00200621796



CONDITION REPORT



Report No:
2017305818
DATE
01/10/2026



Bonnet slam plate (Shock tower/ Inner tray)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



Interior Lights

VIN: MEEBBA00200621796