



## CONDITION REPORT



Report No:  
2017295668  
DATE  
09/09/2026

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 09/09/2026        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 09/09/2026        |                     | Kempton Park -           |

## Vehicle Data

|                 |                                     |                         |                   |
|-----------------|-------------------------------------|-------------------------|-------------------|
| Vehicle Type    | PASSENGER VEHICLE                   | Registered Owner        | MFC AUCTION HOUSE |
| Manufacturer    | RENAULT                             | Registration Number     | JJ82KMGP          |
| Model           | KWID 1.0 DYNAMIQUE 5-DR [2016-2019] | Register Number         |                   |
| VIN             | MEEBBA00400487258                   | Date Of First Licensing |                   |
| Engine Number   |                                     | Last COR                |                   |
| Doors           | 5                                   | License Expiry Date     |                   |
| Color           | WHITE                               | Power / Displacement    |                   |
| Year Model      | 2017                                | Paint Finish            | C - COMMON        |
| Km Reading      | 125,479 KM                          | Fuel                    | PETROL            |
| Cab / Body Type | HATCHBACK                           | Transmission            | MANUAL            |

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MEEBBA00400487258



## CONDITION REPORT



Report No:

2017295668

DATE

09/09/2026

## Damage

## Repair Way

|                                                       |                                               |
|-------------------------------------------------------|-----------------------------------------------|
| Engine Oil Leak                                       | Repair                                        |
| Engine Wiring Defective                               | Repair                                        |
| Air cleaner Damaged                                   | Replace                                       |
| Windscreen Wiper Missing                              | Replace                                       |
| Headlight Left Damaged                                | Replace                                       |
| Headlight Right Damaged                               | Replace                                       |
| Dash Padding Damaged                                  | Repair                                        |
| Side Mirror Left Paintwork • Scratched                | Repair                                        |
| Front Bumper Cracked                                  | Replace                                       |
| Grill Damaged                                         | Replace                                       |
| Bonnet Residual Traces of Repair                      | Repair                                        |
| Front Fender Right Dented                             | Repair                                        |
| Rear Fender Left Paintwork • Scratched                | Repair                                        |
| Rear Fender Right Paintwork • Scratched               | Repair                                        |
| Door Front Left Paintwork • Scratched                 | Repair                                        |
| Door Front Right Dented                               | Repair                                        |
| Door Rear Left Paintwork • Scratched                  | Repair                                        |
| Boot Lid / Hatch door Residual Traces of Repair       | Repair                                        |
| Boot Lid / Hatch Door Shock Left Defective            | Replace                                       |
| Boot Lid / Hatch Door Shock Right Defective           | Replace                                       |
| Fuel Flap Defective                                   | Repair                                        |
| Windscreen Cracked                                    | Replace                                       |
| Control Arm(s) Front Axle Left Deformed               | Repair                                        |
| Control Arm Bush(es) Front Axle Left Cracked          | Replace                                       |
| Control Arm Bush(es) Front Axle Right Cracked         | Replace                                       |
| Engine to silencer pipe Welded                        | Repair                                        |
| Gearbox Oil Sweat                                     | Repair                                        |
| CV Joint(s) Boot(s) Front Left (inner/outer) Damaged  | Replace                                       |
| CV Joint(s) Boot(s) Front Right (inner/outer) Damaged | Replace                                       |
| Warning lights illuminated                            | Repair                                        |
| Body exterior                                         | Residual traces of poor repair on body panels |
| Body exterior                                         | Signs of spray work done on body panels       |

## Brakes

## Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 1.5                | 1.8                | -                |                                  |
| Rear                | 0.9                | 0.7                | -                |                                  |
| Emergency / Parking | 0.8                | 0.7                | -                |                                  |

DEKRA Automotive (PTY) Ltd.  
 97 Willem Cruywagen Ave  
 Klerksoord, Pretoria, 0200  
 Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MEEBBA00400487258



## CONDITION REPORT



Report No:

2017295668

DATE

09/09/2026

## Tyres and Rims

## Tyre Specification &amp; Measurement

|             | Size      | Load/Speed Index | Manufacture | Model      | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|------------|-------|-----------------|------------------|
| Front Left  | 155/80R13 | 79T              | Jk tyre     | Ultima neo | V     | 1417            | 2 mm             |
| Front Right | 155/80R13 | 79T              | Jk tyre     | Ultima neo | V     | 1417            | 2 mm             |
| Rear Left   | 155/80R13 | 79T              | Jk tyre     | Ultima neo | V     | 1417            | 5 mm             |
| Rear Right  | 155/80R13 | 79T              | Jk tyre     | Ultima neo | V     | 1417            | 6 mm             |
| Spare       | 155/80R13 | 79T              | Ceat        | Milaze     | V     | 0000            | 1 mm             |

\* Tyre Legend: V=Virgin, R=Recap

## Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System    | Code      | Description                                       | Status |
|----|-----------|-----------|---------------------------------------------------|--------|
| 1  | INJECTION | DTC065711 | MAIN RELAY CONTROL CIRCUIT SHORT CIRCUIT TO EARTH |        |

## Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

## Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

## Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

## Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MEEBBA00400487258



## CONDITION REPORT



Report No:

2017295668

DATE

09/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE FRONT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MEEBBA00400487258



## CONDITION REPORT



Report No:  
2017295668  
DATE  
09/09/2026



ODOMETER




DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual transmission

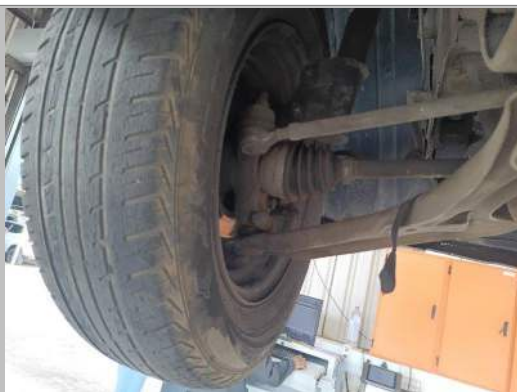

LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MEEBBA00400487258



## CONDITION REPORT



Report No:  
2017295668  
DATE  
09/09/2026



RF TYRE TREAD



RR TYRE TREAD



Sparewheel



Coolant reservoir



Dipstick



warning lights illuminated

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MEEBBA00400487258



## CONDITION REPORT



Report No:

2017295668

DATE


09/09/2026



Both levers not working



Oil cap

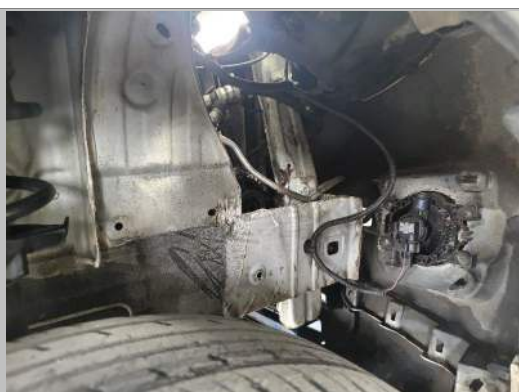

R/F fender liner missing



REAR



ENGINE 1



ENGINE 2

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MEEBBA00400487258



## CONDITION REPORT



Report No:  
2017295668  
DATE  
09/09/2026




CHASSIS



VIN PLATE OR STICKER



LICENSE DISC

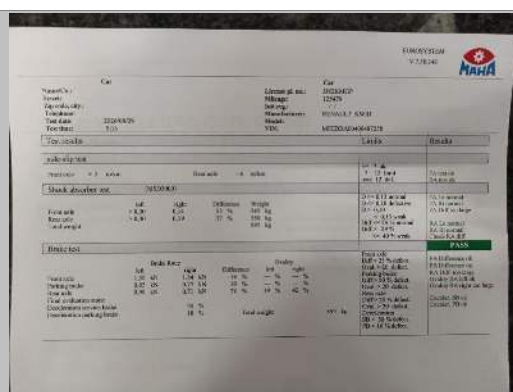

SHOCK AND BRAKE REPORT



DIAGNOSTIC REPORT PAGE 1



DIAGNOSTIC REPORT PAGE 2

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MEEBBA00400487258



## CONDITION REPORT



Report No:


2017295668

DATE

09/09/2026



DIAGNOSTIC REPORT PAGE 3

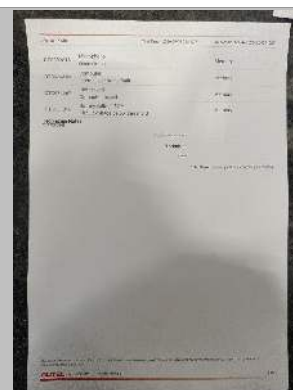

DIAGNOSTIC REPORT PAGE 4



Windscreen



Windscreen



Windscreen



Windscreen Wiper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MEEBBA00400487258



## CONDITION REPORT



Report No:

2017295668

DATE

09/09/2026



Front Fender Right



Front Fender Right



Door Front Right



Rear Fender Right



Boot Lid / Hatch door



Rear Fender Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MEEBBA00400487258



## CONDITION REPORT



Report No:  
2017295668  
DATE  
09/09/2026



Door Rear Left



Door Front Left



Side Mirror Left



Bonnet



Bonnet



Bonnet

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MEEBBA00400487258



## CONDITION REPORT



Report No:  
2017295668  
DATE  
09/09/2026



Grill




Engine Wiring



Engine Wiring



Headlight Right

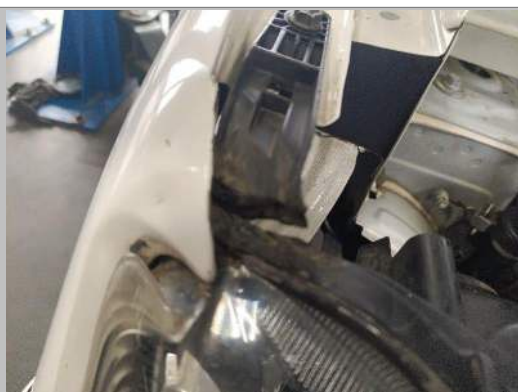

Headlight Right



Headlight Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MEEBBA00400487258



## CONDITION REPORT



Report No:

2017295668

DATE

09/09/2026



Air cleaner



Control Arm Bush(es) Front Axle Right



Front Bumper



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MEEBBA00400487258



## CONDITION REPORT



Report No:  
2017295668  
DATE  
09/09/2026



Control Arm Bush(es) Front Axle Left



Control Arm(s) Front Axle Left



Control Arm(s) Front Axle Left



CV Joint(s) Boot(s) Front Left (inner/outer)



Gearbox



Gearbox

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MEEBBA00400487258




## CONDITION REPORT



Report No:  
2017295668  
DATE  
09/09/2026



CV Joint(s) Boot(s) Front Right (inner/outer)

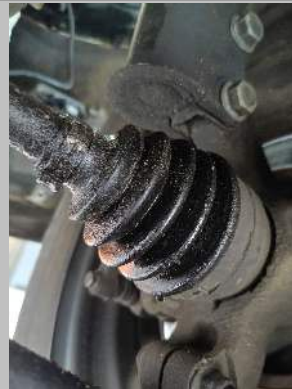

CV Joint(s) Boot(s) Front Right (inner/outer)



Engine



Engine



Engine



Engine

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)


VIN: MEEBBA00400487258



## CONDITION REPORT




Report No:  
2017295668  
DATE  
09/09/2026

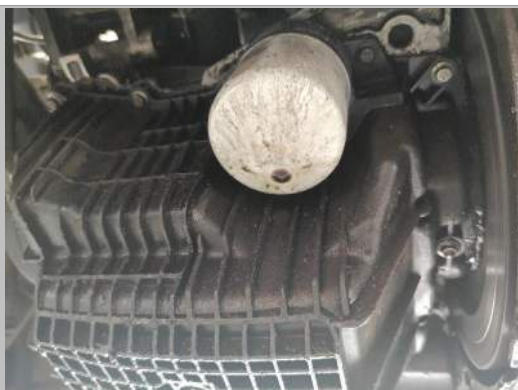

Engine



Engine to silencer pipe

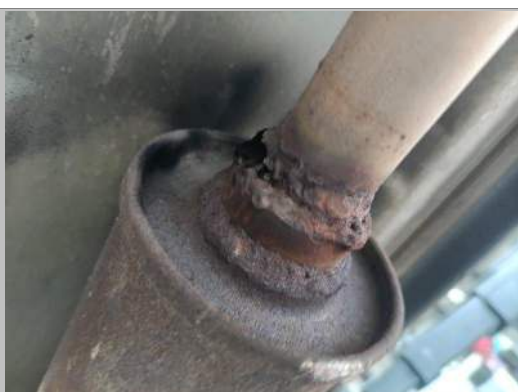

Engine to silencer pipe



Engine to silencer pipe



Engine to silencer pipe



Engine to silencer pipe

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MEEBBA00400487258



## CONDITION REPORT



Report No:  
2017295668  
DATE  
09/09/2026



Engine to silencer pipe



Dash Padding



Dash Padding



Bonnet



Bonnet



Fuel Flap

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)


VIN: MEEBBA00400487258




## CONDITION REPORT



Report No:  
2017295668  
DATE  
09/09/2026

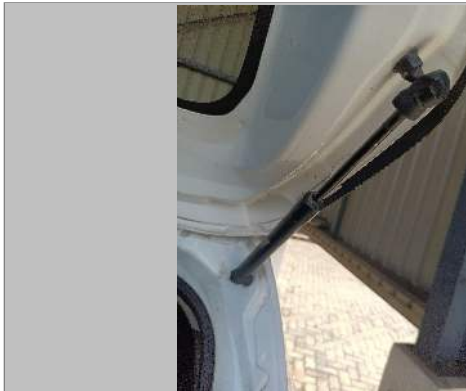

Boot Lid / Hatch Door Shock Right

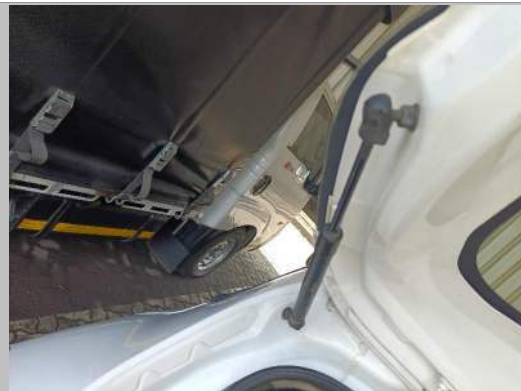

Boot Lid / Hatch Door Shock Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MEEBBA00400487258