



CONDITION REPORT



Report No:
2017305129
DATE
30/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/09/2026		M57 Pretoria Road - 1619
Inspection Date	30/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	KD30WKGP
Model	KWID	Register Number	
VIN	MEEBBA00400621296	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2027
Color	RED	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	112,959 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEBBA00400621296



CONDITION REPORT



Report No:
2017305129
DATE
30/09/2026

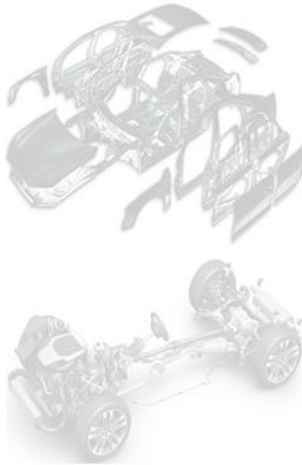

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Replace
Hoses Damaged	Replace
Air cleaner Damaged	Repair
Central Air Vent Damaged	Replace
Tail Light Right Damaged	Replace
Fog Light Front Right Defective	Repair
Headlight Right Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Interior Mirror Missing	Replace
Hood Lining Dirty	Repair
Door Sealing Rubber Front Left Damaged	Replace
Door Sealing Rubber Front Right Damaged	Replace
Door Sealing Rubber Rear Left Damaged	Replace
Door Lock Boot Lid Damaged	Replace
Window Winder rear left Defective	Repair
Boot Carpet Damaged	Repair
Steering Wheel Trim Excessive Wear & Tear	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Damaged	Repair
Bonnet slam plate (Shock tower/ Inner tray) Damaged	Repair
B • Pillar Left Dented	Repair
C • Pillar Right Dented	Repair
Front Fender Left Dented	Repair
Front Fender Right Damaged	Repair
Rear Fender Right Dented	Repair
Front Fender Left / Inner Tray Damaged	Replace
Front Fender Right / Inner Tray Damaged	Replace
Rear Fender Right / Inner Tray Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Damaged	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Residual Traces of Repair	Replace
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Residual Traces of Repair	Repair
Sill Panel Left Damaged	Repair
Brake Piping Damaged	Repair
Service Brake Performance Rear Axle Left / Right Difference out of legal range	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Rear Axle Defective	Repair
Control Arm Bush(es) Front Axle Left Damaged	Replace
Control Arm Bush(es) Front Axle Right Damaged	Replace
Mounting Rubber(s) Rear Axle Left Cracked	Replace
Mounting Rubber(s) Rear Axle Right Cracked	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Damaged	Replace
Main Beam Left Damaged	Repair
Main Beam Right Damaged	Repair
Chassis Dented	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:
2017305129
DATE
30/09/2026

Damage	Repair Way
Engine to silencer pipe Welded	Replace
Silencer Missing	Replace
Gearbox Oil Sweat	Repair
Radiator Cradle Damaged	Replace
Jack Missing	Replace
Front right shock absorber weak	Replace
Firewall insulation cover damaged	Replace
Spare wheel missing	Replace
Rear left and right tyre sizes different	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.78	1.92	-	
Rear	1.21	0.52	-	
Emergency / Parking	1.1	0.52	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	155/80 R13	79T	Firestone	Touring	V	1418	0 mm
Front Right	155/80 R13	79T	Jk tyre	Ultima-Neo	V	1018	2 mm
Rear Left	175R13LT	97Q	Brightway	Radial	V	0921	4 mm
Rear Right	155/80 R13	79T	Sava	Effecta	V	4018	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJ(INJECTION)	DTC009517	AIR TEMPERATURE SENSOR CIRCUIT SIGNAL OUTSIDE UPPE	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Signs of rodent in engine bay.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:
2017305129
DATE
30/09/2026

Lights: Front right fog light lens faded.

Interior: Vehicle interior dirty and panels scratched.

Body • Exterior: Poor residual traces of repair on body panels. Body panels misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels. Signs of damage to front and rear of vehicle. Boot does not open.

Brakes: Rear right brake piping bend

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:
2017305129
DATE
30/09/2026

Page No: 1			
Page Title: Brake and shock absorber report			
Page Sub Title: Brake and shock absorber report			
Page Date: 30/09/2026			
Page Time: 11:04			
Page User: MEEBBA00400621296			
Page Version: 1.0			
Page Author: MEEBBA00400621296			
Page Editor: MEEBBA00400621296			
Page Reviewer: MEEBBA00400621296			
Page Approver: MEEBBA00400621296			
Page Status: PENDING			
Page Category: Brake and shock absorber report			
Page Sub Category: Brake and shock absorber report			
Page Keywords: Brake and shock absorber report			
Page Description: Brake and shock absorber report			
Page Content: Brake and shock absorber report			
Page Footer: Brake and shock absorber report			

Brake and shock absorber report

Page No: 2			
Page Title: Diagnostic report page 1			
Page Sub Title: Diagnostic report page 1			
Page Date: 30/09/2026			
Page Time: 11:04			
Page User: MEEBBA00400621296			
Page Version: 1.0			
Page Author: MEEBBA00400621296			
Page Editor: MEEBBA00400621296			
Page Reviewer: MEEBBA00400621296			
Page Approver: MEEBBA00400621296			
Page Status: PENDING			
Page Category: Diagnostic report page 1			
Page Sub Category: Diagnostic report page 1			
Page Keywords: Diagnostic report page 1			
Page Description: Diagnostic report page 1			
Page Content: Diagnostic report page 1			
Page Footer: Diagnostic report page 1			

Diagnostic report page 1

Page No: 3			
Page Title: Diagnostic report page 2			
Page Sub Title: Diagnostic report page 2			
Page Date: 30/09/2026			
Page Time: 11:04			
Page User: MEEBBA00400621296			
Page Version: 1.0			
Page Author: MEEBBA00400621296			
Page Editor: MEEBBA00400621296			
Page Reviewer: MEEBBA00400621296			
Page Approver: MEEBBA00400621296			
Page Status: PENDING			
Page Category: Diagnostic report page 2			
Page Sub Category: Diagnostic report page 2			
Page Keywords: Diagnostic report page 2			
Page Description: Diagnostic report page 2			
Page Content: Diagnostic report page 2			
Page Footer: Diagnostic report page 2			

Diagnostic report page 2

Page No: 4			
Page Title: Diagnostic report page 3			
Page Sub Title: Diagnostic report page 3			
Page Date: 30/09/2026			
Page Time: 11:04			
Page User: MEEBBA00400621296			
Page Version: 1.0			
Page Author: MEEBBA00400621296			
Page Editor: MEEBBA00400621296			
Page Reviewer: MEEBBA00400621296			
Page Approver: MEEBBA00400621296			
Page Status: PENDING			
Page Category: Diagnostic report page 3			
Page Sub Category: Diagnostic report page 3			
Page Keywords: Diagnostic report page 3			
Page Description: Diagnostic report page 3			
Page Content: Diagnostic report page 3			
Page Footer: Diagnostic report page 3			

Diagnostic report page 3

Page No: 5			
Page Title: Diagnostic report page 4			
Page Sub Title: Diagnostic report page 4			
Page Date: 30/09/2026			
Page Time: 11:04			
Page User: MEEBBA00400621296			
Page Version: 1.0			
Page Author: MEEBBA00400621296			
Page Editor: MEEBBA00400621296			
Page Reviewer: MEEBBA00400621296			
Page Approver: MEEBBA00400621296			
Page Status: PENDING			
Page Category: Diagnostic report page 4			
Page Sub Category: Diagnostic report page 4			
Page Keywords: Diagnostic report page 4			
Page Description: Diagnostic report page 4			
Page Content: Diagnostic report page 4			
Page Footer: Diagnostic report page 4			

Diagnostic report page 4



FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:
2017305129
DATE
30/09/2026



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:

2017305129

DATE

30/09/2026



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



RF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:

2017305129

DATE

30/09/2026



RR TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:
2017305129
DATE
30/09/2026



Oil cap and dipstick



Spare wheel Accessories



Firewall insulation cover



Central Air Vent



Steering Wheel Trim



Door Sealing Rubber Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296




CONDITION REPORT



Report No:
2017305129
DATE
30/09/2026



Seat Front Right

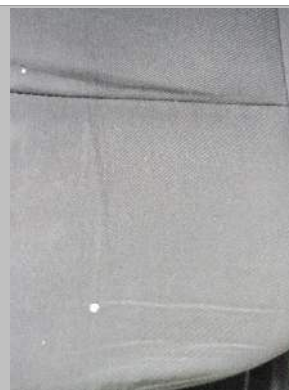

Seat Front Right



Door Sealing Rubber Rear Left



Inner Boot Floor Pan and Spare Wheel Well



Inner Boot Floor Pan and Spare Wheel Well



Rear Fender Right / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:


2017305129

DATE

30/09/2026



Boot Carpet

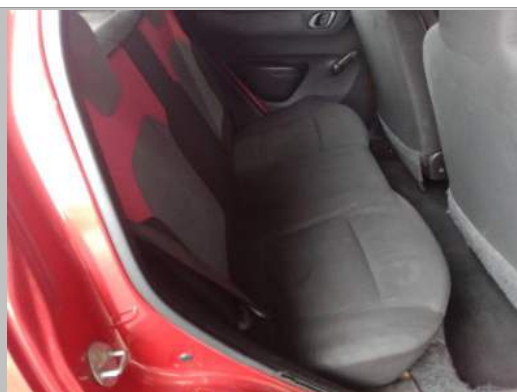

Seat Rear



Door Rear Right



Door Front Right



Side Mirror Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:

2017305129

DATE

30/09/2026



Front Fender Right / Inner Tray



Rear Fender Right / Inner Tray



Rear bumper



Rear bumper



Boot Lid / Hatch door



Tail Light Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:

2017305129

DATE


30/09/2026



Door Rear Left



Door Front Left

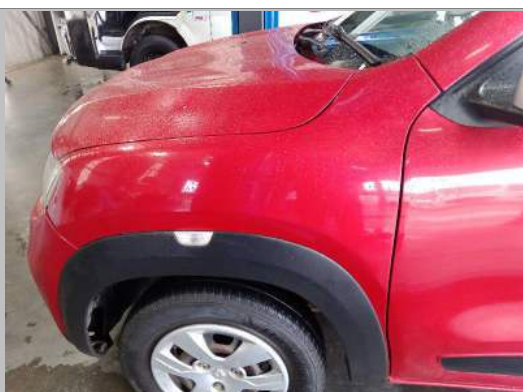

Front Fender Left



B • Pillar Left



Seat Front Left



Door Sealing Rubber Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:
2017305129
DATE
30/09/2026



Seat Rear



Window Winder rear left



Front Fender Left / Inner Tray



Bonnet



Fog Light Front Right

Brake test						Unit
	Brake force		Difference		Quality	
	left	right		left	right	
Front axle	1,78 kN	1,52 kN	7 %	— %	— %	Pa
Parking brake	1,10 kN	0,17 kN	83 %	— %	— %	Pa
Rear axle	1,21 kN	0,22 kN	82 %	53 %	59 %	Pa
Final readout on stick						Pa
Deceleration service brake		60 %				Pa
Deceleration parking brake		18 %				Pa
Total weight						925 kg

Service Brake Performance Rear Axle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:
2017305129
DATE
30/09/2026

Brake test					
	Brake force		Difference	Ovality	
	left	right		left	right
Front axle	1,78 kN	1,92 kN	7 %	— %	— %
Parking brake	1,10 kN	0,72 kN	33 %	— %	— %
Rear axle	1,21 kN	0,52 kN	57 %	51 %	29 %
Final evaluation static					
Deceleration service brake	60 %		Total weight		929 kg
Deceleration parking brake	18 %				

Parking Brake Performance



Headlight Right



Hoses



Engine Wiring



Hoses



Air cleaner

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:
2017305129
DATE
30/09/2026



Bonnet slam plate (Shock tower/ Inner tray)



Tyre Front Right



Control Arm Bush(es) Front Axle Right



Main Beam Right



Engine to silencer pipe



Engine to silencer pipe

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:
2017305129
DATE
30/09/2026



Main Beam Left



Sill Panel Left



Sill Panel Left



Control Arm Bush(es) Front Axle Left



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:
2017305129
DATE
30/09/2026



Silencer



Gearbox



Engine



Tyre Front Left



Radiator Cradle



Chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:
2017305129
DATE
30/09/2026



Chassis



Mounting Rubber(s) Rear Axle Right



Mounting Rubber(s) Rear Axle Left



Rear Axle



Brake Piping



C • Pillar Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296



CONDITION REPORT



Report No:
2017305129
DATE
30/09/2026



Door Lock Boot Lid



Water level



Interior Mirror



Hood Lining



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00400621296