



CONDITION REPORT



Report No:
2017302308
DATE
22/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/09/2026		M57 Pretoria Road - 1619
Inspection Date	22/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	KJ76TYGP
Model	KIGER	Register Number	
VIN	MEEHBC00300032827	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2026
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	66,401 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00300032827



CONDITION REPORT




Report No:
2017302308
DATE
22/09/2026

Damage

Repair Way

Engine Oil Sweat	Repair
Seat Front Right Torn / Cut	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Shock Absorber Rear Left Leak	Replace
R/R reflector missing	Replace

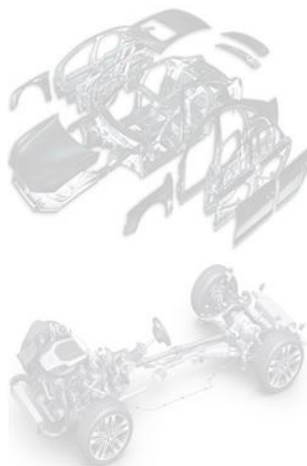

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.3	2.3	-	
Rear	1.5	1.8	-	
Emergency / Parking	1.2	1.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/60R16	89H	Royal black	Mile	V	3325	2 mm
Front Right	195/60R16	89H	Royal black	Mile	V	3325	5 mm
Rear Left	195/60R16	89H	Royal black	Mile	V	3325	5 mm
Rear Right	195/60R16	89H	Royal black	Mile	V	3325	5 mm
Spare	185/65R15	88R	Ceat	Temporary	V	0000	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00300032827



CONDITION REPORT



Report No:

2017302308

DATE

22/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INSTRUMENT PANEL	DTC941113	OIL PRESSURE SENSOR CIRCUIT OPEN CIRCUIT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00300032827



CONDITION REPORT




Report No:
2017302308
DATE
22/09/2026

Car				Car			
Make/Model	Subaru	Make/Model	Subaru	Make/Model	Subaru	Make/Model	Subaru
Year	2016	Year	2016	Year	2016	Year	2016
Registration	2016/01	Registration	2016/01	Registration	2016/01	Registration	2016/01
Test results				Test results			
Shock absorbers	Pass	Shock absorbers	Pass	Shock absorbers	Pass	Shock absorbers	Pass
Brake pads	Pass	Brake pads	Pass	Brake pads	Pass	Brake pads	Pass
Brake discs	Pass	Brake discs	Pass	Brake discs	Pass	Brake discs	Pass
Brake master cylinder	Pass	Brake master cylinder	Pass	Brake master cylinder	Pass	Brake master cylinder	Pass
Brake booster	Pass	Brake booster	Pass	Brake booster	Pass	Brake booster	Pass
Brake lines	Pass	Brake lines	Pass	Brake lines	Pass	Brake lines	Pass
Brake fluid	Pass	Brake fluid	Pass	Brake fluid	Pass	Brake fluid	Pass
Brake system	Pass	Brake system	Pass	Brake system	Pass	Brake system	Pass

Shock and brake report

Car				Car			
Make/Model	Subaru	Make/Model	Subaru	Make/Model	Subaru	Make/Model	Subaru
Year	2016	Year	2016	Year	2016	Year	2016
Registration	2016/01	Registration	2016/01	Registration	2016/01	Registration	2016/01
Test results				Test results			
Shock absorbers	Pass	Shock absorbers	Pass	Shock absorbers	Pass	Shock absorbers	Pass
Brake pads	Pass	Brake pads	Pass	Brake pads	Pass	Brake pads	Pass
Brake discs	Pass	Brake discs	Pass	Brake discs	Pass	Brake discs	Pass
Brake master cylinder	Pass	Brake master cylinder	Pass	Brake master cylinder	Pass	Brake master cylinder	Pass
Brake booster	Pass	Brake booster	Pass	Brake booster	Pass	Brake booster	Pass
Brake lines	Pass	Brake lines	Pass	Brake lines	Pass	Brake lines	Pass
Brake fluid	Pass	Brake fluid	Pass	Brake fluid	Pass	Brake fluid	Pass
Brake system	Pass	Brake system	Pass	Brake system	Pass	Brake system	Pass

Diagnostics report

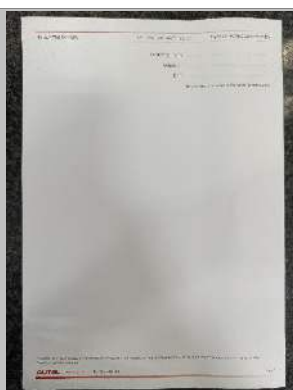

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00300032827



CONDITION REPORT



Report No:
2017302308
DATE
22/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00300032827



CONDITION REPORT



Report No:
2017302308
DATE
22/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00300032827



CONDITION REPORT



Report No:

2017302308

DATE

22/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00300032827



CONDITION REPORT



Report No:
2017302308
DATE
22/09/2026



Expansion bottle



Oil cap and dipstick



R/R reflector missing



Seat Front Right



Door Front Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00300032827



CONDITION REPORT



Report No:
2017302308
DATE
22/09/2026



Rear Fender Right



Door Rear Left



Engine



Shock Absorber Rear Left



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00300032827