



CONDITION REPORT



Report No:

2017304888

DATE

29/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/09/2026		M57 Pretoria Road - 1619
Inspection Date	29/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	REANULT	Registration Number	KM34JZGP
Model	KIGER	Register Number	
VIN	MEEHBC00600042557	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	151,318 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEHBC00600042557



CONDITION REPORT



Report No:
2017304888
DATE
29/09/2026

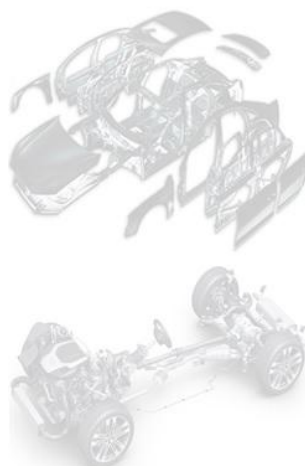

Damage

Repair Way

Switch Electrical Window Winder front right Malfunction	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
A • Pillar Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Chipmarks	Repair
Door Rear Left Dented	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Paintwork • Discoloured	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tyre Front Left Defective	Replace
Gearbox Oil Sweat	Repair
Foreign substance on oil cap	Repair
All four hup caps missing	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.3	2.2	-	
Rear	1.0	1.7	-	
Emergency / Parking	0.3	1.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/60R16	92H	Autogrip	P308 plus	V	3024	1 mm
Front Right	205/60R16	92H	Autogrip	P308 plus	V	3024	1 mm
Rear Left	205/60R16	92H	Autogrip	P308 plus	V	3024	3 mm
Rear Right	205/60R16	92H	Autogrip	P308 plus	V	3024	3 mm
Spare	185/65R15	88R	Ceat	Stepnee	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00600042557



CONDITION REPORT



Report No:
2017304888
DATE
29/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	MEMORY	DTC090174	CLUTCH MOTOR PERFORMANCE LOSS OF POWER OR TORQUE	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00600042557



CONDITION REPORT



Report No:

2017304888

DATE

29/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE FRONT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00600042557



CONDITION REPORT



Report No:

2017304888

DATE

29/09/2026




ODOMETER



DASHBOARD (W/ ENGINE RUNNING)




INTERIOR (FRONT DRIVER DOOR)

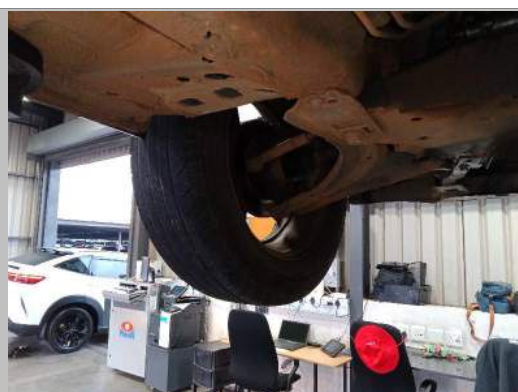

LF TYRE TREAD



RR TYRE TREAD

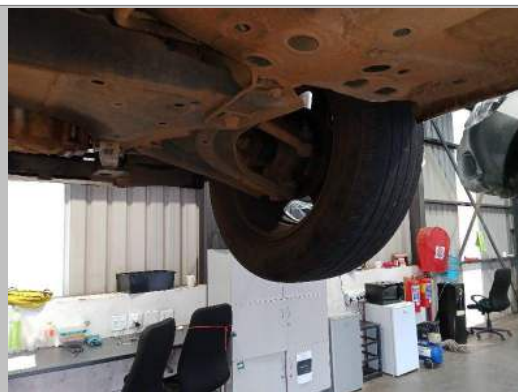

RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00600042557



CONDITION REPORT



Report No:
2017304888
DATE
29/09/2026



LR TYRE TREAD



Spare wheel



Automatic



Expention bottle



Oil cap and dipstick



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00600042557



CONDITION REPORT




Report No:
2017304888
DATE
29/09/2026



ENGINE 1




ENGINE 2

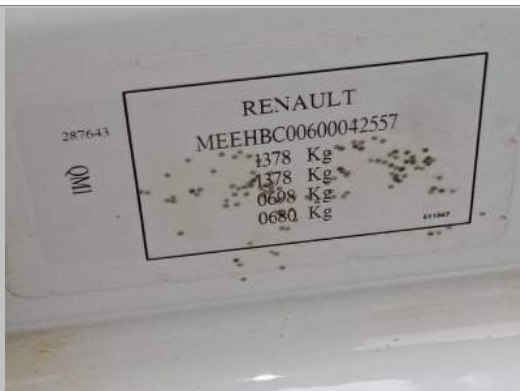


VIN PLATE OR STICKER



LICENSE DISC

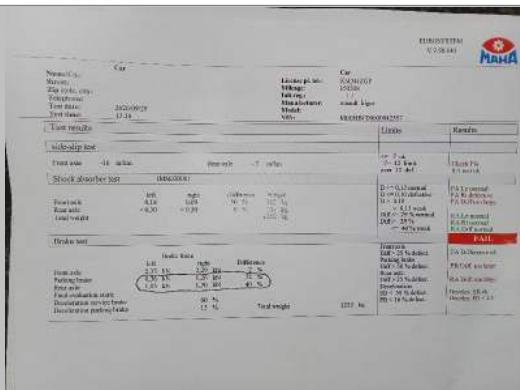

SHOCK AND BRAKE REPORT

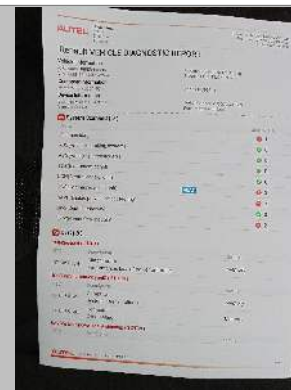

DIAGNOSTIC REPORT PAGE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEEHBC00600042557



CONDITION REPORT



Report No:
2017304888
DATE
29/09/2026

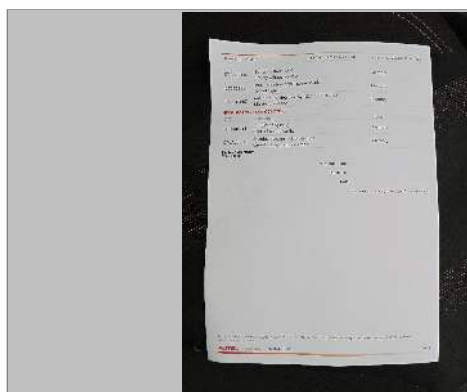

DIAGNOSTIC REPORT PAGE 2




Windscreen



Switch Electrical Window Winder front right

Test results					VIN: MEEHBC00600
Side-slip test					
Front axle	-10	m/cm	Rear axle	-7	m/cm
Shock absorber test					
OMSD30000					
Front axle	left	right	Difference	Weight	
Rear axle	0,18	0,09	50 %	765 kg	
Total weight	> 0,30	> 0,20	0 %	487 kg	
Brake test					
Brake force					
Front axle	left	right	Difference		
Parking brake	2,33 kN	2,39 kN	2 %		
Rear axle	0,08 kN	1,20 kN	72 %		
Final evaluation static	1,03 kN	1,70 kN	40 %		
Deceleration service brake			80 %		
Deceleration parking brake			13 %	Total weight	1252 kg

Parking Brake Performance

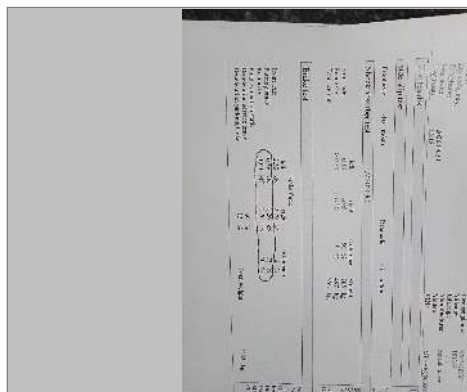

Service Brake Performance Rear Axle



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00600042557



CONDITION REPORT



Report No:
2017304888
DATE
29/09/2026



Bonnet



Door Rear Right



Door Front Right



Front Fender Right



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00600042557



CONDITION REPORT



Report No:
2017304888
DATE
29/09/2026



Door Front Left



Door Rear Left



Rear Fender Left



Boot Lid / Hatch door



Rear bumper



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEHBC00600042557



CONDITION REPORT



Report No:

2017304888

DATE

29/09/2026



Tyre Front Left



Tyre Front Left



A • Pillar Left

DEKRA Automotive (PTY) Ltd.

97 Willem Cruywagen Ave

Klerksoord, Pretoria, 0200

Phone: 012 542 4867

www.dekraauto.co.za

VIN: MEEHBC00600042557