



CONDITION REPORT



Report No:
2017306419
DATE
02/10/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	02/10/2026		M57 Pretoria Road - 1619
Inspection Date	02/10/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	RENAULT	Registration Number	LW91TRGP
Model	TRIBER	Register Number	
VIN	MEERBC00500176058	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	BROWN	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	60,638 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEERBC00500176058



CONDITION REPORT



Report No:
2017306419
DATE
02/10/2026

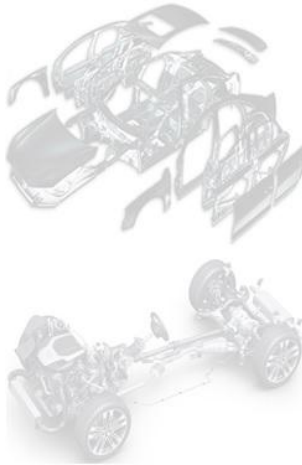

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Switch Electrical Window Winder rear right Damaged	Replace
Windscreen Wiper Damaged	Replace
Indicator Light Front Left Damaged	Replace
Tail Light Left Damaged	Replace
Headlight Left Damaged	Replace
Seat Front Left Dirty	Repair
Seat Rear Dirty	Repair
Seat Rear (2. Row) Damaged	Repair
Hood Lining Dirty	Repair
Door Panel Rear Left Damaged	Repair
Door Panel Rear Right Damaged	Repair
Door Handle Front Right Missing	Replace
Door Sealing Rubber Front Left Damaged	Replace
Door Sealing Rubber Front Right Missing	Replace
Door Sealing Rubber Rear Left Damaged	Replace
Door Sealing Rubber Rear Right Missing	Replace
Brake Pedal Rubber Missing	Replace
Steering Wheel Trim Excessive Wear & Tear	Repair
Side Mirror Left Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
C • Pillar Left Damaged	Repair
C • Pillar Right Damaged	Repair
Front Fender Left Damaged	Replace
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Residual Traces of Repair	Repair
Front Fender Left / Inner Tray Damaged	Repair
Door Front Left Dented	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Boot Lid / Hatch Door Rubbers Damaged	Replace
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Sill Panel Left Damaged	Repair
Roof Dented	Repair
Control Arm(s) Front Axle Left Damaged	Replace
Control Arm(s) Front Axle Right Damaged	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Damaged	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Rim Rear Left Dented	Repair
Rim Rear Right Dented	Repair
Chassis Dented	Repair
Sub Frame Damaged	Repair
Engine mountings Damaged	Replace
Radiator Cradle Damaged	Repair
Steering Malfunction	Repair
Engine Noise Excessive	Repair
Jack Missing	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058



CONDITION REPORT



Report No:
2017306419
DATE
02/10/2026

Damage	Repair Way
Wheel Spanner Missing	Replace
Triangle Missing	Replace
Loose wiring inside of vehicle	Replace
Oil sludge on oil cap	Repair
Front bumper stiffener dented	Repair
Spare wheel missing	Replace
Front and rear tyre sizes different	Repair
Airbag warning light illuminated on dashboard	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.15	2.48	-	
Rear	0.0	0.0	-	
Emergency / Parking	1.2	1.23	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/65 R15	92T	Barum	Brillantis	V	4920	0 mm
Front Right	185/65 R15	88H	Ceat	Secure drive	V	4622	0 mm
Rear Left	185/60 R15	84H	Anchee	AC808	V	0124	0 mm
Rear Right	185/55 R15	86H	Michelin	Energy	V	2514	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJ(INJECTION)	DTC001477	EXHAUST CAMSHAFT SHIFTER CIRCUIT COMMAND IMPOSSIBL	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: Electrical Components and Instruments: Driver's electrical window switch unit loose.Rear wiper missing.
Interior: Vehicle interior dirty and panels scratched.Left interior side mirror cover missing.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058



CONDITION REPORT



Report No:

2017306419

DATE

02/10/2026

Body • Exterior: Front left inner fender liner missing. Signs of impact damage to front of vehicle. Poor residual traces of repair on body panels. Body panels misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058



CONDITION REPORT



Report No:

2017306419

DATE

02/10/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058



CONDITION REPORT



Report No:

2017306419

DATE

02/10/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual Transmission



Loose wiring



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058



CONDITION REPORT



Report No:

2017306419

DATE

02/10/2026



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Oil cap and dipstick



Front bumper stiffener



Front chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058



CONDITION REPORT



Report No:

2017306419

DATE _____

02/10/2026



Rear chassis



ENGINE 1



VIN PLATE OR STICKER



LICENSE DISC

[illegible]

SHOCK AND BRAKE REPORT

[illegible]

DIAGNOSTIC REPORT PAGE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058



CONDITION REPORT




Report No:


2017306419

DATE

02/10/2026

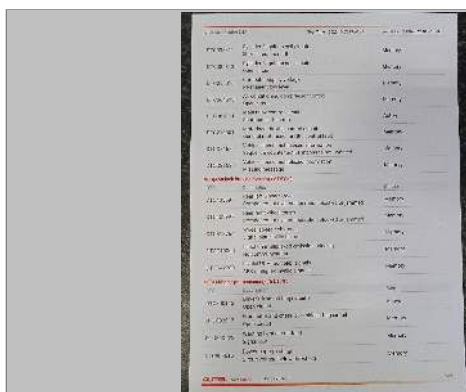

DIAGNOSTIC REPORT PAGE 3

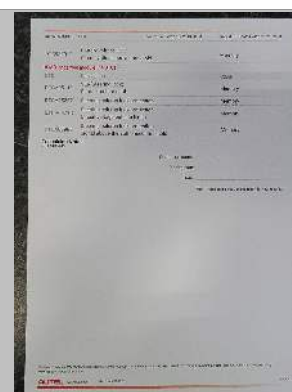

DIAGNOSTIC REPORT PAGE 4



Hood Lining



Steering Wheel Trim



Door Handle Front Right



Door Sealing Rubber Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058



CONDITION REPORT



Report No:

2017306419

DATE


02/10/2026



Door Sealing Rubber Rear Right



Seat Rear (2. Row)

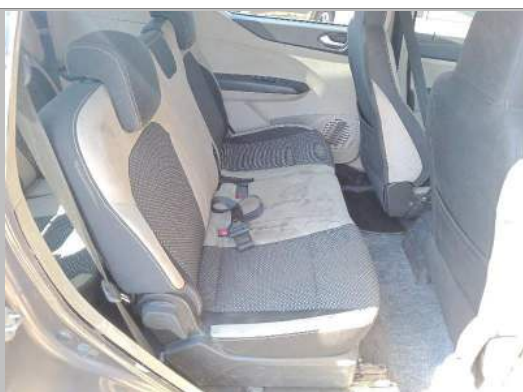

Seat Rear



Switch Electrical Window Winder rear right



C • Pillar Right



Door Panel Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058



CONDITION REPORT



Report No:
2017306419
DATE
02/10/2026



Rear Fender Right



Door Rear Right



Door Front Right



Front Fender Right



Rear Fender Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058



CONDITION REPORT



Report No:
2017306419
DATE
02/10/2026



C • Pillar Left



Door Sealing Rubber Rear Left



Door Panel Rear Left



Seat Front Left



Door Sealing Rubber Front Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058



CONDITION REPORT




Report No:

2017306419

DATE

02/10/2026

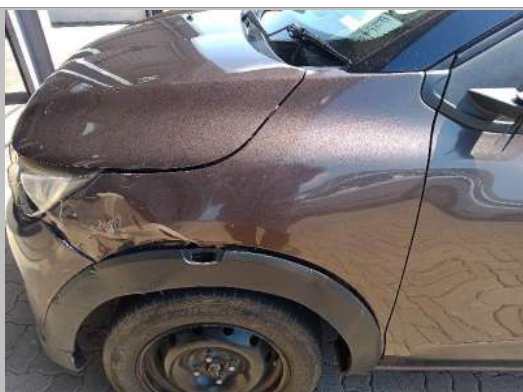

Front Fender Left



Side Mirror Left



Indicator Light Front Left



Windscreen Wiper



Headlight Left



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058



CONDITION REPORT



Report No:
2017306419
DATE
02/10/2026



Engine Wiring



Engine Wiring



Engine mountings



Front Fender Left / Inner Tray



Roof



Inner Boot Floor Pan and Spare Wheel Well

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058




CONDITION REPORT



Report No:
2017306419
DATE
02/10/2026



Boot Lid / Hatch Door Rubbers

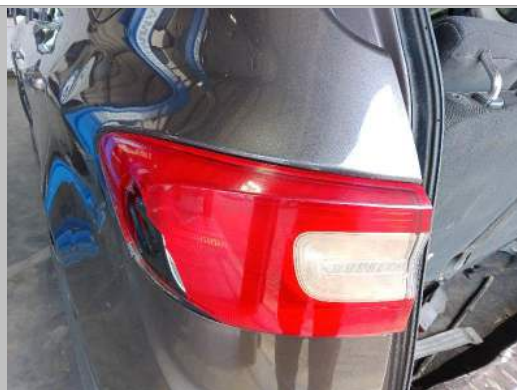

Tail Light Left



Boot Lid / Hatch door



Rim Rear Left



Control Arm Bush(es) Front Axle Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058



CONDITION REPORT



Report No:
2017306419
DATE
02/10/2026



Front Bumper



Front Bumper



Control Arm Bush(es) Front Axle Left



Sill Panel Left



Rim Rear Right



Radiator Cradle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058



CONDITION REPORT



Report No:
2017306419
DATE
02/10/2026



Sub Frame



Sub Frame



Engine



Tyre Front Right



Tyre Front Left



Control Arm(s) Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058



CONDITION REPORT



Report No:

2017306419

DATE

02/10/2026



Control Arm(s) Front Axle Right



Chassis



Chassis



Tyre Rear Right



Tyre Rear Left



Inner Boot Floor Pan and Spare Wheel Well

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEERBC00500176058




CONDITION REPORT



Report No:
2017306419
DATE
02/10/2026

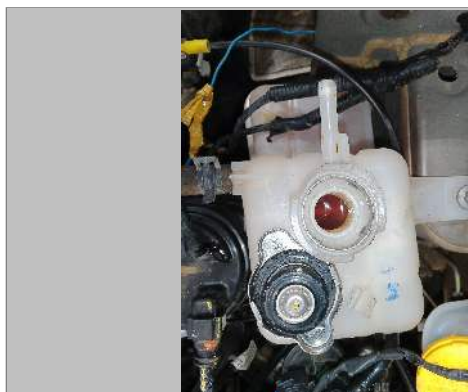

Water level

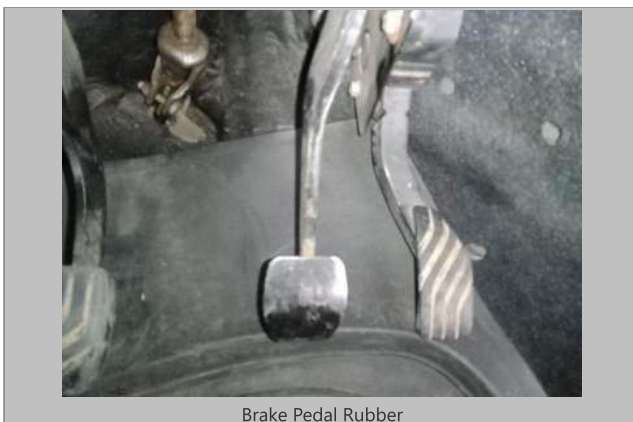

Brake Pedal Rubber

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00500176058