



CONDITION REPORT

Report No: 2016480482

DATE
05/08/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	05/08/2024		M57 Pretoria Road - 1619
Inspection Date	05/08/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	TOYOTA	Registration Number	HL05PLGP
Model	AVANZA	Register Number	
VIN	MHKM5FA2N0K007803	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	28/02/2022
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	243,777 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

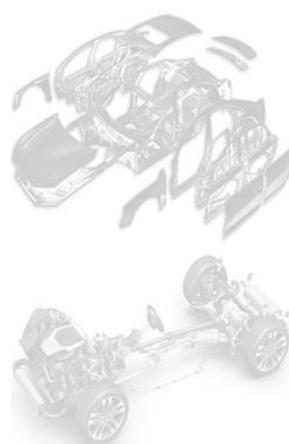

Damage	Repair Way
Engine Oil Leak	Repair
Fan Belt Damaged	Replace
Radiator Damaged	Replace
Air conditioner pipes Damaged	Replace
Engine Management Lights Set	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Seat Rear (2. Row) Damaged	Repair
Seat Belt Front Left Damaged	Repair
Seat Belt Front Right Damaged	Repair
Dash Padding Damaged	Repair
Carpet Front Damaged	Repair
Carpet Rear Damaged	Repair
Steering Wheel Trim Damaged	Repair
Side Mirror Left Damaged	Replace
Side Mirror Right Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Replace
Bonnet slam plate (Shock tower/ Inner tray) Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKM5FA2N0K007803

1 / 15



CONDITION REPORT

Report No: 2016480482

DATE

05/08/2024

Damage	Repair Way
Rear bumper Damaged	Repair
Windscreen Damaged	Replace
Brake disc 1. Axle left Worn	Replace
Brake disc 1. Axle right Worn	Replace
Shock Absorber Rear Left Worn	Replace
Tyre Front Left Worn	Repair
Main Beam Left Welded	Repair
Gearbox Oil Leak	Repair
Radiator Cross Member Damaged	Replace
Brakes Insufficient	Repair
Engine Performance Insufficient	Repair
Clutch Operation Slippy Hesitation	Replace
Body and exterior	Cut and join
Engine	Battery loose
interior	vehicle air bags deployed
Body and exterior	Signs of stone chips to some body panels.
Body and exterior	Signs of repair work done to somebody panels.
Body and exterior	Signs of impact damage to front of vehicle

Brakes**Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.25	2.14	-	
Rear	2.02	3.02	-	
Emergency / Parking	1.3	0.42	-	

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/70R14	88T	Zextour	Radial	V	0322	0 mm
Front Right	185/70R14	88T	Dunlop	Sp	V	1321	1 mm
Rear Left	185/70R14	88T	Tracmax	Radial	V	4722	2 mm
Rear Right	185/70R14	88T	Tracmax	Radial	V	4722	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacturer).

No	System	Code	Description	Status
1	EFI	P1604	ENGINE START ABNORMAL	

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksdorp, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT**

VIN: MHKMFFA2NOK007802

Report No.: 2016480482

2 / 15

DATE

05/08/2024

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

Report No: 2016480482


VIN: MHKM5FA2N0K007803

DATE


05/08/2024

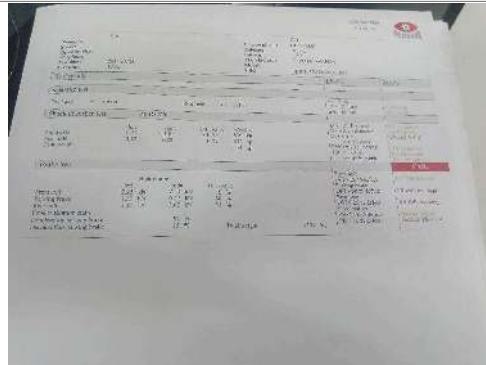


Brake and shock test

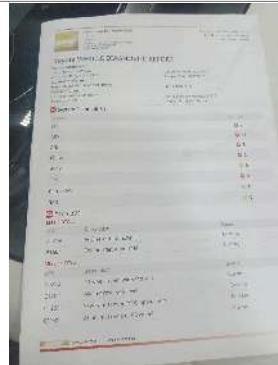

Diagnostics

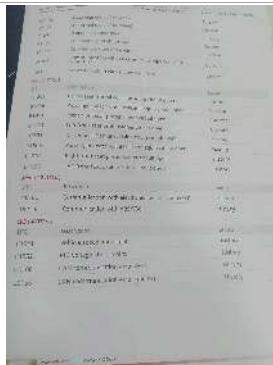

Diagnostics

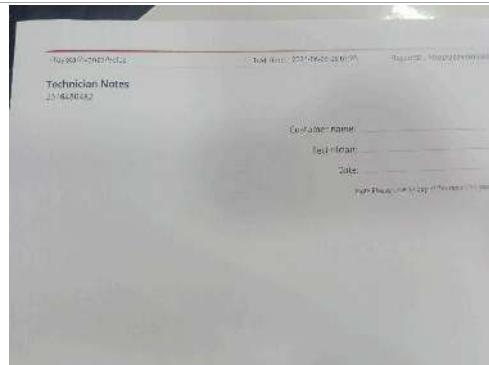

Diagnostics



FRONT RIGHT CORNER



REAR LEFT CORNER



CONDITION REPORT

Report No: 2016480482

DATE

VIN: MHKM5FA2NOK007803

05/08/2024

4 / 15

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016480482

DATE

05/08/2024

VIN: MHKM5FA2NOK007803-

5 / 15



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



CONDITION REPORT

Report No: 2016480482

DATE
05/08/2024

VIN: MHKM5FA2N0K007803

6 / 15

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016480482

DATE
05/08/2024

90 DEGREE REAR



90 DEGREE LEFT

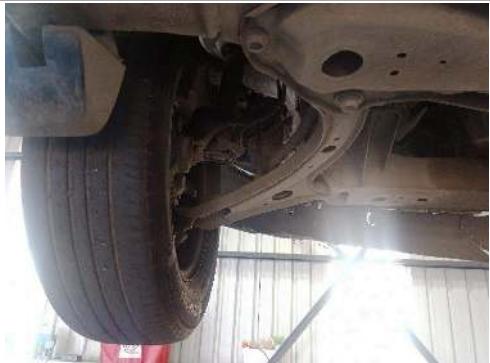

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



CONDITION REPORT

Report No: 2016480482

DATE
05/08/2024

VIN: MHKM5FA2N0K007803

8 / 15

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016480482

DATE
05/08/2024

LICENSE DISC



VIN: MHKM5FA2N0K007803

9 / 15



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



CONDITION REPORT

Report No: 2016480482

DATE
05/08/2024

VIN: MHKM5FA2N0K007803

10 / 15



CONDITION REPORT

Report No: 2016480482

DATE
05/08/2024

Fan Belt



VIN: MHKM5FA2N0K007803

11 / 15



Main Beam Left



Main Beam Left



Air conditioner pipes



Air conditioner pipes



CONDITION REPORT

Report No: 2016480482

DATE
05/08/2024

VIN: MHKM5FA2N0K007803

12 / 15



CONDITION REPORT

Report No: 2016480482

DATE
05/08/2024

Radiator



Bonnet slam plate (Shock tower/ Inner tray)

VIN: MHKM5FA2NOK007803

13 / 15



Bonnet



Front Bumper



Front Bumper



Front Fender Left



CONDITION REPORT

Report No: 2016480482

DATE
05/08/2024

VIN: MHKM5FA2N0K007803

14 / 15



CONDITION REPORT

Report No: 2016480482

DATE
05/08/2024

Rear Fender Left



Door Front Left

VIN: MHKM5FAJNOK007803

15 / 15



Door Rear Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



CONDITION REPORT

Report No: 2016480482

DATE

05/08/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016480482

DATE
05/08/2024

Door Rear Right



Door Front Right



Front Fender Right



Rear Fender Right



Windscreen



Side Mirror Right



CONDITION REPORT

Report No: 2016480482

DATE
05/08/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016480482

DATE
05/08/2024

Side Mirror Left




Seat Belt Front Left



Seat Belt Front Right



Seat Front Right

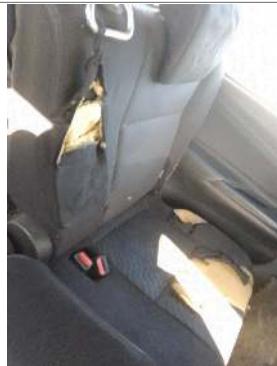

Seat Rear



Seat Rear (2. Row)



CONDITION REPORT

Report No: 2016480482

DATE

05/08/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016480482

DATE
05/08/2024

Carpet Rear



Carpet Rear



Carpet Front



Seat Front Left



Dash Padding



Steering Wheel Trim



CONDITION REPORT

Report No: 2016480482

DATE

05/08/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016480482

DATE
05/08/2024

Engine Management Lights



Shock Absorber Rear Left

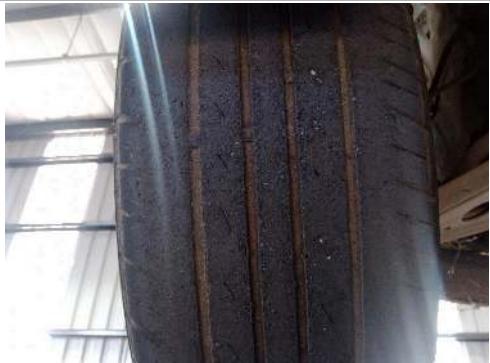

Tyre Front Left



Engine



Gearbox



Brake disc 1. Axle left



CONDITION REPORT

Report No: 2016480482

DATE
05/08/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016480482

DATE
05/08/2024

Brake disc 1. Axle right



Radiator Cross Member

**CONDITION REPORT**

Report No: 2016480482

DATE
05/08/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za