



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/12/2023		M57 Pretoria Road - 1619
Inspection Date	22/12/2023		Kempton Park -

**Vehicle Data**

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	BS10CPGP
Model	FIESTA	Register Number	
VIN	MNBJXXARJJBT62953	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	174,248 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

**Vehicle Options & Accessories****Items**

## VEHICLE INSPECTION

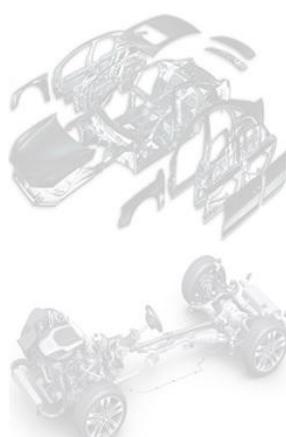

Damage	Repair Way
Engine Oil Sweat	Repair
Engine Wiring Defective	Repair
Expansion Bottle Defective	Replace
Windscreen Wiper Defective	Replace
Tail Light Left Cracked	Replace
Tail Light Right Defective	Repair
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Damaged	Repair
Seat Rear Dirty	Repair
Hood Lining Defective	Repair
Door Handle Rear Right Defective	Repair
Parcel Tray Damaged	Repair
Steering Wheel Trim Defective	Repair
Front Bumper Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Inner Boot Floor Pan and Spare Wheel Well Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Shock Absorber Rear Left Leak	Replace
Shock Absorber Rear Right Leak	Replace
Mounting Rubber(s) Rear Axle Left Cracked	Replace
Mounting Rubber(s) Rear Axle Right Cracked	Replace

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MNBJXXARJJBT62953

1 / 15



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

Damage	Repair Way
Tyre Front Right Worn	Replace
Spare Tyre Damaged	Replace
Rim Front Right Dented	Repair
Rim Spare Wheel Dented	Repair
Main Beam Right Defective	Repair
Chassis Scratched	Repair
Cross Member Front Right Damaged	Repair
Gearbox Mountings Cracked	Replace
Gearbox Oil Sweat	Repair
Engine Noise Excessive	Repair
Wheel Spanner Missing	Replace

**Brakes****Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	2.45	2.82	-	
Rear	1.98	1.92	-	
Emergency / Parking	1.61	1.77	-	

**Tyres and Rims****Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/50 R16	84V	A-Three	P606	V	1020	2 mm
Front Right	195/50 R16	84V	A-Three	P606	V	1020	0 mm
Rear Left	195/50 R16	88V	Royalblack	Performance	V	3122	4 mm
Rear Right	195/50 R16	88V	Maxtrek	Maximus	V	2422	5 mm
Spare	175/65 R14	82H	Firestone	Touring	V	4118	0 mm

\* Tyre Legend: V=Virgin, R=Recap

**Diagnostic**

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacturer).

No	System	Code	Description	Status
1	BCMII(BODY CONTROL MODULE)	C1137:24-08	REVERSE GEAR SWITCH	

**Inspection Conditions**

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

**Comments**

General Comments: SHOCK ABSORBER TEST REPORT COULD NOT BE PERFORMED.

Engine Compartment: Engine bay dirty. Brake fluid level ok. Corrosion on battery box. Signs of rodent in engine bay.

Electrical Components and Instruments: Drivers side small speaker cover damaged.

Lights: Front left fog light not working.

Interior: Vehicle interior dirty and some interior panels scratched. Change holder missing.

Body • Exterior: Minor dents and scratches on some body panels. Spray work on some body panels. Some body panels misaligned. Stone chips on some body panels.

Axle and Suspension: Abnormal noise coming from front and rear suspension.

Tyres and Rims: Alloy rims scratched. Front right tyre has flat spots.

Undercarriage: Vehicle undercarriage dirty.

Road Test: Gear selection faulty.

**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE  
 ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

DEKRA Automotive (PTY) Ltd.  
 97 Willem Cruywagen Ave  
 Klerksdorp, Pretoria, 0200  
 Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

VIN: 1MNYVAP1614047

Report No: 201614047

2 / 15

DATE

22/12/2023

**Technician**

Sibusiso Mokase

This document was created electronically and is valid without signature.

## General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




## CONDITION REPORT

Report No: 2016210047


VIN: MNBJXXARJBT62953

DATE


22/12/2023

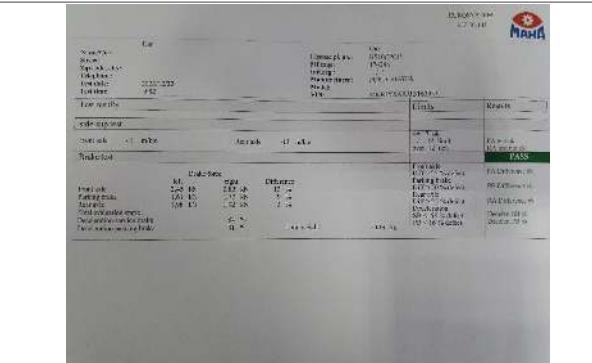

Brake and shock absorber report

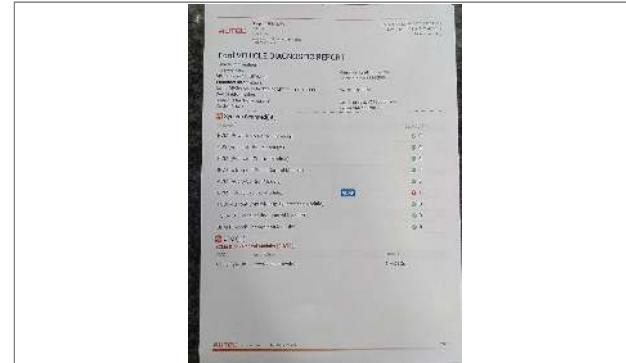


Diagnostic report page 1

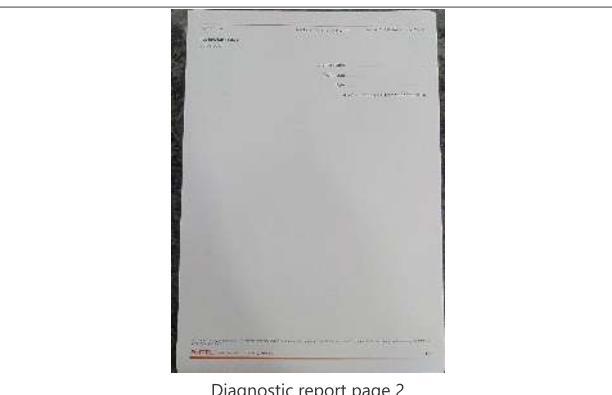


Diagnostic report page 2



FRONT RIGHT CORNER

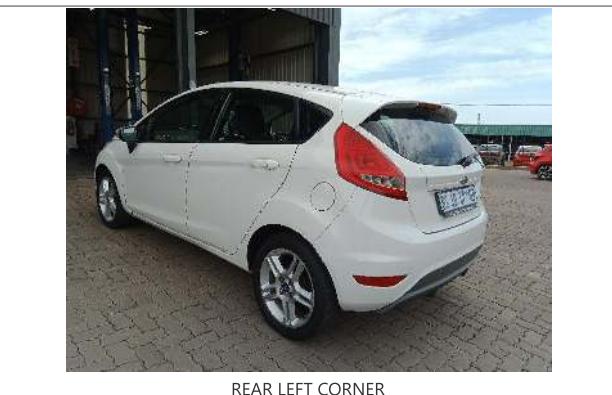

REAR LEFT CORNER

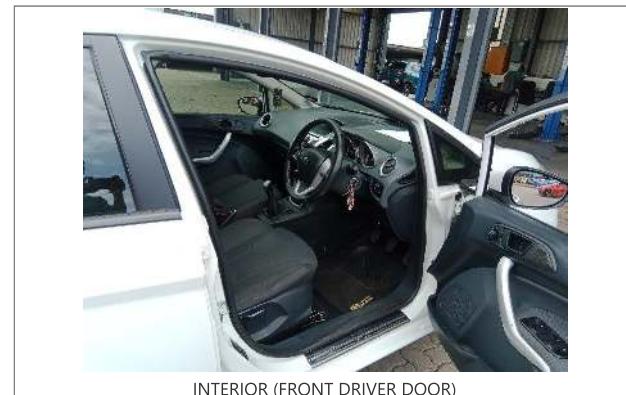

INTERIOR (FRONT DRIVER DOOR)



## CONDITION REPORT

Report No: 2016210047

DATE

VIN: MNBJXXA21JT62023

21/12/2023

4 / 15

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

VIN: MNBJXXARJBT62953

5 / 15



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

VIN: MNBJXXARJBT62953

6 / 15



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

VIN: MNBJXXARJBT62953

7 / 15



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



LICENSE DISC



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

VIN: MNBJXXARJBT62953

8 / 15



## CONDITION REPORT


Report No: 2016210047

DATE  
22/12/2023


VIN PLATE OR STICKER



ENGINE 1

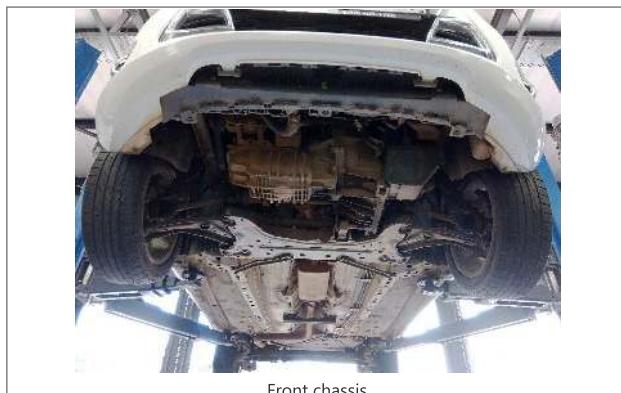


Front chassis

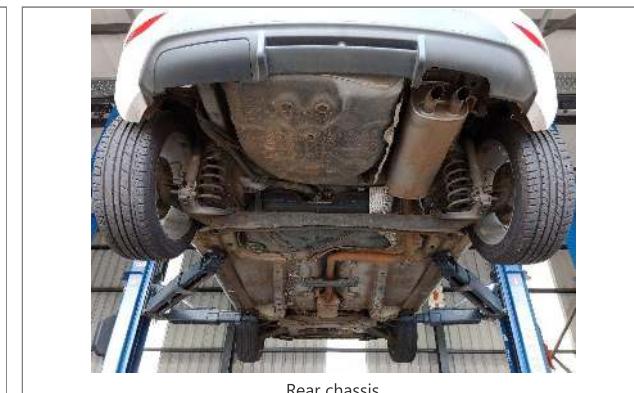

Rear chassis



Spare wheel Accessories

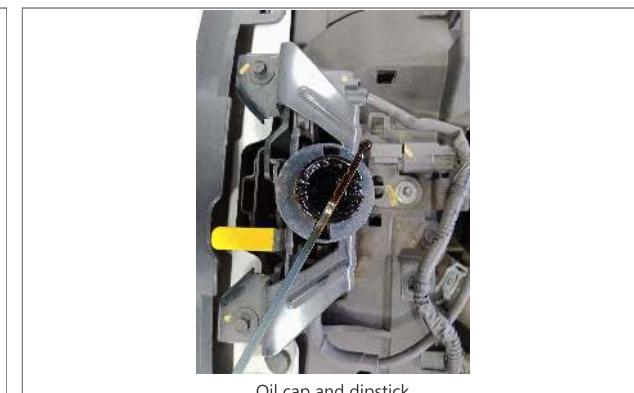

Oil cap and dipstick



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

VIN: MNBJXXARJBT62953

10 / 15



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

Manual Transmission



Hood Lining



Steering Wheel Trim



Seat Front Right



Seat Rear



Door Handle Rear Right



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

VIN: MNBJXXARJBT62953

12 / 15



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

Rear bumper



Rear bumper



Seat Rear



Seat Front Left



Headlight Left



Headlight Right



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

VIN: MNBJXXARJBT62953

14 / 15



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

Front Bumper



Front Bumper



Tail Light Left



Parcel Tray



Rim Spare Wheel



Spare Tyre



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

Inner Boot Floor Pan and Spare Wheel Well



Tail Light Right



Windscreen Wiper



Expansion Bottle



Door Front Right



Door Rear Right



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

Rear Fender Right



Door Rear Left



Door Front Left




Tyre Front Right



Rim Front Right



Engine

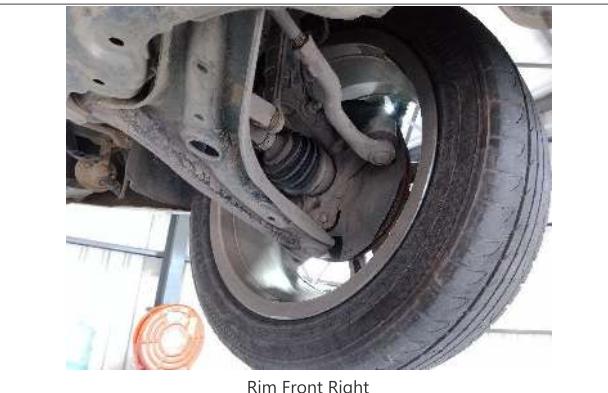



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

Gearbox



Engine Wiring



Cross Member Front Right



Gearbox Mountings



Chassis



Main Beam Right



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

Mounting Rubber(s) Rear Axle Left



Mounting Rubber(s) Rear Axle Right



Shock Absorber Rear Left



Shock Absorber Rear Right



Water level



Engine Wiring



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

Windscreen



## CONDITION REPORT

Report No: 2016210047

DATE  
22/12/2023

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)