



MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	18/07/2025		M57 Pretoria Road - 1619
Inspection Date	18/07/2025		Kempton Park - GT


Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	KIA	Registration Number	JV51KSGP
Model	SELTOS	Register Number	
VIN	MZBER814MMN160539	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	BLUE	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	114,863 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

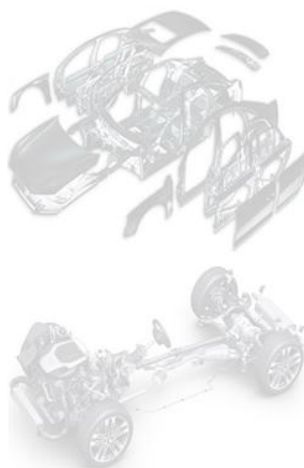

Damage	Repair Way
Parcel Tray Missing	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Chipmarks	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Spare Tyre Excessive Wear & Tear	Replace
License disc missing	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.0	2.3	-	
Rear	1.6	1.8	-	
Emergency / Parking	1.3	1.4	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60R17	96H	Goodyear	Assurance	V	3721	3 mm
Front Right	215/60R17	96H	Goodyear	Assurance	V	3720	3 mm
Rear Left	215/60R17	96H	Dunlop	Sp sport	V	1221	2 mm
Rear Right	215/60R17	96H	Bridgestone	Turanza	V	4215	3 mm
Spare	215/60R17	96H	Goodyear	Assurance	V	3620	0 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	HISTORY	B2617:00	CLUSTER AIRBAG WARNING LAMP CAN MESSAGE TIME OUT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE FRONT



90 DEGREE REAR



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)




INTERIOR (FRONT DRIVER DOOR)



Automatic



LF TYRE TREAD

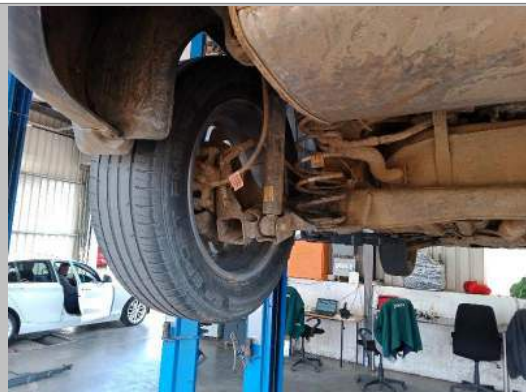

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



Coolant bottle



Oil cap and dipstick



ENGINE 1



CHASSIS



ENGINE 2




VIN PLATE OR STICKER



LICENSE DISC MISSING



DIAGNOSTIC REPORT PAGE 1

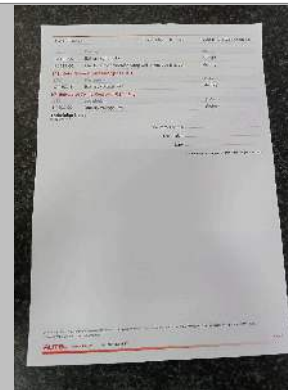

DIAGNOSTIC REPORT PAGE 2



Item	Value	Unit	Remarks
Shock absorbers	22	%	Good
Brake pads	100	%	Good
Brake discs	100	%	Good
Steering rack	100	%	Good
Washers	100	%	Good
Wipers	100	%	Good
Light bulbs	100	%	Good
Oil level	100	%	Good
Water level	100	%	Good
tyre pressure	100	%	Good
Exhaust system	100	%	Good
Engine oil	100	%	Good
Transmission oil	100	%	Good
Brake fluid	100	%	Good
Power steering fluid	100	%	Good
Windscreen	100	%	Good
Body panels	100	%	Good
Interior	100	%	Good
Exterior	100	%	Good
Overall condition	100	%	Good

Shock and brake report



Windscreen



Spare Tyre



Parcel Tray



Boot Lid / Hatch door



Water level



Rear Fender Right



Door Rear Right



Front Fender Right



Front Bumper



Front Bumper



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBER814MMN160539