



CONDITION REPORT



Report No:
2017305015
DATE
29/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/09/2026		M57 Pretoria Road - 1619
Inspection Date	29/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	KIA	Registration Number	LR05JJGP
Model	SONET/HATCH BACK	Register Number	
VIN	MZBFC811VPN278367	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/05/2027
Color	RED	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	51,417 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MZBFC811VPN278367



CONDITION REPORT



Report No:
2017305015
DATE
29/09/2026

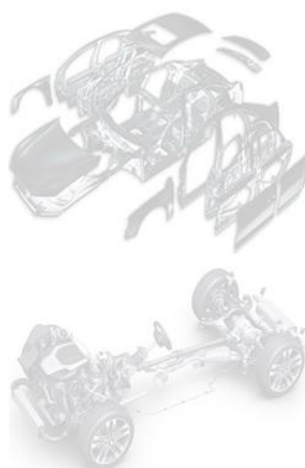

Damage

Repair Way

Hoses Oil Leak	Replace
Seat Front Left Dirty	Repair
Seat Front Right Dirty	Repair
Seat Rear Damaged	Repair
Door Sealing Rubber Front Right Damaged	Replace
Front Bumper Paintwork • Scratched	Repair
Front Fender Right Dented	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Dented	Repair
Door Rear Left Damaged	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Dented	Repair
Fuel Flap Dented	Repair
Windscreen Cracked	
Belly plates Damaged	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Fan Cowley damaged	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.89	3.1	-	
Rear	1.76	1.89	-	
Emergency / Parking	1.48	1.41	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60 R16	95H	MRF	Wanderer	V	0623	3 mm
Front Right	215/60 R16	95H	MRF	Wanderer	V	0623	3 mm
Rear Left	215/60 R16	95H	MRF	Wanderer	V	0623	5 mm
Rear Right	215/60 R16	95H	MRF	Wanderer	V	0623	5 mm
Spare	195/65 R15	91H	Goodyear	Assurance	V	0623	7 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC811VPN278367

**CONDITION REPORT**

Report No:
2017305015
DATE
29/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Radiator and Aircon condenser misaligned.
Interior: Vehicle interior dirty and panels scratched.
Body • Exterior: Dents and scratches on body panels Signs of impact damage to front of vehicle.
Undercarriage: Bottom of engine and gearbox covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC811VPN278367



CONDITION REPORT



Report No:
2017305015
DATE
29/09/2026

Vehicle		Car		Car	
Make/Model		Mazda CX-5		Mazda CX-5	
Year		2016		2016	
Test date		2025/09/28		2025/09/28	
Test time		11:40		11:40	
Test results		Pass		Pass	
Auto-stop test		Pass		Pass	
Shock absorber test		Pass		Pass	
Brake test		Pass		Pass	


Brake and shock absorber report

Vehicle		Car		Car	
Make/Model		Mazda CX-5		Mazda CX-5	
Year		2016		2016	
Test date		2025/09/28		2025/09/28	
Test time		11:40		11:40	
Test results		Pass		Pass	

Diagnostic report page 1

Vehicle		Car		Car	
Make/Model		Mazda CX-5		Mazda CX-5	
Year		2016		2016	
Test date		2025/09/28		2025/09/28	
Test time		11:40		11:40	
Test results		Pass		Pass	


Diagnostic report page 2

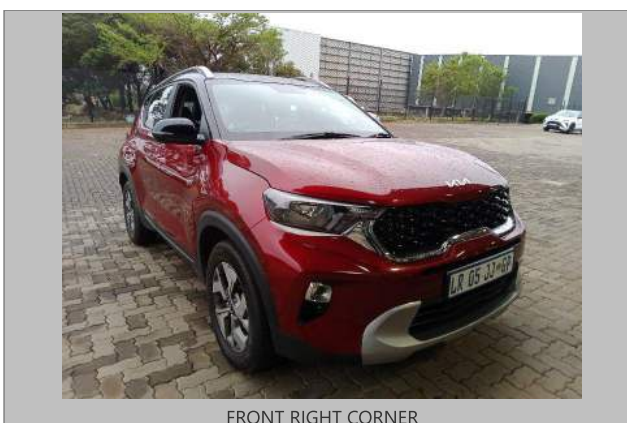

FRONT RIGHT CORNER



REAR LEFT CORNER

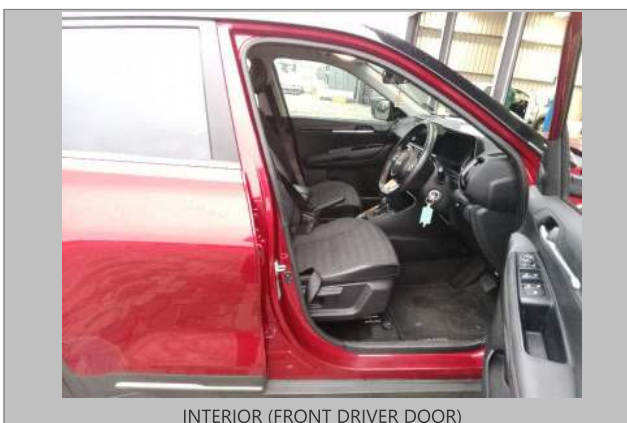

INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC811VPN278367



CONDITION REPORT



Report No:
2017305015
DATE
29/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC811VPN278367



CONDITION REPORT



Report No:

2017305015

DATE


29/09/2026



90 DEGREE LEFT



LF TYRE TREAD

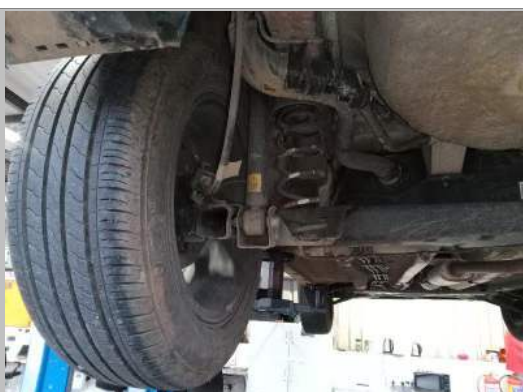

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare Wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC811VPN278367



CONDITION REPORT



Report No:
2017305015
DATE
29/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC811VPN278367



CONDITION REPORT



Report No:

2017305015

DATE


29/09/2026




Fan Cowley



Seat Front Right

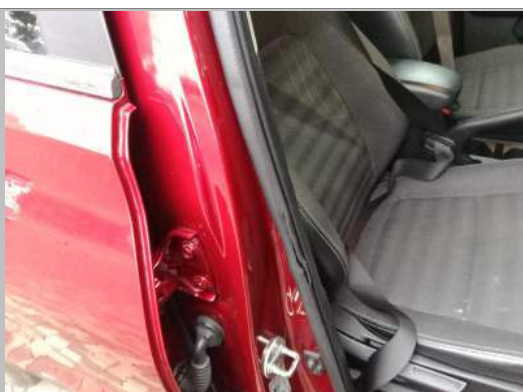

Door Sealing Rubber Front Right

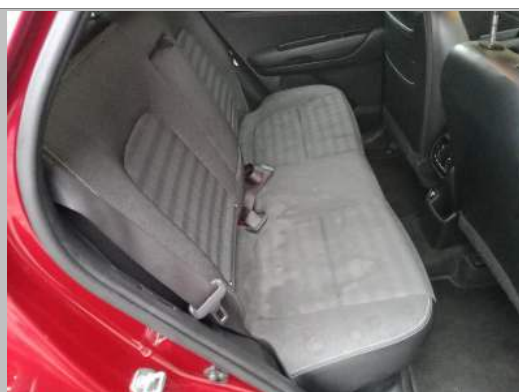

Seat Rear



Front Fender Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC811VPN278367



CONDITION REPORT



Report No:
2017305015
DATE
29/09/2026



Door Rear Right



Boot Lid / Hatch door



Rear Fender Left



Fuel Flap



Door Rear Left



Seat Rear

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC811VPN278367



CONDITION REPORT



Report No:

2017305015

DATE

29/09/2026



Seat Front Left



Windscreen



Water level



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC811VPN278367



CONDITION REPORT



Report No:
2017305015
DATE
29/09/2026



CV Joint(s) Boot(s) Front Left (inner/outer)



Hoses



Belly plates



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MZBFC811VPN278367