

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	13/02/2024		M57 Pretoria Road - 1619
Inspection Date	13/02/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	KIA	Registration Number	JRN767MP
Model	SPORTAGE	Register Number	
VIN	U5YPG815LHL337351	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/05/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	165,864 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Air cleaner Defective	Repair
Center Console / Cubbyhole + Lid Defective	Repair
Brake Light Centre Damaged	Replace
Number Plate Light Left Damaged	Replace
Headlight Left Scratched	Replace
Seat Front Right Defective	Repair
Seat Rear Dirty	Repair
Hood Lining Dirty	Repair
Door Handle Front Right Defective	Repair
Door Sealing Rubber Front Left Damaged	Replace
Door Sealing Rubber Front Right Torn / Cut	Repair
Door Sealing Rubber Rear Left Damaged	Replace
Door Sealing Rubber Rear Right Torn / Cut	Repair
Steering Wheel Trim Defective	Repair
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Dented	Repair
Front Fender Left Paintwork • Chipmarks	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Dented	Repair
Door Front Left Dented	Repair
Door Front Right Damaged	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Defective	Repair

Damage	Repair Way
Rocker Panel Left Dented	Repair
Roof Dented	Repair
Windscreen Cracked	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Mounting Rubber(s) Rear Axle Left Cracked	Replace
Mounting Rubber(s) Rear Axle Right Cracked	Replace
Spare Tyre Worn	Replace
Rim Rear Left Welded	Replace
Rim Rear Right Welded	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Chassis Dented	Repair
Sub Frame Dented	Repair
Belly plates Damaged	Replace
Gearbox Oil Leak	Repair
Fuel Tank Damaged	Replace
Engine Noise Excessive	Repair
Warning lights illuminated on dashboard	Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.93	4.1	-	
Rear	2.11	2.27	-	
Emergency / Parking	0.98	2.92	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/55 R18	102W	Blackhawk	Radial	V	1523	5 mm
Front Right	225/55 R18	98V	Fortune	All Season	V	1823	3 mm
Rear Left	225/55 R18	98V	Fortune	All Season	V	1823	3 mm
Rear Right	225/55 R18	98H	Lanvigator	Performax	V	1621	1 mm
Spare	225/60 R17	99V	Voyager	Radial	V	4419	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENG(ENGINE)	U02A3:00	LOST COMMUNICATION WITH PARTICULATE MATTER SENSOR	

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ?ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Engine bay dirty.Brake fluid level ok.Bottom of engine and gearbox covered.

E

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase


This document was created electronically and is valid without signature.

General Remarks:


The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



MANUAL TRANSMISSION

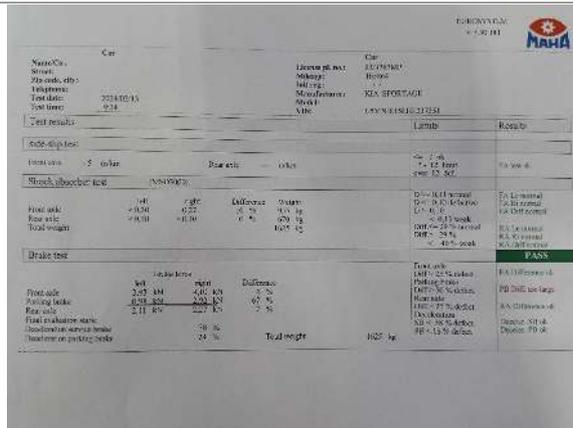

BRAKE AND SHOCK REPORT

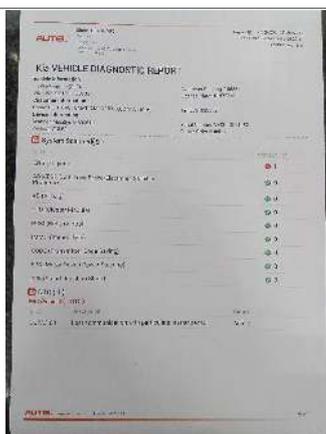


DIAGNOSTIC REPORT PAGE 1



DIAGNOSTIC REPORT PAGE 2



LICENSE DISC

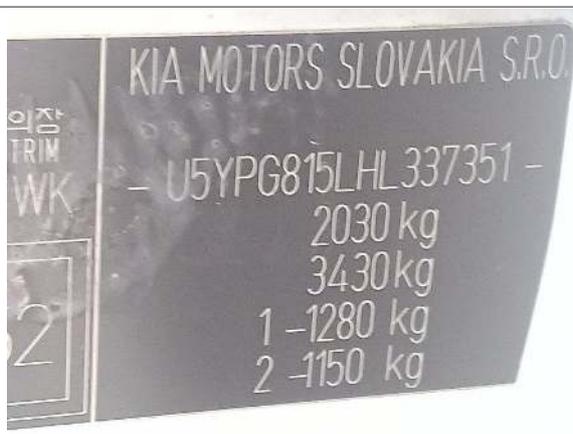

VIN PLATE OR STICKER



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

VIN: U5YPG815LHL337351

7 / 16



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



LF TYRE TREAD



Oil cap and dipstick



Spare wheel and Accessories

VIN: U5YPG815LHL337351

8 / 16

VIN: U5YPG815LHL337351

9 / 16



Front chassis



Rear chassis



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



ENGINE 1

VIN: U5YPG815LHL337351

10 / 16

VIN: U5YPG815LHL337351
11 / 16



Center Console / Cubbyhole + Lid



Hood Lining



Steering Wheel Trim



Steering Wheel Trim



Seat Front Right



Door Sealing Rubber Front Right

VIN: U5YPG815LHL337351

12 / 16

VIN: U5YPG815LHL337351

13 / 16



Door Front Right



Door Rear Right



Rear Fender Right



Seat Rear



Door Sealing Rubber Rear Right



Rear bumper

VIN: U5YPG815LHL337351

14 / 16




Rear bumper




Boot Lid / Hatch door


6LHL337351
15 / 16

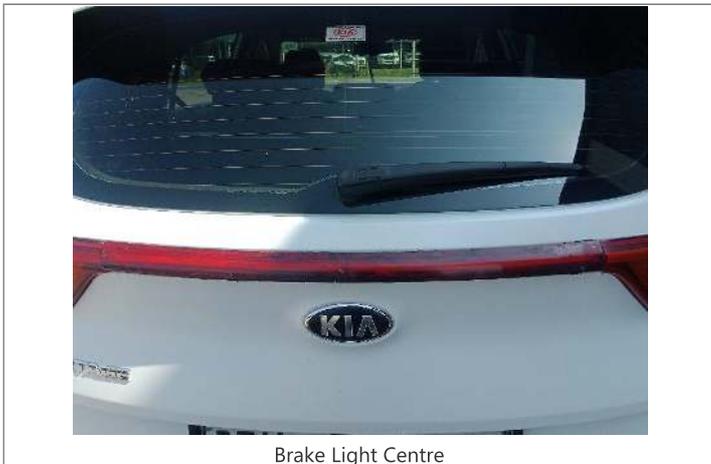


Brake Light Centre

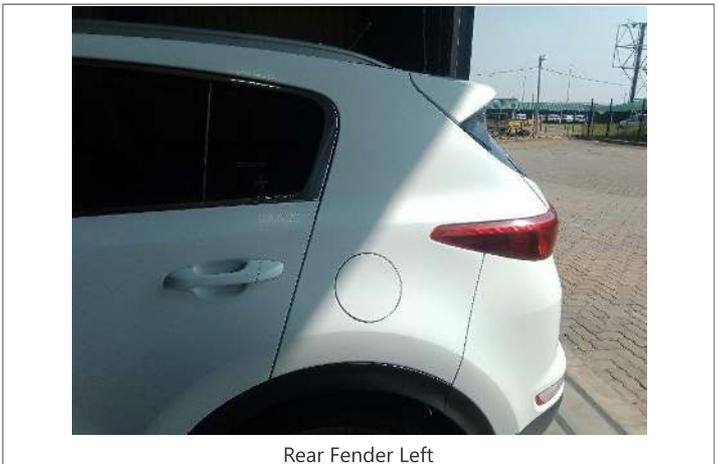

Rear Fender Left

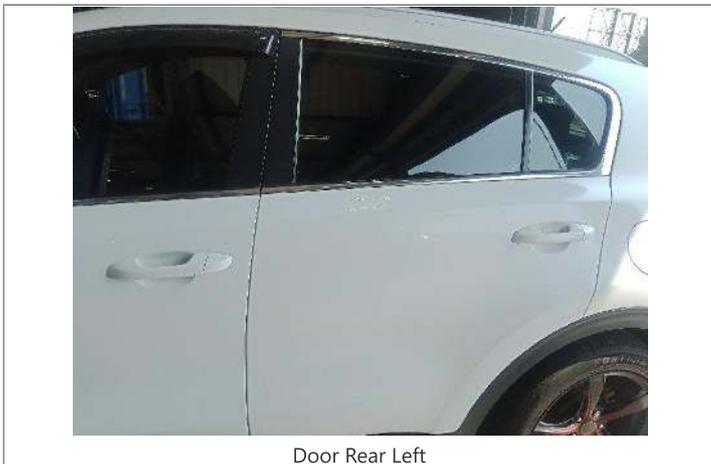

Door Rear Left

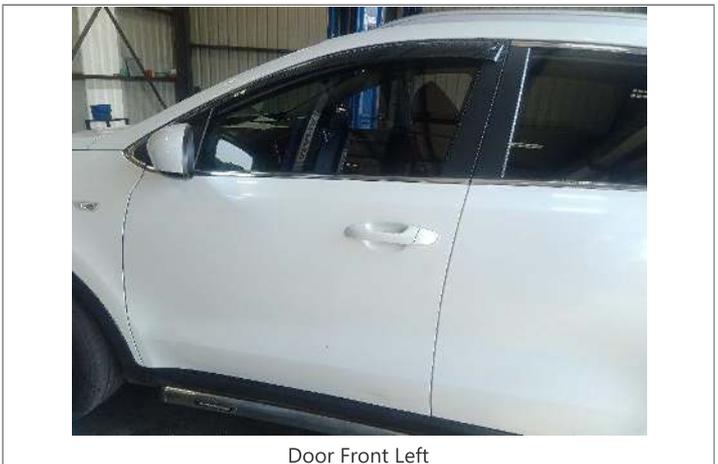

Door Front Left

VIN: U5YPG815LHL337351


16 / 16



Rocker Panel Left




Side Mirror Left

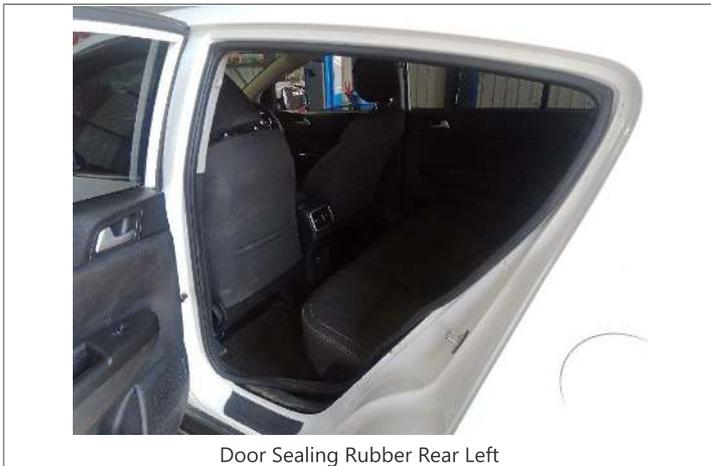

Door Sealing Rubber Rear Left



Sill Panel Left

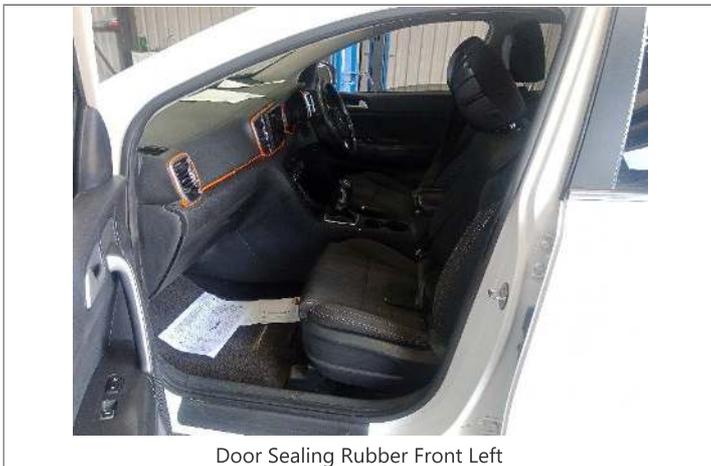

Door Sealing Rubber Front Left



Windscreen



Front Fender Left




Front Bumper



Front Bumper



Bonnet

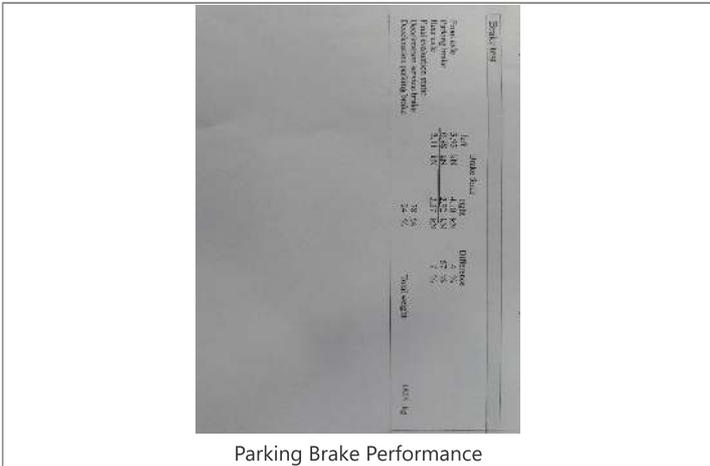

Parking Brake Performance



Water level



Air cleaner



Spare Tyre



Number Plate Light Left



Roof



Control Arm Bush(es) Front Axle Right



Control Arm Bush(es) Front Axle Left



Bolt(s) / Nut(s) Front Wheel Left



Belly plates



Belly plates



Belly plates



Gearbox




Engine



Sub Frame



Chassis

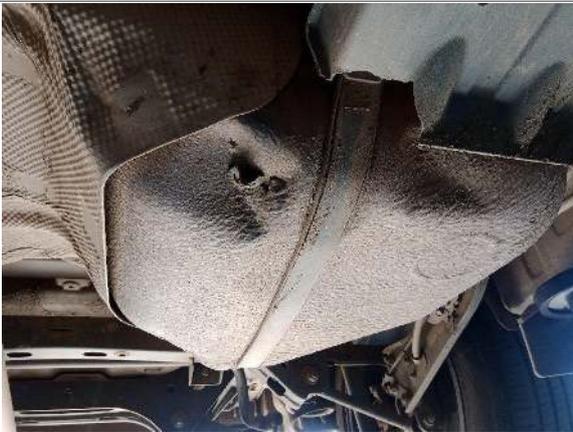

Fuel Tank



Belly plates



Belly plates



Mounting Rubber(s) Rear Axle Right



Mounting Rubber(s) Rear Axle Left



Rim Rear Right



Rim Rear Left



Side Mirror Right



Door Handle Front Right



Headlight Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za