



CONDITION REPORT

Report No: 2016206362

DATE
19/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	19/12/2023		M57 Pretoria Road - 1619
Inspection Date	19/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	FT51GNGP
Model	SANDERO	Register Number	
VIN	VF15SRAAC56415418	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2023
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	115,645 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

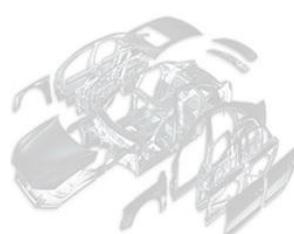

Damage	Repair Way
Fog Light Rear Left Defective	Repair
Rear Fender Left Paintwork • Dull	Repair
Door Rear Left Paintwork • Dull	Repair
Windscreen Chipped	Replace
Rim Rear Left Dented	Repair
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace



CONDITION REPORT

Report No: 2016206362

DATE
19/12/2023

Brakes

Brake Test Results

	Left	Right		
	Braking Force [kN]	Braking Force [kN]	Axle Weight [kg]	Deceleration [m/s ²]
Front	2.0	2.3	-	
Rear	0.9	1.0	-	
Emergency / Parking	1.1	1.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	91H	Continental	Contact	V	3816	1 mm
Front Right	205/55R16	91H	Continental	Contact	V	4016	5 mm
Rear Left	205/55R16	91W	Rovelo	RPX	V	0321	5 mm
Rear Right	205/55R16	91H	Continental	Contact	V	3219	5 mm
Spare	185/65R15	88T	Barum	Brilliantis	V	////	6 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacturer).

Inspection Conditions

No Test Drive
 Rain at time of inspection
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.
 Engine Compartment: Bottom of engine is covered.
 Body • Exterior: Minor dents scratches and stone chips on some body panels. Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: V15ENR2016206362

Report No: 2016206362


2 / 8

DATE


19/12/2023

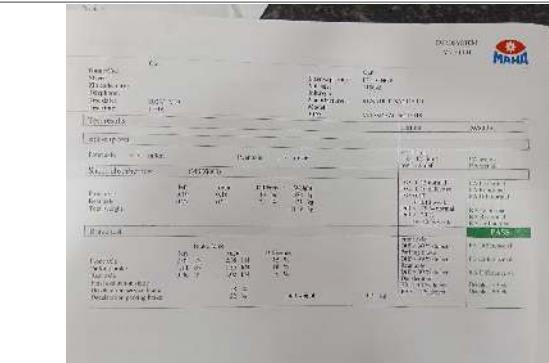


Shock and brake report

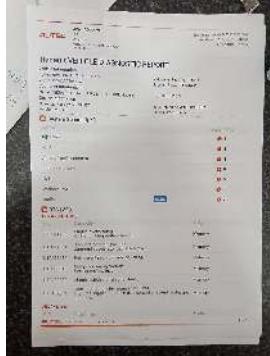

Diagnostic test

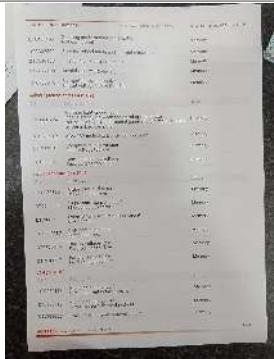

Diagnostic test

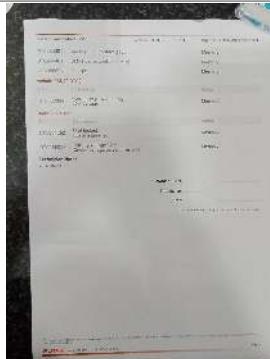

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



CONDITION REPORT

Report No: 2016206362

VIN: VF15SRAAC56415418

DATE

3/8
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016206362

DATE

VIN: VF15SRAA1G9421203

19/12/2023

4 / 8



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



CONDITION REPORT

Report No: 2016206362

DATE
19/12/2023

VIN: VF15SRAAC56415418

5 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016206362

DATE
19/12/2023

VIN: VF15SRAAC56415418

6 / 8



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



CONDITION REPORT

Report No: 2016206362

DATE
19/12/2023

VIN: VF15SRAAC56415418

7 / 8



CONDITION REPORT

Report No: 2016206362

DATE
19/12/2023

LICENSE DISC



VIN PLATE OR STICKER




ENGINE 1



ENGINE 2



CHASSIS

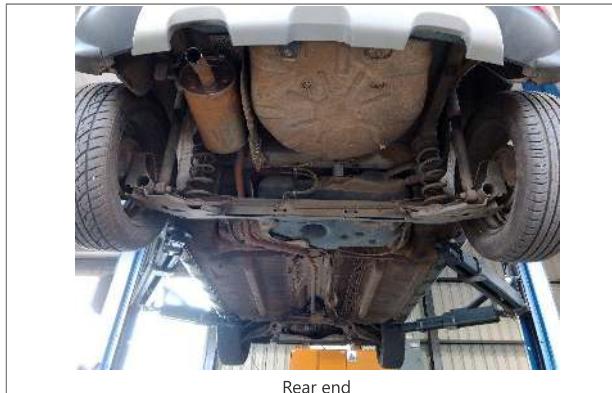

Rear end



CONDITION REPORT

Report No: 2016206362

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016206362

DATE
19/12/2023

Oil cap and dipstick



Manual



Expansion bottle



Rear Fender Left



Door Rear Left



Bolt(s) / Nut(s) Front Wheel Left



CONDITION REPORT

Report No: 2016206362

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016206362

DATE
19/12/2023

Rim Rear Left



Fog Light Rear Left



Windscreen



CONDITION REPORT

Report No: 2016206362

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za