



## CONDITION REPORT



Report No:  
2016962656  
DATE  
30/07/2025

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 30/07/2025        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 30/07/2025        |                     | Kempton Park -           |

## Vehicle Data

|                 |                   |                         |            |
|-----------------|-------------------|-------------------------|------------|
| Vehicle Type    | PASSENGER VEHICLE | Registered Owner        |            |
| Manufacturer    | RENAULT           | Registration Number     | FY97WDGP   |
| Model           | SANDERO           | Register Number         |            |
| VIN             | VF15SRAAC57850959 | Date Of First Licensing |            |
| Engine Number   |                   | Last COR                |            |
| Doors           | 5                 | License Expiry Date     |            |
| Color           | WHITE             | Power / Displacement    |            |
| Year Model      |                   | Paint Finish            | C - COMMON |
| Km Reading      | 90,729 KM         | Fuel                    | PETROL     |
| Cab / Body Type | HATCHBACK         | Transmission            | MANUAL     |

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: VF15SRAAC57850959



## CONDITION REPORT



Report No:  
2016962656  
DATE  
30/07/2025

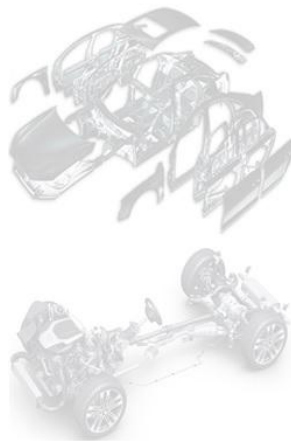

## Damage

## Repair Way

|                                         |                                                    |
|-----------------------------------------|----------------------------------------------------|
| Seat Front Right Torn / Cut             | Repair                                             |
| Door Sealing Rubber Rear Right Damaged  | Replace                                            |
| Rear Lower Valance Damaged              | Repair                                             |
| Front Bumper Damaged                    | Repair                                             |
| Front Fender Left Dented                | Repair                                             |
| Front Fender Right Dented               | Repair                                             |
| Rear Fender Left Paintwork • Scratched  | Repair                                             |
| Rear Fender Right Paintwork • Scratched | Repair                                             |
| Door Rear Left Paintwork • Scratched    | Repair                                             |
| Door Rear Right Paintwork • Scratched   | Repair                                             |
| Rear bumper Damaged                     | Repair                                             |
| Windscreen Cracked                      | Repair                                             |
| Rim Rear Left Dented                    | Repair                                             |
| Body exterior                           | Signs of spray work done on some body panels       |
| Body exterior                           | Minor dents scratches stone chips on some body pan |
| Engine                                  | Bottom of engine is covered                        |
| Sparewheel well damage                  | Repair                                             |

## Brakes

## Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 2.4                | 2.6                | -                |                                  |
| Rear                | 1.7                | 1.6                | -                |                                  |
| Emergency / Parking | 0.8                | 1.1                | -                |                                  |

## Tyres and Rims

## Tyre Specification &amp; Measurement

|             | Size      | Load/Speed Index | Manufacture | Model      | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|------------|-------|-----------------|------------------|
| Front Left  | 205/55R16 | 91V              | Goodyear    | Efficient  | V     | 3420            | 5 mm             |
| Front Right | 205/55R16 | 91V              | Goodyear    | Efficient  | V     | 3420            | 5 mm             |
| Rear Left   | 205/55R16 | 91H              | Continental | Contact    | V     | 1317            | 5 mm             |
| Rear Right  | 205/55R16 | 91H              | Continental | Cont       | V     | 1317            | 5 mm             |
| Spare       | 185/65R15 | 88T              | Barum       | Brillantis | V     | 0000            | 3 mm             |

\* Tyre Legend: V=Virgin, R=Rechap

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: VF15SRAAC57850959



## CONDITION REPORT



Report No:  
2016962656  
DATE  
30/07/2025

**Diagnostic**

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System    | Code      | Description                                        | Status |
|----|-----------|-----------|----------------------------------------------------|--------|
| 1  | INJECTION | DTC013009 | UPSTREAM OXYGEN SENSOR CIRCUIT COMPONENT IN POOR C |        |

**Inspection Conditions**

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

**Comments**

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

**Technician**

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: VF15SRAAC57850959



## CONDITION REPORT



Report No:  
2016962656  
DATE  
30/07/2025



Manual



Warning lights illuminated



Sparewheel well damage



Sparewheel well damage



Expansion bottle



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: VF15SRAAC57850959



## CONDITION REPORT



Report No:  
2016962656  
DATE  
30/07/2025



R/F headlight clips broken



Sparewheel well damage




Sparewheel damage



Rear end



Sparewheel

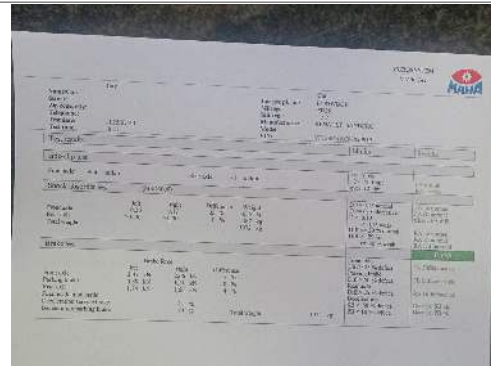

Shock and brake report

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: VF15SRAAC57850959



## CONDITION REPORT




Report No:  
2016962656  
DATE  
30/07/2025



Diagnostic test



Diagnostic test

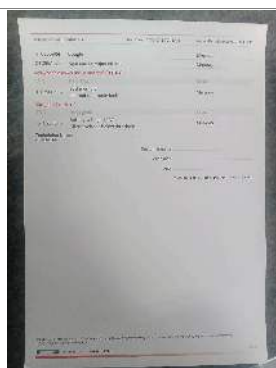

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: VF15SRAAC57850959



## CONDITION REPORT



Report No:  
2016962656  
DATE  
30/07/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)


VIN: VF15SRAAC57850959




## CONDITION REPORT



Report No:  
2016962656  
DATE  
30/07/2025

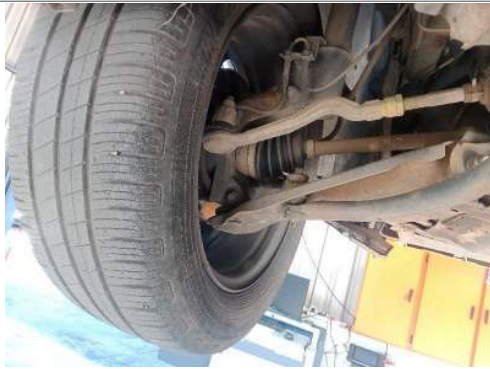

LF TYRE TREAD

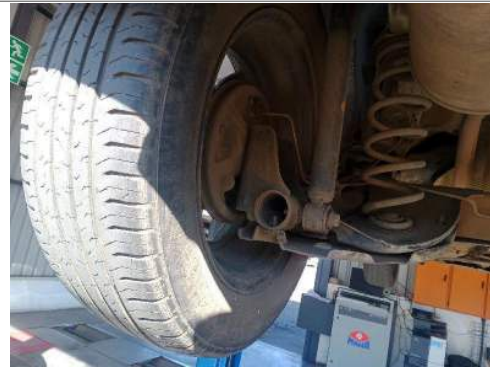

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: VF15SRAAC57850959



## CONDITION REPORT




Report No:  
2016962656  
DATE  
30/07/2025



ENGINE 1



CHASSIS

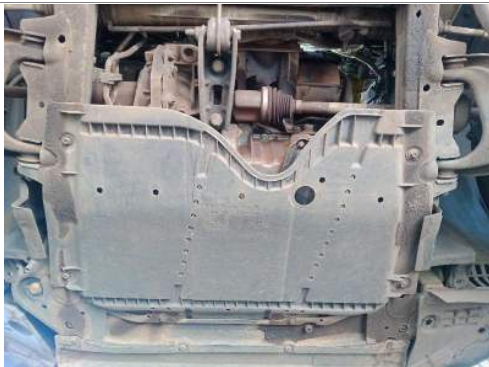

ENGINE 2



Seat Front Right



Front Fender Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: VF15SRAAC57850959



## CONDITION REPORT



Report No:  
2016962656  
DATE  
30/07/2025



Rear Fender Right



Rear bumper



Rear bumper



Door Sealing Rubber Rear Right



Door Rear Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: VF15SRAAC57850959



## CONDITION REPORT



Report No:  
2016962656  
DATE  
30/07/2025



Water level



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Front Fender Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: VF15SRAAC57850959



## CONDITION REPORT



Report No:  
2016962656  
DATE  
30/07/2025



Rim Rear Left



Rear Lower Valance



Windscreen

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: VF15SRAAC57850959