



CONDITION REPORT



Report No:
2017299616
DATE
16/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	17/09/2026		M57 Pretoria Road - 1619
Inspection Date	16/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	JK01TDGP
Model	SANDERO STEPWAY	Register Number	
VIN	VF15SRAAC63539692	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	BLUE	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	144,480 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF15SRAAC63539692



CONDITION REPORT



Report No:

2017299616

DATE

16/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Engine Management Lights Set	Repair
Windscreen Wiper Damaged	Replace
Interior Lights Damaged	Replace
Tail Light Right Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Door Panel Front Right Damaged	Replace
Parcel Tray Missing	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Doorstopper Front Right Damaged	Replace
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Windscreen Damaged	Repair
Brake disc 1. Axle left Worn	Replace
Brake disc 1. Axle right Worn	Replace
Shock Absorber Front Left Worn	Replace
Shock Absorber Front Right Worn	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Spare Tyre Damaged	Replace
Brakes Malfunction	Repair
Engine Performance Insufficient	Repair
Engine Noise Excessive	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.61	2.72	-	
Rear	1.33	1.35	-	
Emergency / Parking	1.15	1.5	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF15SRAAC63539692



CONDITION REPORT



Report No:
2017299616
DATE
16/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	91V	Linglong	Radial	V	5221	1 mm
Front Right	205/55R16	91V	Kapsen	Radial	V	0823	2 mm
Rear Left	205/55R16	91H	Continental	Contieco	V	24119	0 mm
Rear Right	205/55R16	91H	Continental	Contieco	V	2419	0 mm
Spare	185/65R15	88T	Barum	Radial	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJ	DTC001192	INLET CAMSHAFT SHIFTER PHASER CONTROL OUTSIDE OF LIMITS.	ACTIVE

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 34 DTC'S AT TIME OF TESTING SEE DTC REPORT. STARTER MALFUNCTIONING.Engine Compartment: Battery loose. engine struggles to start.

Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels. Repair work done to vehicle below standard. Vehicle body in poor condition. Signs of impact damage to rear of vehicle.

Tyres and Rims: spare wheel deflated.

Road Test: brakes are extremely hard. vehicle cannot be driven.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF15SRAAC63539692



CONDITION REPORT



Report No:

2017299616

DATE _____

16/09/2026

1. SUBJECT INFORMATION
V. 1.

Brake test.

[illegible]

Diagnostic.

DATE	DESCRIPTION	AMOUNT	BALANCE
1970-01-01	OPENING BALANCE		100.00
1970-01-15	PAID TO MRS. J. B. SMITH	25.00	75.00
1970-02-01	RECEIVED FROM MRS. J. B. SMITH	10.00	85.00
1970-02-15	PAID TO MRS. J. B. SMITH	15.00	70.00
1970-03-01	RECEIVED FROM MRS. J. B. SMITH	5.00	75.00
1970-03-15	PAID TO MRS. J. B. SMITH	10.00	65.00
1970-04-01	RECEIVED FROM MRS. J. B. SMITH	15.00	80.00
1970-04-15	PAID TO MRS. J. B. SMITH	10.00	70.00
1970-05-01	RECEIVED FROM MRS. J. B. SMITH	5.00	75.00
1970-05-15	PAID TO MRS. J. B. SMITH	10.00	65.00
1970-06-01	RECEIVED FROM MRS. J. B. SMITH	15.00	80.00
1970-06-15	PAID TO MRS. J. B. SMITH	10.00	70.00
1970-07-01	RECEIVED FROM MRS. J. B. SMITH	5.00	75.00
1970-07-15	PAID TO MRS. J. B. SMITH	10.00	65.00
1970-08-01	RECEIVED FROM MRS. J. B. SMITH	15.00	80.00
1970-08-15	PAID TO MRS. J. B. SMITH	10.00	70.00
1970-09-01	RECEIVED FROM MRS. J. B. SMITH	5.00	75.00
1970-09-15	PAID TO MRS. J. B. SMITH	10.00	65.00
1970-10-01	RECEIVED FROM MRS. J. B. SMITH	15.00	80.00
1970-10-15	PAID TO MRS. J. B. SMITH	10.00	70.00
1970-11-01	RECEIVED FROM MRS. J. B. SMITH	5.00	75.00
1970-11-15	PAID TO MRS. J. B. SMITH	10.00	65.00
1970-12-01	RECEIVED FROM MRS. J. B. SMITH	15.00	80.00
1970-12-15	PAID TO MRS. J. B. SMITH	10.00	70.00
1971-01-01	CLOSING BALANCE		70.00

Diagnostic.

Shop Pinpoint B DASH-079		Fault Time: 2008-06-24 12:02 PM	Technician: MARCOLOMBINI/TOM
DTCB93118	Right indicator circuit Circuit current above threshold		Memory
BTC950223	Start of clutch switch travel circuit		Memory
DTCS950224	Start of clutch switch travel circuit		Memory
DTCS950894	Bangle		Memory
DAV(Variable power assist steering) (1 DTC)			
DFC	Description		Status
DTCS50758	ECU memory Internal electronic fault		Memory
RDR(Reddy) (2 DTCs)			
DTG	Description		Status
DTCS34262	Unit locked System jammed		Memory
DTCS93016	Battery voltage 12 V Circuit voltage below threshold		Memory
Technician Notes 207 799416			
		Customer name:	
		Technician:	
		Date:	

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF15SRAAC63539692



CONDITION REPORT



Report No:
2017299616
DATE
16/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF15SRAAC63539692



CONDITION REPORT



Report No:
2017299616
DATE
16/09/2026



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF15SRAAC63539692



CONDITION REPORT



Report No:
2017299616
DATE
16/09/2026



LICENSE DISC




VIN PLATE OR STICKER




ENGINE 1



Undercarriage front.

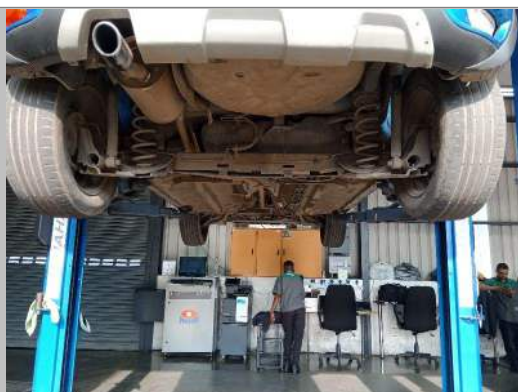

Undercarriage rear.

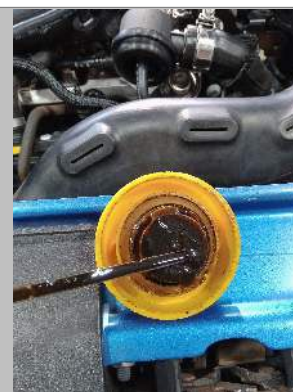

Oil cap and dipstick.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF15SRAAC63539692




CONDITION REPORT



Report No:
2017299616
DATE
16/09/2026




Water level

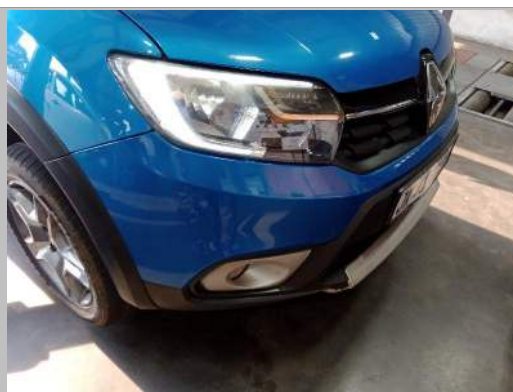


Front Bumper



Front Bumper

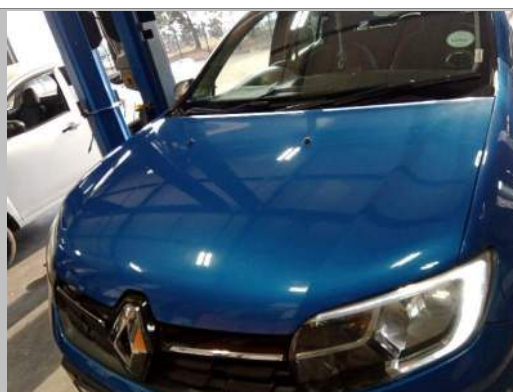

Bonnet

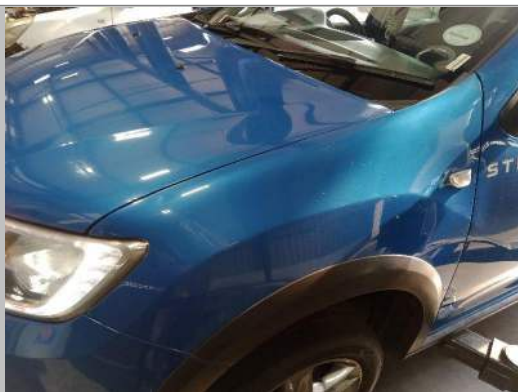

Front Fender Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: VF15SRAAC63539692



CONDITION REPORT



Report No:
2017299616
DATE
16/09/2026

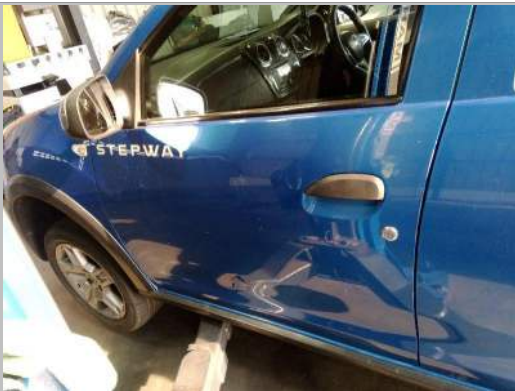

Door Front Left



Door Rear Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF15SRAAC63539692



CONDITION REPORT



Report No:
2017299616
DATE
16/09/2026



Door Front Right



Front Fender Right



Rear Fender Right



Windscreen



Tyre Rear Left



Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF15SRAAC63539692



CONDITION REPORT



Report No:
2017299616
DATE
16/09/2026



Engine



Brake disc 1. Axle right



Brake disc 1. Axle left



Shock Absorber Front Left



Shock Absorber Front Right



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF15SRAAC63539692



CONDITION REPORT



Report No:
2017299616
DATE
16/09/2026



Seat Front Left



Seat Rear



Spare Tyre



Parcel Tray



Tail Light Right



Inner Boot Floor Pan and Spare Wheel Well

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF15SRAAC63539692



CONDITION REPORT



Report No:


2017299616

DATE

16/09/2026



Inner Boot Floor Pan and Spare Wheel Well

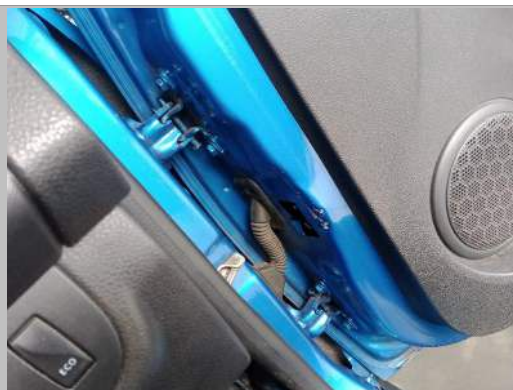

Doorstopper Front Right



Door Panel Front Right



Interior Lights



Windscreen Wiper



Engine Management Lights

DEKRA Automotive (PTY) Ltd.

97 Willem Cruywagen Ave

Klerksord, Pretoria, 0200

Phone: 012 542 4867

www.dekraauto.co.za

VIN: VF15SRAAC63539692