



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	24/01/2024		M57 Pretoria Road - 1619
Inspection Date	24/01/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	NISSAN	Registration Number	HTZ385MP
Model	NAVARA	Register Number	
VIN	VSKCVND40Z0564202	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/09/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	241,942 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	AUTOMATIC

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

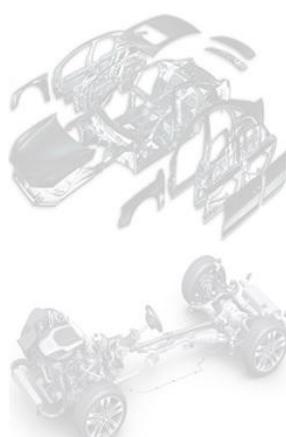

Damage	Repair Way
Engine Oil Sweat	Repair
Hoses Defective	Repair
Fan Belt Defective	Replace
Under bonnet insulation cover Damaged	Repair
Tail Light Left Broken	Replace
Seat Front Right Torn / Cut	Repair
Steering Wheel Trim Defective	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Paintwork • Chipmarks	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Damaged	Repair
Door Rear Right Residual Traces of Repair	Repair
Tailgate Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Dented	Repair
Load Body Paintwork • Scratched	Repair
Windscreen Chipped	Replace
Brake disc 1. Axle left Defective	Replace
Brake disc 1. Axle right Defective	Replace
Stabilizer Mounting Front Left Defective	Repair
Engine to silencer pipe Defective	Repair
Gearbox Oil Sweat	Repair
Cab Mounting Point Rear Right Cracked	Replace
Brakes Noisy	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VSKCVND40Z0564202

1 / 13



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

Damage	Repair Way
Jack Missing	Replace

Brakes**Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	-	-	-	-
Rear	-	-	-	-
Emergency / Parking	-	-	-	-

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/65 R17	112T	Continental	Crosscontact	V	3422	9 mm
Front Right	265/65 R17	112T	Continental	Crosscontact	V	3322	9 mm
Rear Left	265/65 R17	112T	Continental	Crosscontact	V	3322	9 mm
Rear Right	265/65 R17	112T	Continental	Crosscontact	V	3322	9 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE	P1550	BATTERY CURRENT SENSOR	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Engine bay dirty. Brake fluid level ok. Rust inside expansion bottle. Battery loose. Co

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: KVKCNPND02076240437

Report No: 2076240437


2 / 13

DATE


24/01/2024

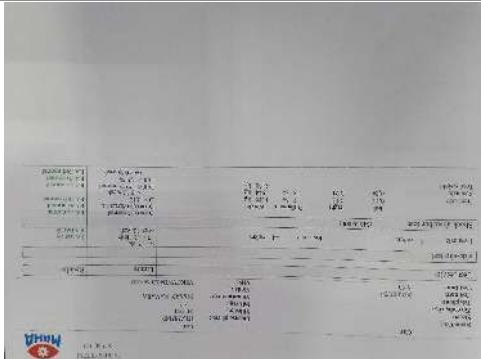

Shock absorber report

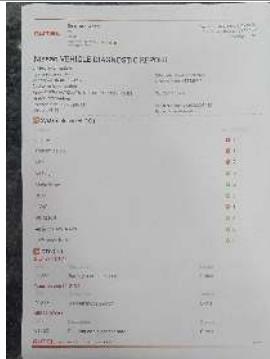

Diagnostic report page 1

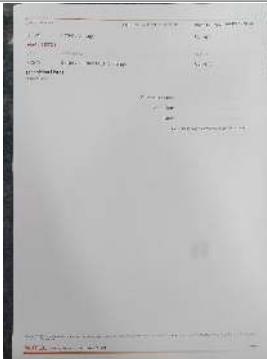

Diagnostic report page 2




FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

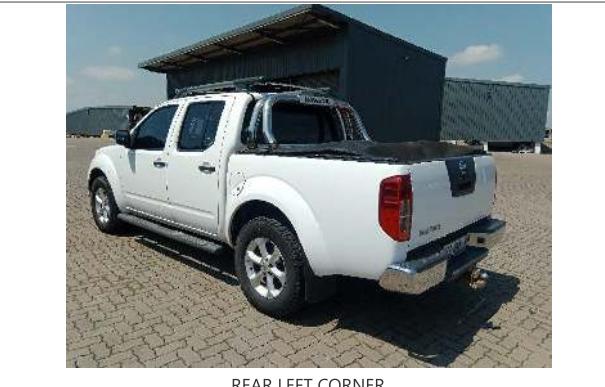

**CONDITION REPORT****Report No: 2016240437**

VIN: VSKCVND40Z0564202

DATE

24/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016240437

DATE

VIN: VSKCVND 24/05/2024

4 / 13



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

VIN: VSKCND40Z0564202

5 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

VIN: VSKCVND40Z0564202

6 / 13



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

VIN: VSKCVND40Z0564202

7 / 13



CONDITION REPORT

Report No: 2016240473

DATE
24/01/2024

VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick



Spare wheel Accessories



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

VIN: VSKCVND40Z0564202

9 / 13



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

Hoses



Water level



Fan Belt



Under bonnet insulation cover



Steering Wheel Trim



Seat Front Right



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

VIN: VSKCVND40Z0564202

11 / 13



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

Door Front Right



Door Rear Right



Rear Fender Right



Load Body



Tail Light Left



Tailgate





CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

VIN: VSKCVND40Z0564202

13 / 13



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

Rear bumper



Rear bumper



Rear Fender Left



Door Rear Left



Door Front Left



Sill Panel Left



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

Front Fender Left



Windscreen



Front Bumper



Front Bumper



Bonnet



Front Fender Right



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

Engine



Gearbox



Cab Mounting Point Rear Right



Engine to silencer pipe



Stabilizer Mounting Front Left



Brake disc 1. Axle left



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

Brake disc 1. Axle right



CONDITION REPORT

Report No: 2016240437

DATE
24/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za