

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/01/2025		M57 Pretoria Road - 1619
Inspection Date	09/01/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	OPEL	Registration Number	JH06PHGP
Model	CORSA 1.0 ENJOY 66KW 5-DR [2019-2021]	Register Number	
VIN	W0V0XEP68K4502379	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2025
Color	GREY	Power / Displacement	
Year Model	2019	Paint Finish	M - METALLIC
Km Reading	158,549 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Windscreen Wiper Missing	Replace
Parcel Tray Missing	Replace
Bonnet Dented	Repair
A • Pillar Left Dented	Repair
Front Fender Left Dented	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Dented	Repair
Door Front Left Dented	Repair
Door Front Right Damaged	Repair
Door Rear Left Dented	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Dented	Repair
Roof Dented	Repair
Windscreen Cracked	Replace
Tie Rod End right Damaged	Replace
Shock Absorber Mounting Front Left Loose / Excessive Play	Replace
Shock Absorber Mounting Front Right Loose / Excessive Play	Replace
Body exterior	Minor dents scratches stone chips on some body pan

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: W0V0XEP68K4502379

Damage	Repair Way
Most body panels cover in hail damage	Repair
Body exterior	Signs of spray work done on some body panels
Front tyre size differs	Replace
some body panels misaligned	Repair
Warning lights illuminated	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.2	3.1	-	
Rear	2.0	2.1	-	
Emergency / Parking	1.6	1.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	91V	Continental	Contact	V	0517	3 mm
Front Right	185/65R15	88H	Continental	Contact	V	2819	3 mm
Rear Left	205/55R16	91V	Continental	Contact	V	2023	5 mm
Rear Right	205/55R16	91W	Continental	Contact	V	1023	6 mm
Spare	205/55R16	91W	Goodyear	Efficient	V	0000	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	P0011:00	INTAKE CAMSHAFT POSITION SYSTEM PERFORMANCE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

VIN: W0V0XEP68K4502379


2 / 12




Warning lights illuminated




Manual

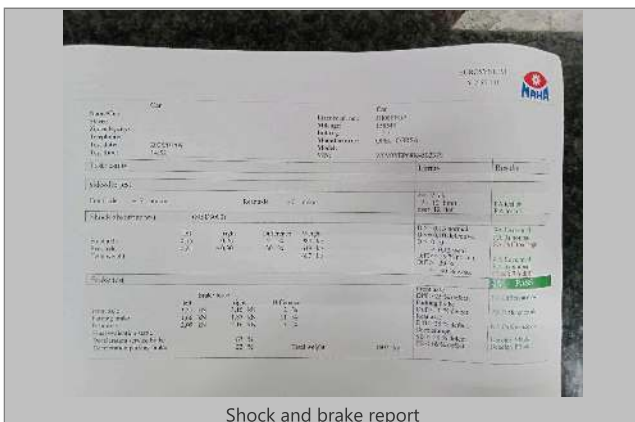


Shock and brake report

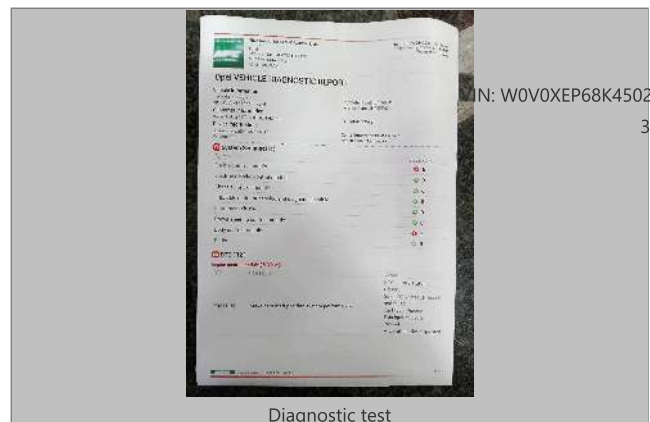

Diagnostic test

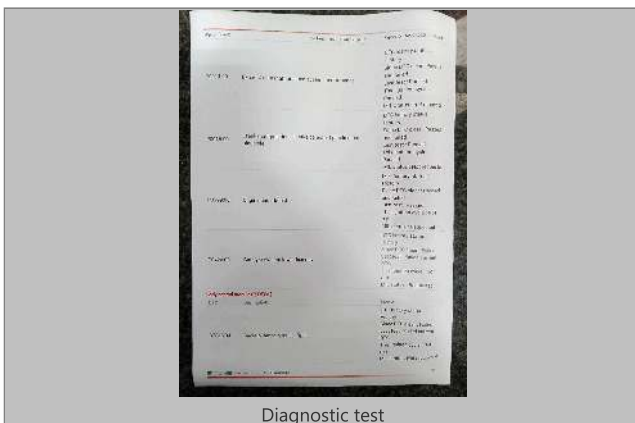

Diagnostic test

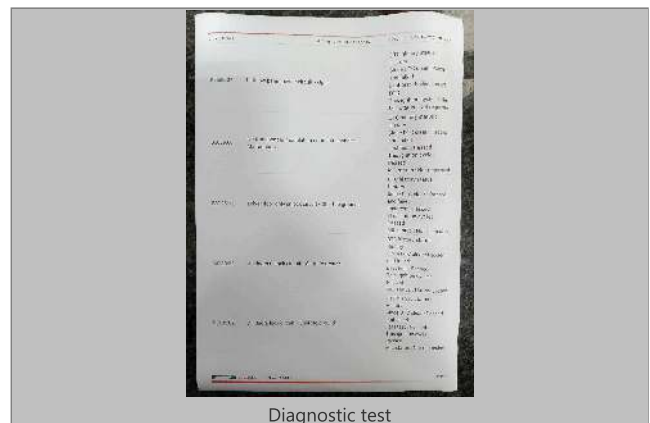


Diagnostic test

N: WOV0XEP68K4502379

3 / 12

VIN: W0V0XEP68K4502379

4 / 12

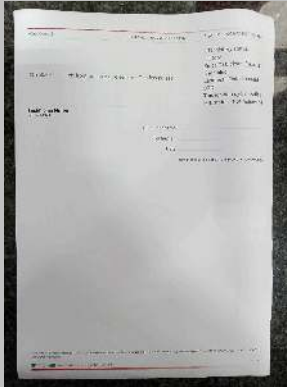

Diagnostic test



Sparewheel



Oil cap and dipstick



Expansion bottle



Rear end



FRONT RIGHT CORNER

VIN: W0V0XEP68K4502379

5 / 12

VIN: W0V0XEP68K4502379

6 / 12



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

VIN: W0V0XEP68K4502379

8 / 12



LICENSE DISC



VIN PLATE OR STICKER



LF TYRE TREAD



LR TYRE TREAD

VIN: W0V0XEP68K4502379

9 / 12



RR TYRE TREAD



RF TYRE TREAD



ENGINE 1



CHASSIS



ENGINE 2



Windscreen Wiper

VIN: W0V0XEP68K4502379


11 / 12



Parcel Tray



Boot Lid / Hatch door

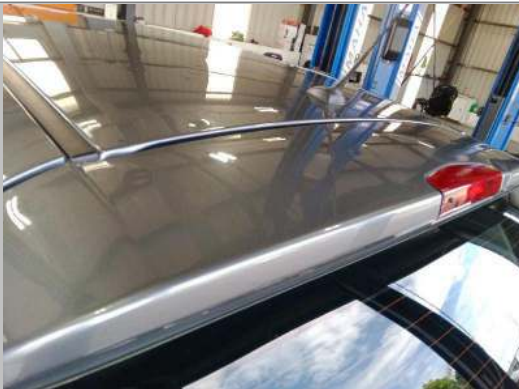

Boot Lid / Hatch door



Rear Fender Left



Door Rear Left



A • Pillar Left

VIN: W0V0XEP68K4502379

12 / 12



A • Pillar Left



Door Front Left



Front Fender Left



Bonnet



Windscreen



Windscreen Wiper



Front Fender Right



Door Front Right



Door Rear Right



Water level



Roof



Shock Absorber Mounting Front Right



Shock Absorber Mounting Front Left



Tie Rod End right



CONDITION REPORT

Report No: 2016713971

DATE
09/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za