



CONDITION REPORT



Report No:
2016960881
DATE
28/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/07/2025		M57 Pretoria Road - 1619
Inspection Date	28/07/2025		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	AUDI	Registration Number	KT09DBGP
Model	S3 SEDAN 2.0T FSI QUATTRO S TRONIC [2014-2014]	Register Number	
VIN	WAUZZZ8V2E1030522	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/03/2026
Color	WHITE	Power / Displacement	
Year Model	2014	Paint Finish	M - METALLIC
Km Reading	130,807 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WAUZZZ8V2E1030522



CONDITION REPORT



Report No:
2016960881
DATE
28/07/2025

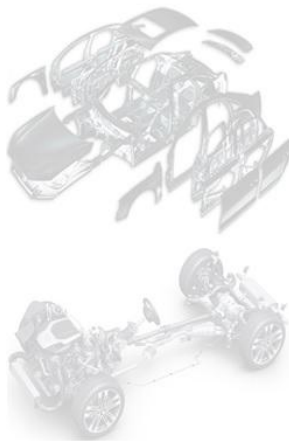

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Damaged	Repair
Hoses Oil Leak	Repair
Front Bumper Damaged	Repair
C • Pillar Left Damaged	Repair
Front Fender Left Dented	Repair
Door Rear Left Damaged	Repair
Rear bumper Damaged	Repair
Steering Rack Boot Right Leak	Repair
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Tyre Rear Left Smooth	Replace
Tyre Rear Right Excessive Wear & Tear	Replace
Rim Front Left Cracked	Replace
Rim Rear Left Dented	Repair
Engine to silencer pipe Welded	Replace
Differential Oil Leak	Repair
Body exterior	Signs of spray work done on some body panels
Warning lights illuminated	Repair
Electronics malfunction.	Bootlid does not open
Windscreen Is Tinted	Repair

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/35R19	91Y	Continental	Contact	V	0000	1 mm
Front Right	235/35R19	91Y	Goodyear	Eagle	V	0000	2 mm
Rear Left	235/35R19	91Y	Continental	Contact	V	2222	0 mm
Rear Right	235/35R19	91W	Yokohama	Advance	V	0000	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V2E1030522



CONDITION REPORT



Report No:
2016960881
DATE
28/07/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	P268100	INTAKE MANIFOLD RUNNER BANK 1 CONTROL CIRCUIT OPEN	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WAUZZZ8V2E1030522



CONDITION REPORT




Report No:
2016960881
DATE
28/07/2025

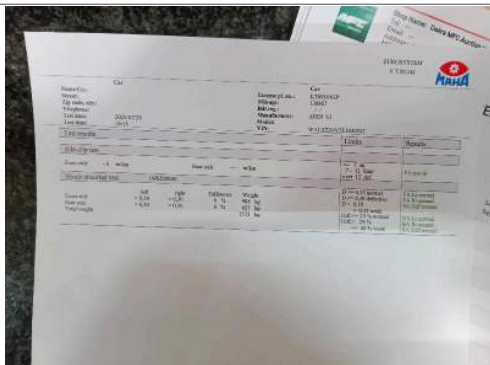


Shock test



Diagnostic test

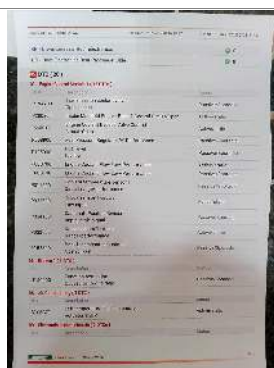

Diagnostic test

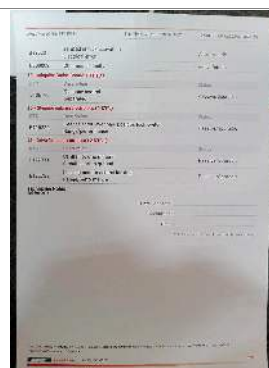

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V2E1030522



CONDITION REPORT



Report No:
2016960881
DATE
28/07/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V2E1030522



CONDITION REPORT



Report No:
2016960881
DATE
28/07/2025



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V2E1030522



CONDITION REPORT



Report No:
2016960881
DATE
28/07/2025



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V2E1030522



CONDITION REPORT



Report No:
2016960881
DATE
28/07/2025



Expansion bottle



Oil cap and dipstick



Warning lights illuminated



Engine warning lights illumina



Rear bumper



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V2E1030522



CONDITION REPORT



Report No:
2016960881
DATE
28/07/2025



C • Pillar Left



Front Fender Left



Water level



Stabilizer Mounting Front Right



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V2E1030522



CONDITION REPORT



Report No:
2016960881
DATE
28/07/2025



Front Bumper



Front Bumper



Front Bumper



Stabilizer Mounting Front Left



Rim Front Left



Rim Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V2E1030522



CONDITION REPORT



Report No:
2016960881
DATE
28/07/2025



Hoses



Hoses



Engine



Engine



Engine



Steering Rack Boot Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V2E1030522



CONDITION REPORT



Report No:
2016960881
DATE
28/07/2025



Differential



Rim Rear Left



Tyre Rear Left



Tyre Rear Right



Engine to silencer pipe



Engine to silencer pipe

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V2E1030522



CONDITION REPORT



Report No:
2016960881
DATE
28/07/2025



Engine to silencer pipe



Engine to silencer pipe



Engine Wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ8V2E1030522