



CONDITION REPORT



Report No:
2017304186
DATE
28/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/09/2026		M57 Pretoria Road - 1619
Inspection Date	28/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	BMW	Registration Number	JM73CPGP
Model	320i GT 5-DR AT [2013-2016]	Register Number	
VIN	WBA3X12050D735476	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/06/2026
Color	GREY	Power / Displacement	
Year Model	2014	Paint Finish	M - METALLIC
Km Reading	175,272 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3X12050D735476



CONDITION REPORT



Report No:

2017304186

DATE

28/09/2026



Damage

Repair Way

Bonnet stay and shocks Defective	Replace
Tail Light Left Cracked	Repair
Front Bumper Damaged	Repair
Bonnet Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Damaged	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tie Rod End right Damaged	Replace
Control Arm Bush(es) Front Axle Right Damaged	Replace
Tyre Rear Left Smooth	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Both front fog lights malfunction	Repair
R/F fender liner missing	Replace
Rear tyres size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.0	3.3	-	
Rear	2.8	3.0	-	
Emergency / Parking	2.4	1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/50R18	97V	Yokohama	C drive	V	2919	3 mm
Front Right	235/50R18	101W	Lanvigator	Catch power	V	2519	2 mm
Rear Left	225/50R18	95W	Bridgestone	Turanza	V	2820	0 mm
Rear Right	235/50R18	101V	Continental	Contact	V	5017	1 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: WBA3X12050D735476



CONDITION REPORT



Report No:
2017304186
DATE
28/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INTERMITTENT	930AA3	CRASH SAFETY MODULE UNDERVOLTAGE DETECTED SELF-TES	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3X12050D735476



CONDITION REPORT



Report No:
2017304186
DATE
28/09/2026

[illegible]

Shock and brake report

[illegible]

Diagnostic report

[illegible]

Diagnostic report

[illegible]

Diagnostic report

1970-1979	1980-1989	1990-1999
1970	1980	1990
1971	1981	1991
1972	1982	1992
1973	1983	1993
1974	1984	1994
1975	1985	1995
1976	1986	1996
1977	1987	1997
1978	1988	1998
1979	1989	1999
1980	1990	2000
1981	1991	2001
1982	1992	2002
1983	1993	2003
1984	1994	2004
1985	1995	2005
1986	1996	2006
1987	1997	2007
1988	1998	2008
1989	1999	2009
1990	2000	2010
1991	2001	2011
1992	2002	2012
1993	2003	2013
1994	2004	2014
1995	2005	2015
1996	2006	2016
1997	2007	2017
1998	2008	2018
1999	2009	2019
2000	2010	2020
2001	2011	2021
2002	2012	2022
2003	2013	2023
2004	2014	2024
2005	2015	2025
2006	2016	2026
2007	2017	2027
2008	2018	2028
2009	2019	2029
2010	2020	2030
2011	2021	2031
2012	2022	2032
2013	2023	2033
2014	2024	2034
2015	2025	2035
2016	2026	2036
2017	2027	2037
2018	2028	2038
2019	2029	2039
2020	2030	2040
2021	2031	2041
2022	2032	2042
2023	2033	2043
2024	2034	2044
2025	2035	2045
2026	2036	2046
2027	2037	2047
2028	2038	2048
2029	2039	2049
2030	2040	2050
2031	2041	2051
2032	2042	2052
2033	2043	2053
2034	2044	2054
2035	2045	2055
2036	2046	2056
2037	2047	2057
2038	2048	2058
2039	2049	2059
2040	2050	2060
2041	2051	2061
2042	2052	2062
2043	2053	2063
2044	2054	2064
2045	2055	2065
2046	2056	2066
2047	2057	2067
2048	2058	2068
2049	2059	2069
2050	2060	2070
2051	2061	2071
2052	2062	2072
2053	2063	2073
2054	2064	2074
2055	2065	2075
2056	2066	2076
2057	2067	2077
2058	2068	2078
2059	2069	2079
2060	2070	2080
2061	2071	2081
2062	2072	2082
2063	2073	2083
2064	2074	2084
2065	2075	2085
2066	2076	2086
2067	2077	2087
2068	2078	2088
2069	2079	2089
2070	2080	2090
2071	2081	2091
2072	2082	2092
2073	2083	2093
2074	2084	2094
2075	2085	2095
2076	2086	2096
2077	2087	2097
2078	2088	2098

Diagnostic report

[illegible]

Diagnostic report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WBA3X12050D735476



CONDITION REPORT




Report No:
2017304186
DATE
28/09/2026

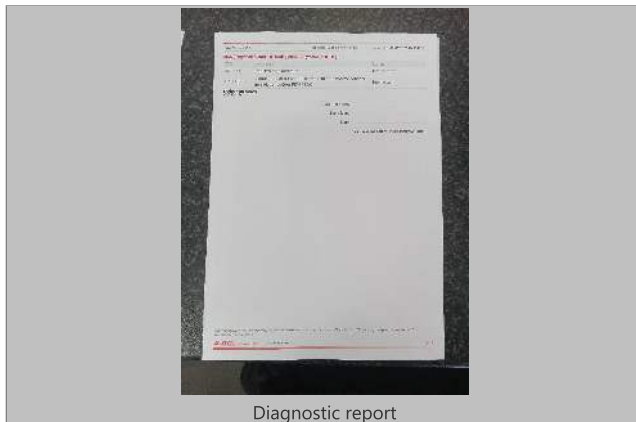

Diagnostic report



FRONT RIGHT CORNER

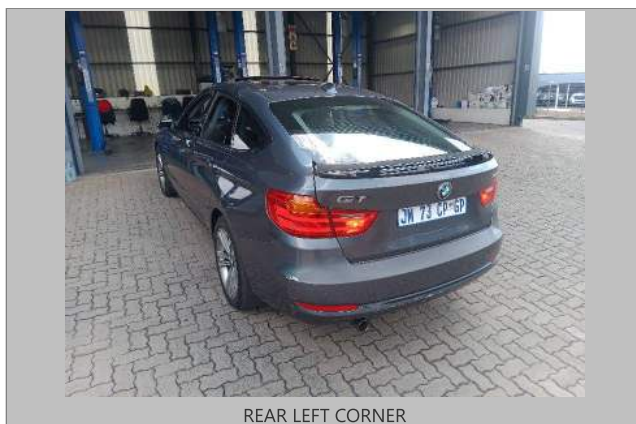

REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3X12050D735476



CONDITION REPORT



Report No:
2017304186
DATE
28/09/2026



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3X12050D735476




CONDITION REPORT




Report No:
2017304186
DATE
28/09/2026



LR TYRE TREAD

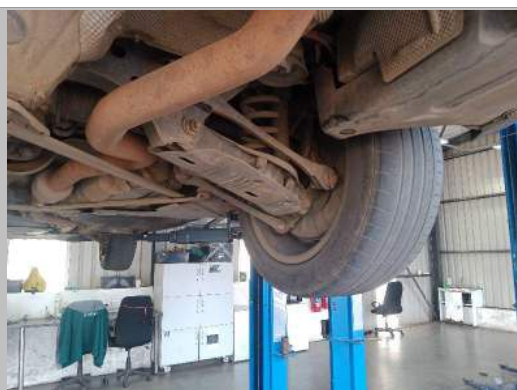

RR TYRE TREAD

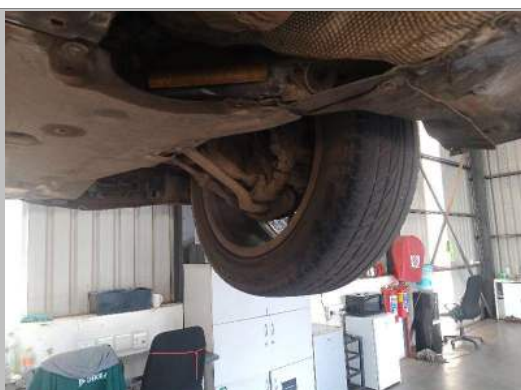

RF TYRE TREAD



No spare wheel



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3X12050D735476



CONDITION REPORT



Report No:
2017304186
DATE
28/09/2026



ENGINE 1



ENGINE 2



CHASSIS



Expection bottle



Oil cap

Test results	
Side-slip test	
Front axle	-1 m/km
Rear axle	-10 m/km
Shock absorber test (MSD3000)	
Front axle	0.25
Rear axle	0.13
Weight	976 kg
Total weight	1067 kg
Brake test	
Front axle	1.02 kN
Rear axle	1.02 kN
Weight	976 kg
Total weight	1067 kg
Description parking brake	
Front evaluation status	2.64 kN
Rear axle	2.64 kN
Weight	976 kg
Total weight	1067 kg

Parking Brake Performance

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3X12050D735476



CONDITION REPORT



Report No:
2017304186
DATE
28/09/2026



Water level



Bonnet stay and shocks



Bonnet



Rear Fender Right



Door Rear Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3X12050D735476



CONDITION REPORT



Report No:
2017304186
DATE
28/09/2026



Front Fender Right



Front Bumper



Front Bumper



Front Fender Left



Door Front Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3X12050D735476



CONDITION REPORT



Report No:
2017304186
DATE
28/09/2026



Rear Fender Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



Tail Light Left



Bolt(s) / Nut(s) Rear Wheel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3X12050D735476



CONDITION REPORT




Report No:
2017304186
DATE
28/09/2026



Bolt(s) / Nut(s) Rear Wheel Left



Bolt(s) / Nut(s) Front Wheel Left

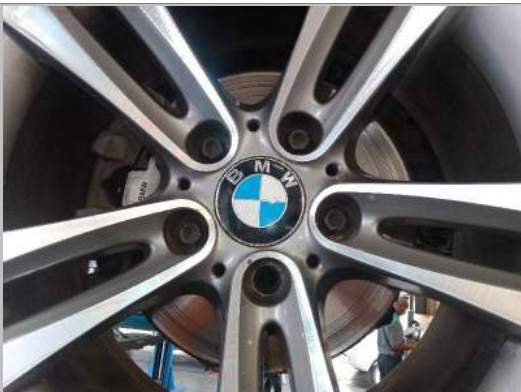

Bolt(s) / Nut(s) Front Wheel Right



Tyre Rear Left



Tie Rod End right



Control Arm Bush(es) Front Axle Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3X12050D735476

**CONDITION REPORT**

Report No:
2017304186
DATE
28/09/2026



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3X12050D735476