

CONDITION REPORT

Report No: 2016852364

DATE 23/04/2025

08610 33572

DEKRA MFC M57 Pretoria Rd - 1619 KEMPTON PARK - GT













| Assi | n | m | Δ | n | ٠ |
|------|---|---|---|---|---|
| | | | | | |

MFC Auction House MFC Client Inspection Location M57 Pretoria Road - 1619 23/04/2025 Requested Date Kempton Park - GT 23/04/2025 Inspection Date

Vehicle Data Vehicle Type PASSENGER VEHICLE Registered Owner BMW KDM770NW Manufacturer Registration Number Model 330D DSL SPORT STEPTRONIC [2015-2019] Register Number Date Of First Licensing WBA8F36050NT48158 Last COR Engine Number License Expiry Date 30/04/2025 Power / Displacement WHITE Paint Finish TWO COAT UNI Year Model 2016 DIESEL Fuel Km Reading 217,360 KM AUTOMATIC Transmission SEDAN Cab / Body Type

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

| Damage | Repair Way | |
|--------------------------------|------------|--|
| Front Bumper Damaged | Repair | |
| Bonnet Damaged | Repair | |
| Front Fender Left Damaged | Repair | |
| Door Front Right Damaged | Repair | |
| Door Rear Left Damaged | Repair | |
| Door Rear Right Damaged | Repair | |
| Boot Lid / Hatch door Damaged | Repair | |
| Rear bumper Damaged | Repair | |
| Windscreen Damaged | Replace | |
| Shock Absorber Front Left Worn | Replace | |
| Tyre Front Left Worn | Replace | |



DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016852364

DATE 23/04/2025

Brakes

Brake Test Results

| | Left | Right | | |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
| | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s ²] |
| Front | 3.74 | 3.82 | - | |
| Rear | 2.52 | 2.61 | - | |
| Emergency / Parking | 2.64 | 2.95 | - | |

Tyres and Rims

Tyre Specification & Measurement

| | Size | Load/Speed Index | Manufacture | Model | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|--------|-------|------------------------|------------------|
| Front Left | 225/40R19 | 93Y | Vitour | Radial | V | 1922 | 0 mm |
| Front Right | 225/40R19 | 93W | Winrun | Radial | V | 2023 | 1 mm |
| Rear Left | 255/35R19 | 96Y | Lanvigator | Radial | V | 2724 | 2 mm |
| Rear Right | 255/35R19 | 96Y | Lanvigator | Radial | V | 2724 | 3 mm |

^{*} Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System | Code | Description | Status |
|----|--------|--------|--|--------|
| 1 | FEM | 8040B9 | DEACTIVATION OF TERMINAL 30B:STOP STARTABILITY LIMIT | |
| | | 004069 | REACHED | |

Inspection Conditions

No Test Drive

Rain at time of inspection

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 7 DTC'S AT TIME OF TESTING SEE DTC REPORT.Body • Exterior: Minor dents and scratches to some body panels. Signs of stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016852364


DATE 23/04/2025

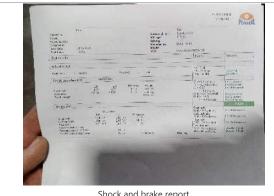

Shock and brake report



Diagnostics

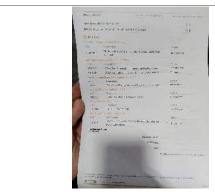

Diagnostics



FRONT RIGHT CORNER



REAR LEFT CORNER



DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016852364

DATE 23/04/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016852364

DATE 23/04/2025



90 DEGREE LEFT













DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016852364

DATE 23/04/2025



VIN PLATE OR STICKER





Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016852364

DATE 23/04/2025



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Door Rear Left



DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867

www.dekraauto.co.za



CONDITION REPORT

Report No: 2016852364

DATE 23/04/2025



Rear bumper



Boot Lid / Hatch door




Door Rear Right



Door Front Right





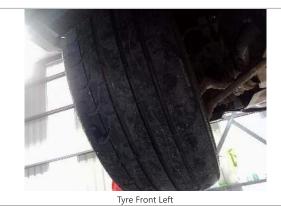

DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867

www.dekraauto.co.za



CONDITION REPORT

Report No: 2016852364

DATE 23/04/2025



Shock Absorber Front Left

DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za