

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/01/2024		M57 Pretoria Road - 1619
Inspection Date	22/01/2024		Kempton Park - GT


Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	MERCEDES-BENZ	Registration Number	CN50ZVGP
Model	E 250	Register Number	
VIN	WDD2043032G114022	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	22/01/2024
Color	RED	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	196,986 KM	Fuel	DIESEL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

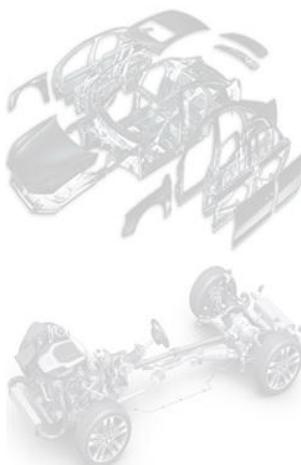

Damage	Repair Way
Tail Light Left Defective	Replace
Dim Light Left Defective	Replace
Sun Roof Switch Defective	Repair
Sun Roof Defective	Repair
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Number Plate Front Deformed	Repair
Number Plate Rear Defective	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
A • Pillar Left Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Tyre Front Right Worn	Replace

Brakes

Brake Test Results

	Left	Right	Axe Weight [KG]	Deceleration [m/s ²]
	Braking Force [kN]	Braking Force [kN]		
Front	3.78	4.13	-	
Rear	3.05	3.15	-	
Emergency / Parking	2.47	1.97	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40R18	92W	Hilo	Radial	V	0321	3 mm
Front Right	225/45R18	95Y	Continental	Contisport	V	0219	0 mm
Rear Left	255/35R18	94W	Lanigator	Radial	V	3921	3 mm
Rear Right	255/35R18	94Y	Michelin	Radial	V	1218	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: VEHICLE ELECTRONICS MALFUNCTIONING. EXCESSIVE NOISE FROM FRONT AND REAR SUSPENSION. Lights: Auto lights malfunctioning.
Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

?ACCORDING TO THE AGE AND

MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



REAR LEFT CORNER



FRONT RIGHT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016237217

VIN: WDD2043032G114022

DATE

22/01/2024



INTERIOR (FRONT DRIVER DOOR)



Automatic





CONDITION REPORT

Report No: 2016237217

DATE
22/01/2024

VIN: WDD2043032G114022

5 / 12

VIN: WDD2043032G114022

6 / 12



Chassis 2



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



CONDITION REPORT

Report No: 2016237217

DATE
22/01/2024

VIN: WDD2043032G114022


7 / 12




ENGINE 1




VIN PLATE OR STICKER

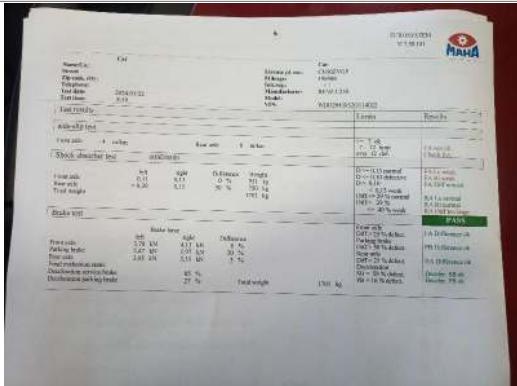

BRAKE REPORT

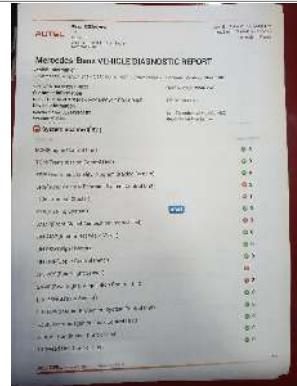

DIAGNOSTIC REPORT PAGE 1

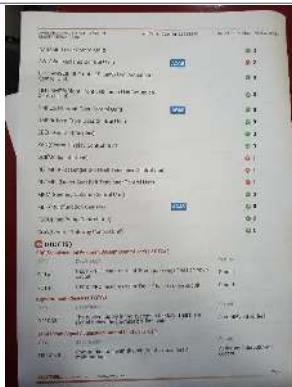

DIAGNOSTIC REPORT PAGE 2



DIAGNOSTIC REPORT PAGE 3




CONDITION REPORT

Report No: 2016237217

DATE
22/01/2024

VIN: WDD2043032G114022

9 / 12

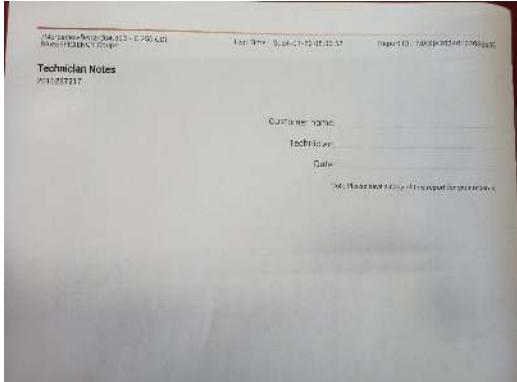

DIAGNOSTIC REPORT PAGE 4



Water level



Front Bumper



Front Bumper



Bonnet



Front Fender Left

VIN: WDD2043032G114022

11 / 12



A • Pillar Left



Door Front Left



Front Fender Right



Rear Fender Left



Rear Fender Right



Door Front Right



CONDITION REPORT

Report No: 2016237217

DATE
22/01/2024



Rear bumper



Rear bumper



Boot Lid / Hatch door



Stabilizer Mounting Front Left



Stabilizer Mounting Front Right



Tyre Front Right



CONDITION REPORT

Report No: 2016237217

DATE
22/01/2024



Number Plate Rear




Number Plate Front



Seat Front Right



Seat Front Right

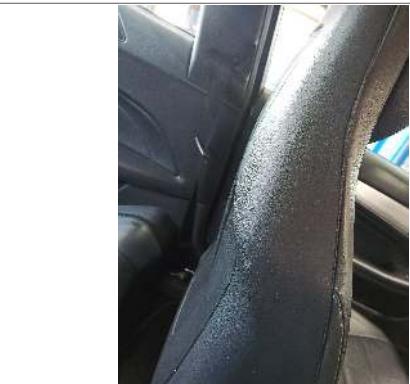

Seat Front Left



Sun Roof Switch



CONDITION REPORT

Report No: 2016237217

DATE
22/01/2024



Sun Roof



Dim Light Left



Tail Light Left



CONDITION REPORT

Report No: 2016237217

DATE
22/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za