



CONDITION REPORT



Report No:
2016962636
DATE
30/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/07/2025		M57 Pretoria Road - 1619
Inspection Date	30/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	MERCEDES-BENZ	Registration Number	JZ11GGGP
Model	VITO	Register Number	
VIN	WDF44770323599001	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/05/2026
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	154,720 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories**Items****VEHICLE INSPECTION**

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323599001



CONDITION REPORT



Report No:
2016962636
DATE
30/07/2025



Damage	Repair Way
Engine Oil Leak	Repair
Central Air Vent Damaged	Replace
Windscreen Wiper Damaged	Replace
Seat Front Right Torn / Cut	Repair
Seat Rear Damaged	Repair
Seat Belt Rear Middle Damaged	Repair
Door Handle Front Right Damaged	Repair
Carpet Rear Damaged	Repair
Side Mirror Left Damaged	Repair
Side Mirror Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Replace
Brake disc 1. Axle left Worn	Replace
Brake disc 1. Axle right Worn	Replace
Brake disc 2. Axle left Worn	Replace
Brake disc 2. Axle right Worn	Replace
Brake Pad/Shoe 2. Axle left Worn	Replace
Brake Pad/Shoe 2. Axle right Worn	Replace
Rebound Rubber Rear Axle Left Damaged	Replace
Control Arm Bush(es) Front Axle Left Welded	Replace
Control Arm Bush(es) Front Axle Right Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Excessive Wear & Tear	Replace
Tyre Rear Right Worn	Replace
Spare Tyre Damaged	Replace
Rim Front Left Cracked	Replace
Rim Front Right Damaged	Replace
Rim Rear Left Deformed	Repair
Rim Rear Right Cracked	Replace
Rim Spare Wheel Damaged	Replace
Belly plates Damaged	Replace
Center Prop Shaft Rubber(s) Loose / Excessive Play	Repair
Rear tyres size differs	Replace



CONDITION REPORT



Report No:
2016962636
DATE
30/07/2025

Brakes**Brake Test Results**

	Left	Right	Axe Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	5.9	5.74	-	
Rear	3.79	4.16	-	
Emergency / Parking	3.12	2.15	-	

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/45R19	102Y	Continental	EcoContact	V	2523	2 mm
Front Right	245/45ZR19	102Y	Tracmax	Radial	V	5123	0 mm
Rear Left	205/65R16C	103H	Michelin	Agilis 51	V	0819	3 mm
Rear Right	245/45ZR16	102Y	Tracmax	Radial	V	5123	0 mm
Spare	245/45ZR19	102Y			V	5123	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacturer).

No	System	Code	Description	Status
1	ECM	P13E7FD	ADBLUE SYSTEM WARNING STAGE 1: THE ADBLUE FILL	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 21 DTC'S AT TIME OF TESTING SEE DTC REPORT. Interior: left and right rear windows tint damaged.

Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to some body panels. Poor alignment to some body panels. Repair work done to vehicle below standard.

Tyres and Rims: Spare tire making model not visible. spare wheel fitted to left rear.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200

Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323599001



CONDITION REPORT



Report No:
2016962636
DATE
30/07/2025

strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323599001



CONDITION REPORT

Report No:
2016962636
DATE
30/07/2025



Brake test.

Diagnostic.

Diagnostic.

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323599001



CONDITION REPORT



Report No:
2016962636
DATE
30/07/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323599001



CONDITION REPORT



Report No:
2016962636
DATE
30/07/2025



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323599001



CONDITION REPORT



Report No:
2016962636
DATE
30/07/2025



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF4770323599001



CONDITION REPORT



Report No:
2016962636
DATE
30/07/2025



Water level



Water level



Front Bumper



Front Bumper



Bonnet



Side Mirror Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323599001



CONDITION REPORT



Report No:
2016962636
DATE
30/07/2025



Front Fender Left



Rear Fender Left



Door Front Left



Door Rear Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323599001



CONDITION REPORT



Report No:
2016962636
DATE
30/07/2025



Rear bumper



Boot Lid / Hatch door



Door Rear Right



Rear Fender Right



Front Fender Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323599001



CONDITION REPORT



Report No:
2016962636
DATE
30/07/2025



Door Handle Front Right



Side Mirror Right



Windscreen



Seat Front Right



Tyre Rear Right



Rebound Rubber Rear Axle Left



CONDITION REPORT



Report No:
2016962636
DATE
30/07/2025



Brake disc 2. Axle left



Brake disc 2. Axle right




Brake Pad/Shoe 2. Axle right



Brake Pad/Shoe 2. Axle left



Control Arm Bush(es) Front Axle Right

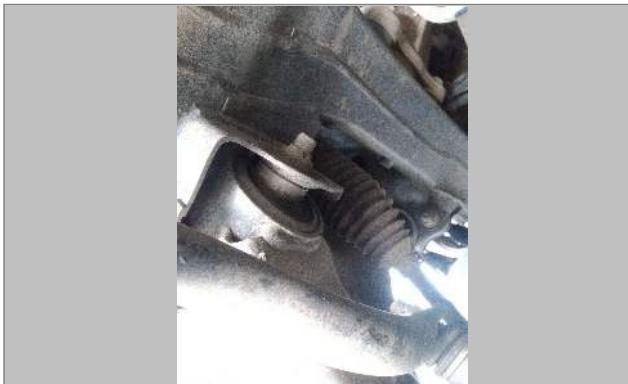

Control Arm Bush(es) Front Axle Left



CONDITION REPORT



Report No:
2016962636
DATE
30/07/2025



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Left



Brake disc 1. Axle right



Brake disc 1. Axle left



Engine



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323599001



CONDITION REPORT



Report No:
2016962636
DATE
30/07/2025



Center Prop Shaft Rubber(s)



Rim Rear Left



Rim Rear Right



Rim Rear Right



Rim Front Left



Rim Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323599001



CONDITION REPORT



Report No:
2016962636
DATE
30/07/2025



Belly plates



Seat Belt Rear Middle



Carpet Rear



Seat Rear



Central Air Vent



Windscreen Wiper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323599001



CONDITION REPORT



Report No:
2016962636
DATE
30/07/2025



Spare Tyre



Rim Spare Wheel



Spare Tyre



Tyre Rear Left



Central Air Vent

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323599001